

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well ☐ gas ☐ well ☒ other **X Plug & Abandon**

2. NAME OF OPERATOR

Seuren Energy Corporation

3. ADDRESS OF OPERATOR

P. O. Box 938, Farmington, New Mexico 874014. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.) **1850' South line & 1745' West line.**AT SURFACE: **Same as above.**AT TOP PROD. INTERVAL: **Same as above.**AT TOTAL DEPTH: **Same as above**

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐CHANGE ZONES ☐ABANDON* ☒

(other)

SUBSEQUENT REPORT OF:

☐☐☐☐☐☐☐☐☐

5. LEASE

Contract No. 105

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Jicarilla Apache

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Jicarilla #2

9. WELL NO.

22

10. FIELD OR WILDCAT NAME

Basin Dakota

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 22, T-36N, R-4W, E.M.F.M.

12. COUNTY OR PARISH

Rio Arriba

13. STATE

New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

7175 Gr.

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Surface pipe (10-3/4", E-40, 32.756) set @ 237 ft. NKB 7/31/78.
Drill 9-7/8" hole to 3519' 8/4/78 and stuck drill pipe and twisted off @ 295' NKB.
Went in hole with overshot & picked up fish 8/5/78. Drill pipe parted again.
Came out of hole and picked up new string of drill pipe. Went in hole and screwed into fish. Brought fish out of hole 8/8/78. Left 3 bit cones in hole.
Fished for cones w/magnet and globe basket and recovered cones. Went back in to condition hole and twisted drill pipe off at 1709' 8/9/78.
Could not mill over or get back onto fish by 8/11/78.
Verbal approval to P & A by Mr. A. R. Kendrick, N.M.O.C.D. and Mr. Jerry Long, U.S.G.S.
Verbal approval given to plug and abandon as follows:
At 1709' NKB Plug w/75 sz of class "B" w/25 CuCl to cover 100' of 9-7/8" hole up to 1609 feet.

(Over)

Subsurface Safety Valve: Make and Type

Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

Original Signed By

SIGNED

Rudy D. Motto


TITLE

Area Superintendent**August 11, 1978**

(This space for Federal or State office use)

TITLE

DATE

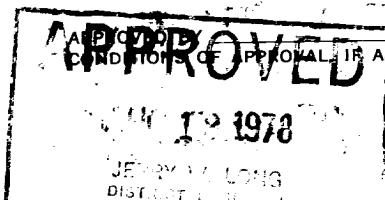

*See Instructions on Reverse Side

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there ~~are~~ ^{are} no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.