

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE\*  
(Other instructions on re-  
verse side)

Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM-8007

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Federal

9. WELL NO.

1 (M17)

10. FIELD AND POOL, OR WILDCAT

Basin Dakota

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 17, T.25N., R.10W.

12. COUNTY OR PARISH  
San Juan

13. STATE  
New Mexico

1.

OIL ☐ GAS ☒  
WELL WELL OTHER

2. NAME OF OPERATOR

Union Oil Company of California

3. ADDRESS OF OPERATOR

P. O. Box 2620 - Casper, WY 82602

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface

1100' FSL & 1185 FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6493' G.L.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON\*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT\*

(Other)


(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

6225' T.D.

Released packer and pulled to 2200'. Set packer. Squeezed Cliff House perms, 2399-2409', 2425-2427', 2431-2433', 2441-2443', 2447-2455', and 2459' with 82 sacks regular cement to maximum standing squeeze pressure of 1700# with no bleed off. Top of cement plug at 2200'. Released packer, reversed tubing, and pulled out of hole laying down tubing. Cut off well head 4' below ground level. Placed 10 sack cement plug in top of casing. Welded plate on casing and installed dry hole marker.

Well plugged & abandoned September 16, 1977.

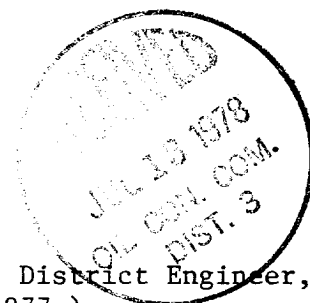

(Verbal approval to plug & abandon recieved from Mr. P. T. McGrath, District Engineer, U.S. Geological Survey, Farmington, New Mexico, on September 13, 1977.)

18. I hereby certify that the foregoing is true and correct

SIGNED

*R. G. Ladd, Jr.*

TITLE District Drilling Supt.

DATE 9-16-77

(This space for Federal or State office use)

APPROVED  
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

JUN 29 1978

P. T. McGRATH

DISTRICT ENGINEER

\*See Instructions on Reverse Side

*20 m d c c*

SEP 19 1977