Form 3160-5 (June 1990)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Budget Bureau No. 1004-0135 Expires: March 31, 1993 5. Lease Designation and Serial No.

FORM APPROVED

NM 76857

6 I Indian, Allottee or Tribe Name

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to deepen or reentry to a different reservoir,
LICE "ADDITION FOR DEDMIT " for such managed

	ON FOR PERMIT" for such proposals	14.11 Unit of CA. Agreement Designation
SUBMIT I	N TRIPLICATE	
	as Well Other	8. Well Name and No. Ginny Corbett Well No. 1
2. Name of Operator		9. API Well No.
Central Resources, Inc.		30-045-27125
3. Address and Telephone No.		10. Field and Pool, or Exploratory Area
P.O. Box 1247, Bloomfield, Nev		Bisti Lower Gallup
4. Location of Well (Footage, Sec., T., R., M		11. County or Parish, State
2310' FSL, 1770' FEL, Sec 31, T		San Juan, New Mexico
	O INDICATE NATURE OF NOTICE, REPORT, OR OTHER	DATA
TYPE OF SUBMISSION	TYPE OF ACTION	
	X Abandonment	Change of Plans
X Notice of Intent	Recompletion	New Construction
	Plugging Back	Non-Routine Fracturing
Subsequent Report	Casing Repair	Water Shut-Off
	Altering Casing	Conversion to Injection
Final Abandonment Notice	Other	Dispose Water
		te: Report results of multiple completion on Well
	Con	npletion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Central Resources, Inc. intends to plug the well in accordance with regulations. Production equipment will be removed and the well will be plugged as specified. Perforate and squeeze will be used unless casing can be recovered over the specified interval or there is evidence cement is in place behind the casing.


Proposed procedure:

- a. Notify the Farmington BLM office at 505-599-8907 24 hours prior to commencement of plugging operations.
- b. Pull all retrievable downhole production equipment.
- c. Set a CIBP at 4750' and spot 50' of cement on top at top of Lower Gallup at 4752'.
- d. Spot a 100' cement plug from 3852' to 3752' across the top of the Mancos at 3802'.
- e. Spot a 100' cement plug from 2618' to 2518' across the top of the Menefee at 2568'.
- f. Spot a 100' cement plug from 1173' to 1073' across the top of the Pictured Cliffs at 1123'.
- g. Spot a 100' cement plug from 333' to 233' across the surface casing shoe at 283'.
- h. Spot a 50' cement plug from 50' to surface.
- i. Cut wellhead and install dry hole marker. Clear and remediate location.

14. I hereby certify that the foregoing is true and cornsigned Rodney L. Sealer	Title District Manager	Date	June 19, 2000
(This space for Federal or State office use) Approved by Conditions of approval, if any:	Title	Date	8/23/00
Title 18 U.S.C. Section 1001, makes it a crime for any persor fictitious or fraudulent statements or representations as to any	knowingly and willfully to make to any depart	ment cr agency of the Ur	nited States any false,

*See Instruction on Reverse Side

CENTRAL RESOURCES, INC.

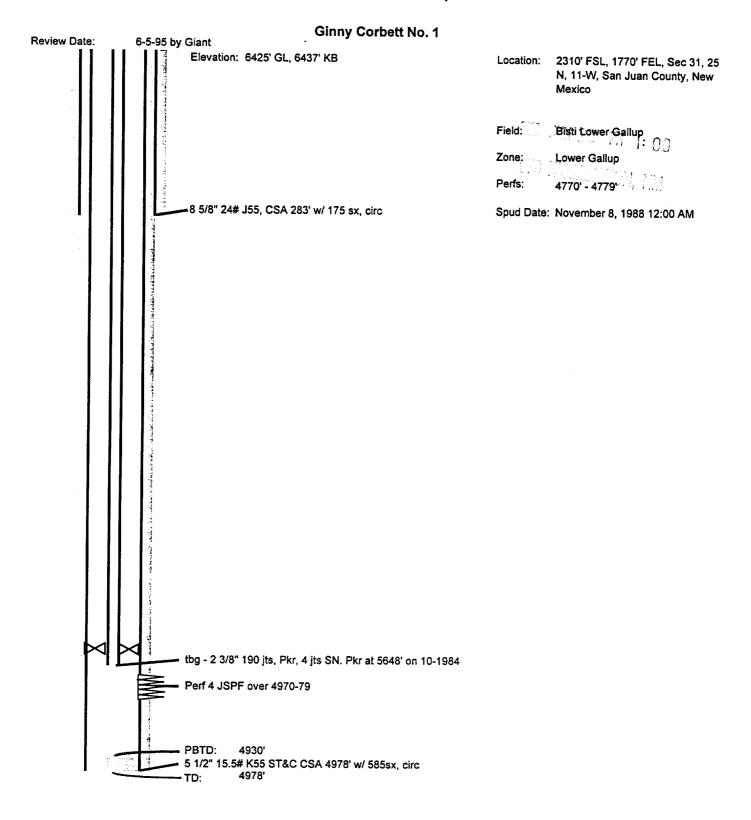

Rod Seale, Printed on 6/19/00