

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT - " for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator


ENERGEN RESOURCES CORPORATION

3. Address and Telephone No.

2198 Bloomfield Highway, Farmington, NM 87401

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

990' FNL, 990' FEL, Sec. 25, T27N, R3W, N.M.P.M.

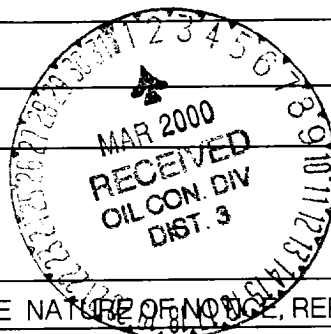

5. Lease Designation and Serial No.

Jic Cont 95

6. If Indian, Allottee or Tribe Name

Jicarilla Apache

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Jicarilla 95 2

9. API Well No.

30-039-06936

10. Field and Pool, or exploratory Area

Gavilan PC/Blanco MV

11. County or Parish, State

Rio Arriba NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Plug PC
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

It is intended to plug the PC in this wellbore as follows:

1. MIRU. Release seal assembly and TOH.
2. TIH and set RBP at 4100'. TOH.
3. TIH with packer to 4000'. Test RBP. Pull up hole to 3600'. Squeeze cement PC perfs with 100 sks cement. WOC.
4. TOH. TIH with bit. Drill out cement. Test squeeze to 500 psi. TOH.
5. TIH and retrieve RBP. TOH.
6. TIH with packer milling assembly. Mill out Model D at 5649'. TOH.
7. Clean out to 6260' with air mist. Land tubing at 6150'. Return to production.

14. I hereby certify that the foregoing is true and correct

Signed Monica Papp

Title Production Assistant

Date 1/26/00

(This space for Federal or State office use)

Approved by [Signature]

Title Lands and Mineral Resources

Date 2/24/00

Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

* See Instruction on Reverse Side