


UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

Sundry Notices and Reports on Wells

JUN 14 PM 3:42

1. Type of Well  
GAS
2. Name of Operator  
**BURLINGTON RESOURCES** OIL & GAS COMPANY
3. Address & Phone No. of Operator  
PO Box 4289, Farmington, NM 87499 (505) 326-7000
4. Location of Well, Footage, Sec., T, R, M  
1610' FSL, 1550' FEL, Sec. 34, T-27-N, R-4-W, NMPM
5. Lease Number  
SF-079607
6. If Indian, All. or Tribe Name
7. Unit Agreement Name
8. Well Name & Number  
Carson #1
9. API Well No.  
30-039-20831
10. Field and Pool  
Tapacito Pict. Cliffs
11. County and State  
Rio Arriba Co, NM

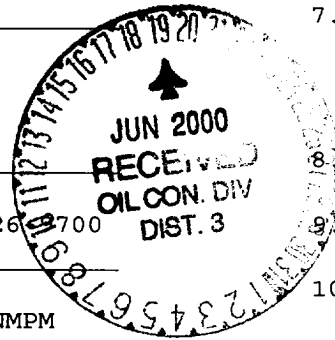

## 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

## Type of Submission

## Type of Action

- |   |   |  |
|---|---|--|
| <input type="checkbox"/> Notice of Intent             | <input checked="" type="checkbox"/> Abandonment | <input type="checkbox"/> Change of Plans         |
| <input checked="" type="checkbox"/> Subsequent Report | <input type="checkbox"/> Recompletion           | <input type="checkbox"/> New Construction        |
| <input type="checkbox"/> Final Abandonment            | <input type="checkbox"/> Plugging Back          | <input type="checkbox"/> Non-Routine Fracturing  |
|   | <input type="checkbox"/> Casing Repair          | <input type="checkbox"/> Water Shut off          |
|   | <input type="checkbox"/> Altering Casing        | <input type="checkbox"/> Conversion to Injection |
|   | <input type="checkbox"/> Other -                |  |

## 13. Describe Proposed or Completed Operations

- 5-30-00 MIRU. ND WH. NU BOP. TIH w/2 1/4" gauge ring to 3610'. TOOH. TIH w/1 1/4" tbg to 3931'. (Verbal approval to change plans from Ron Snow, BLM). Establish circ w/9 bbl wtr. Plug #1: pump 22 sx Class "B" neat cmt @ 3133-3931'. TOOH. WOC. SDON. (Ron Snow, BLM on location).
- 5-31-00 TIH, tag Plug #1 @ 3819'. Load hole w/2 bbl wtr. PT csg to 500 psi, failed. Plug #2: pump 20 sx Class "B" neat cmt inside csg @ 3093-3819'. TOOH. WOC. TIH, tag Plug #2 @ 3100'. Load csg w/1 bbl wtr. PT csg to 500 psi, failed. TOOH. TIH, perf 2 sqz holes @ 2380'. TOOH. Attempt to establish injection. (Verbal approval to change plans from Ron Snow, BLM). Establish circ. TIH to 2449'. Load csg w/0.5 bbl wtr. Plug #3: pump 10 sx Class "B" neat cmt @ 2086-2449'. TOOH. WOC. TIH, tag Plug #3 @ 2107'. TOOH. TIH, perf 2 sqz holes @ 185'. TOOH. Establish circ down csg & out bradenhead w/19 bbl wtr. Plug #4: pump 79 sx Class "B" neat cmt down csg & out bradenhead. Circ 1 bbl cmt to surface. WOC. ND BOP. Cut off WH. Install dry hole marker w/10 sx Class "B" neat cmt. (Ron Snow, BLM on location). SDON.
- 6-1-00 RD. Rig released.

## 14. I hereby certify that the foregoing is true and correct.

Signed *Regan Cole* Title Regulatory Supervisor Date 6/13/00  
no

ACCEPTED FOR RECORD

(This space for Federal or State Office use)

APPROVED BY \_\_\_\_\_ Title \_\_\_\_\_ Date \_\_\_\_\_  
CONDITION OF APPROVAL, if any: \_\_\_\_\_