


Form 9-381a
(Feb. 1951)

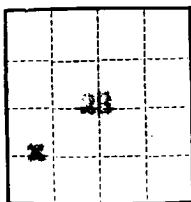

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 078091
Unit Federal Douthitt

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<u>Sand Frac</u>	<u>xx</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Well No. Douthitt is located 660 ft. from N line and 660 ft. from E line of sec. 23
6-2

Dist. 23 (Dist. No.) 660 (Twp.) 13 (Range) New Mexico (Section)
District (Field) San Juan (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 6301 ft. 61

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Pulled 164 jts. 2" thg. Cleaned out sand. Set bridge plug at 5047'. Loaded hole w/120 bbls oil, broke down formation w/20 bbls. oil at 40 bbls. per minute - 2200 psi. Sandfracked w/30,000 sand in 30,000 gallons oil using 50 balls after first 15,000 gallons. Pressure increased from 2200 psi to 2250 psi when balls hit perforations. Flushed w/140 bbls. oil. Final flush pressure 2300 psi. Total load oil used 1,000 bbls. Subbed hole clean. Drilled & drove bridge plug to 5115' KB. Landed 2" EUE tubing @ 5050' KB. Perforated nipple @ 5017.20' to 5019.98'. Pump sent at 5016' KB.

Test Before Workover 31 BO - 10 BW - GOR 965

Test After Workover 46 BO - 17.6 BW - GOR 1174

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company The British-American Oil Producing Company

Address Box 180

Denver 1, Colorado

By

Title District Superintendent