

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY


SUBMIT IN TRIPPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		5. LEASE DESIGNATION AND SERIAL NO. 076092	
2. NAME OF OPERATOR The British-American Oil Producing Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR P. O. Drawer 330, Farmington, New Mexico		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1980' FSL and 1980' FWL		8. FARM OR LEASE NAME Donthit #2	
		9. WELL NO. 3	
		10. FIELD AND POOL, OR WILDCAT Blair Gallup	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 29-26N-13W	
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6534 GL	12. COUNTY OR PARISH San Juan	13. STATE New Mexico

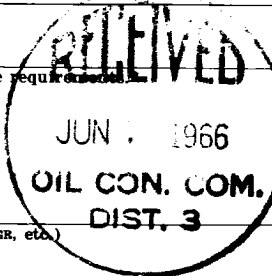

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☒
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

4-26-66 Moved in and rigged up pulling unit. Pulled tubing and rods. Rigged up Dunn oil tools and drilled bridge plug to 5329'.

5-24-66 Moved in and rigged up Bedford, Inc. Pumped in 40 BW to establish rate.

5-25-66 Mixed and spotted 20 sack cement plug across perforations. Pumped bottom plug to 5210. Shut down for 4 1/2 hours. Rigged up jacks and started working casing.

5-26-66 Worked casing. Attempted to shoot off at 2782' and 2493', shot casing off at 2242'. Pulled 5 1/2" casing to 1700'.

5-27-66 Spotted 30 sack cement plug in and out of pipe stub. Spotted 40 sack cement plug from 1500 - 1600'. Laid down 5 1/2" casing. Spotted 10 sack cement plug in surface. Erected dry hole marker. Well is P&A.

Your office will be advised when location is cleaned up and ready for inspection.

18. I hereby certify that the foregoing is true and correct


SIGNED Na R. Stone TITLE Field Supt. DATE 6-2-66

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

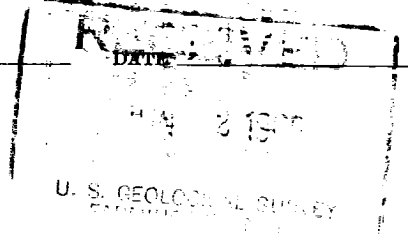

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, or all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1957 O-685229
847-851