

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

**SUBMIT IN TRIPLICATE**

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

J. K. EDWARDS ASSOCIATES, INC. 011307

3. Address and Telephone No. c/o Walsh Engr. & Prod. Corp.

7415 E. Main Farmington, New Mexico 87402

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Unit O, 790'FSL and 1850'FEL  
Section 2, T26N, R12W

5. Lease Designation and Serial No.

NM-16471

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Bengal B #1

9. API Well No.

10. Field and Pool, or Exploratory Area

Gallegos Gallup

11. County or Parish, State

San Juan County, N.M.

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent  
☐ Subsequent Report  
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☐ Other

- ☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

J. K. EDWARDS ASSOCIATES proposes to plug and abandon this well according to the attached procedure.

RECEIVED  
FEB - 9 1995  
OIL CON. DIV.  
BUREAU

14. I hereby certify that the foregoing is true and correct

Signed Paul C. Thompson

Title Paul C. Thompson, Agent

Date 1/23/95

(This space for Federal or State office use)

Approved by \_\_\_\_\_  
Conditions of approval, if any:

Title \_\_\_\_\_

APPROVED  
AS AMENDED

FEB 28 1995  
DISTRICT MANAGER



January 23, 1995


J. K. EDWARDS ASSOCIATES INC.  
Bengal B #1  
790' FSL & 1850' FEL, Section 2, T26N, R12W  
San Juan County, New Mexico

P & A PROCEDURE

1. MOL & RU. Hold safety meeting. TOH with 122 5/8" rods, 78 3/4" rods and RWBC Pump.
2. ND wellhead and NU BOP. Pull and stand back 153 jts of 2-1/16" IJ tubing.
3. Pump Plug #1 (120 sx - 142 cuft) down the 2-7/8" tubing. Squeeze into Gallup perms. Displace cement to 4562'.
4. Find freepoint on 2-7/8" and back off. TOH and lay down 2-7/8" tubing.
5. TIH with 2-1/16" to 50' inside of 2-7/8" stub.
6. Pump Plug #2 (10 sx - 12 cuft) down 2-1/16" tubing. Displace cement to 50' above 2-7/8" stub.
7. POH to 50' above 2-7/8" stub and spot 9#/gal mud to 1276'.
8. POH to 1276' and pump Plug #3 (20 sx - 24 cuft). Displace cement to 1176'.
9. POH to 1176' and spot 9#/gal mud to 476'.
10. POH to 476' and pump Plug #4 (20 sx - 24 cuft). Displace cement to 376'.
11. POH to 376' and spot 9#/gal mud to 150'.
12. POH to 150' and pump Plug #5 (25 sx - 30 cuft) to surface.
13. POH with tubing.
14. ND BOPS. Cut off wellhead. Install P & A marker per BLM specs. Rig down and move off location.
15. Restore location to BLM stipulations.

J. K. EDWARDS ASSOCIATES, INC.  
Bengal B #1  
790'FSL & 1850'FEL, Section 2, T26N, R12W  
San Juan County, New Mexico

Current Status

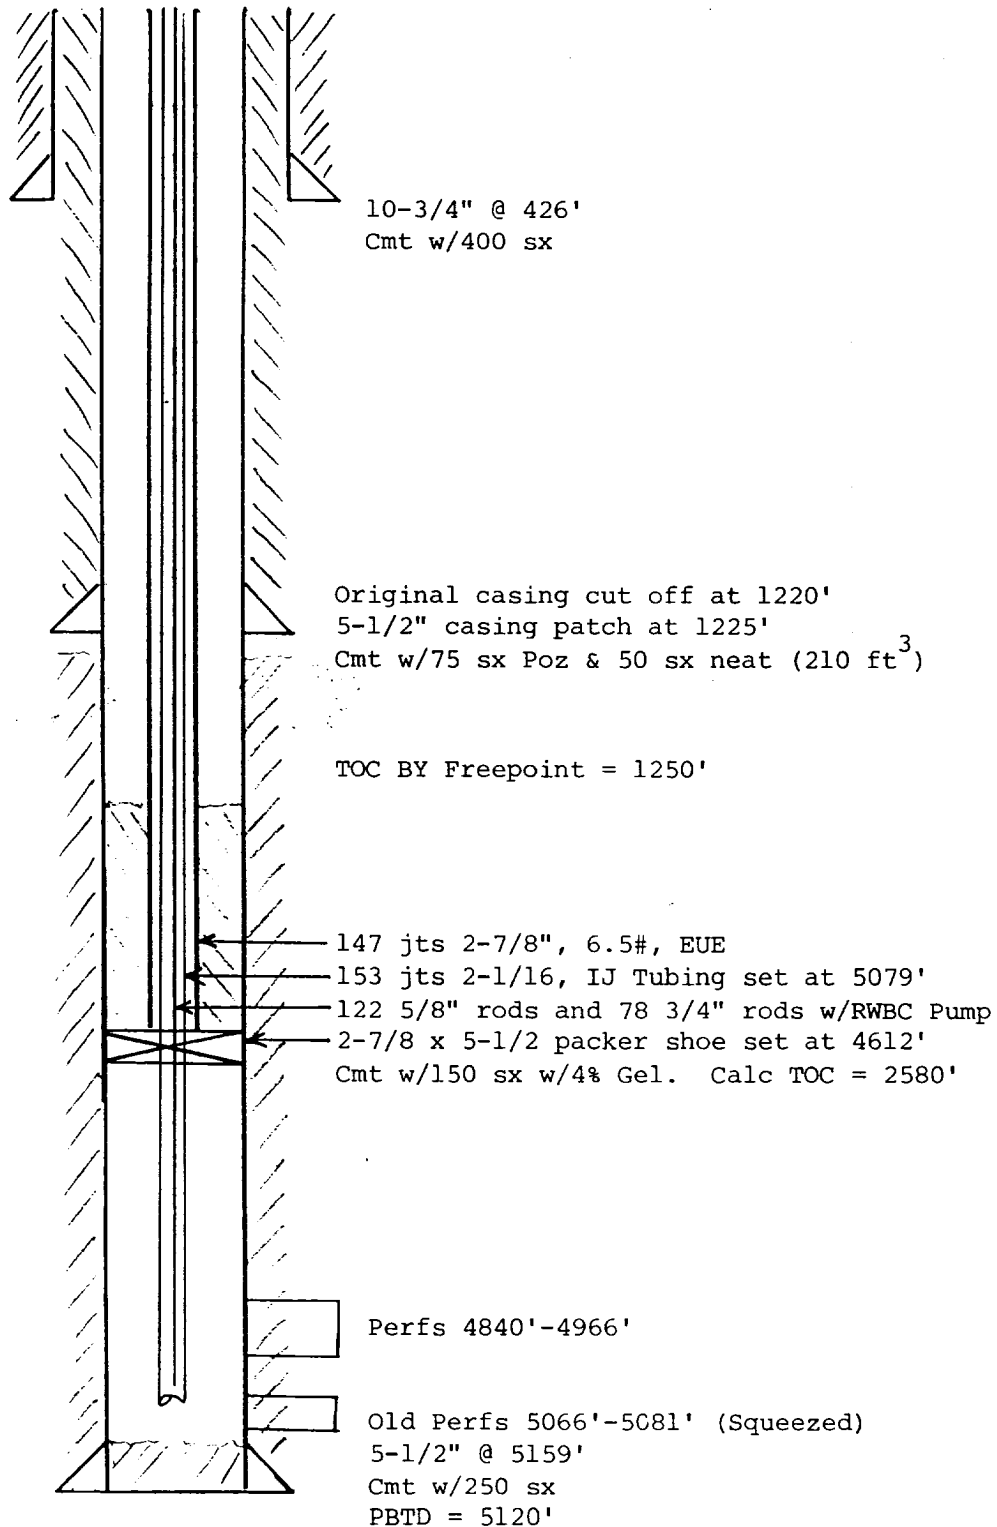

J. K. EDWARDS ASSOCIATES INC.  
Bengal B #1  
790'FSL & 1850'FEL, Section 2, T26N, R12W  
San Juan County, New Mexico

Plugged and Abandoned

