

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT" for such proposals.)


1. NAME OF OPERATOR ☒ OIL WELL ☐ GAS WELL ☐ OTHER		2. NAME OF OPERATOR Skelly Oil Company		3. ADDRESS OF OPERATOR 1860 Lincoln Street - Denver, Colorado 80203		4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) 1980' FNL & 660' FEL of Section 4-26N-12W		14. PERMIT NO. 6015' KB	
7. UNIT AGREEMENT NAME Gallagos Gallup Sand Unit		8. FARM OR LEASE NAME Gallagos Gallup		9. WELL NO. 19		10. FIELD AND POOL, OR WILDCAT 19		11. SEC., T., R., M., OR BLM. AND SURVEY OR AREA Sec. 4-26N-12W	
6. IF INDIAN, ALLOTTEE OR TRIBE NAME SF-078286		12. COUNTY OR PARISH San Juan		13. STATE New Mexico					

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data
SUBSEQUENT REPORT OF:

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)		18. I hereby certify that the foregoing is true and correct	
TEST WATER SHUT-OFF FRACTURE TREAT SHOOT OR ACIDIZE REPAIR WELL (Other)		PULL OR ALTER CASING MULTIPLE COMPLETE ABANDON CHANGE PLANS (Other)	
WATER SHUT-OFF FRACTURE TREATMENT SHOOTING OR ACIDIZING ABANDONMENT ALTERING CASING REPAIRING WELL (Other)		Completion or Recommendation Report and Log form. (NOTE: Report results of multiple completion on well)	

This well reached the economic limit and no longer is profitable to operate.
Plans are to plug and abandon this well and plug as follows:

First Plug - Across Gallup zone perts. 5144'-5144' filling up 50' to 5064'.
Second Plug - 50' inside 5 1/2" casing and 50' above where casing is shot in two.
Third Plug - 100' plug above top of Mesa Verde formation (unless production casing is left remaining through this zone).
Fourth Plug - 100' plug at the bottom of Ojo Alamo Sand (unless surface casing is set through the Ojo Alamo Sand).
10 sacks of cement in top of surface casing with dry hole marker.

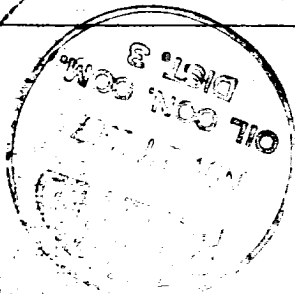

18. I hereby certify that the foregoing is true and correct

SIGNED: *W. F. ...* TITLE: District Superintendent DATE: Nov. 17, 1967

(This space for Federal or State office use)

APPROVED BY: TITLE: CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

NOV 22 1967

*See Instructions on Reverse Side