

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-B1424.

5. LEASE DESIGNATION AND SERIAL NO.

M 02874-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

Huerfano Unit

8. FARM OR LEASE NAME

Huerfano Unit

9. WELL NO.

151

10. FIELD AND POOL, OR WILDCAT

Huerfano

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 35, T-26-N, R-10-W

N.M.P.M.

12. COUNTY OR PARISH 13. STATE

San Juan

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR	8. FARM OR LEASE NAME
El Paso Natural Gas Company	Huerfano Unit
3. ADDRESS OF OPERATOR	9. WELL NO.
Box 990, Farmington, New Mexico	151
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface	10. FIELD AND POOL, OR WILDCAT
1650' N, 1090' W	Huerfano
14. PERMIT NO.	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
	Sec. 35, T-26-N, R-10-W
15. ELEVATIONS (Show whether DF, RT, GR, etc.)	12. COUNTY OR PARISH 13. STATE
677.01	San Juan New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

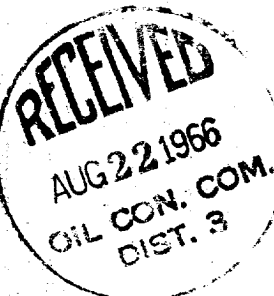
(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

On 8-9-66: Total depth 6868'. Ran 212 joints 4 1/2", 10.5% J-55 casing, 6864.35' set at 6867.85'. Flout collar at 6835', 2nd stage collar at 4984'; 3rd stage collar at 2236'. Cemented 1st stage with 210 sacks 50/50 pozzolone and class "A" cement with 2% calcium chloride and 1/4# finetuff-plug/sk. 2nd stage with 270 sacks class "C" cement, 1/4 gal, 1/4 cu. ft. Strata-Crete "6"/sk. 3rd stage with 125 sacks class "C" cement, 1/4 gal, 1/4 cu. ft. Strata-Crete "6"/sk.

RECEIVED

AUG 19 1966

U. S. GEOLOGICAL SURVEY
FARMINGTON, N. M.

18. I hereby certify that the foregoing is true and correct

SIGNED Original Signed F. H. WOOD

TITLE Petroleum Engineer

DATE August 14, 1966

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.