

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	5. LEASE DESIGNATION AND SERIAL NO. 14-20-603-5034
2. NAME OF OPERATOR PAN AMERICAN PETROLEUM CORPORATION	6. INDIAN, ALGONQUIAN OR TRIBE NAME Navajo Tribal
3. ADDRESS OF OPERATOR 531 Airport Drive, Farmington, New Mexico - 87401	7. UNIT AGREEMENT NAME Navajo Tribal
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660' FSL & 660' FSL	8. FARM OR LEASE NAME Navajo Tribal
14. PERMIT NO.	9. WELL NO. 6
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 5630' Gr, 5652' RBN	10. FIELD AND POOL, OR WILDCAT Tocito Dome Penn
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 22/4 S 22/4 Section 22, T-26-N, R-18-W
	12. COUNTY OR PARISH San Juan
	13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETION

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*


(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

In an attempt to decrease water production and increase oil production from the above mentioned well, we plan to:

1. Pull rods, pump and tubing.
2. Circulate hole clean.
3. Run Lifetime Neutron Log.
4. Set Baker Model "B" cement retainer at 6175'.
5. Squeeze present perfs (6182-88 x 4 - 100) with 100 sx Class "C".
6. Perforate 1' interval from logs above present perfs.
7. Wash perfs with 500 gallons 15% HCL.
8. SWP and place the well on test.

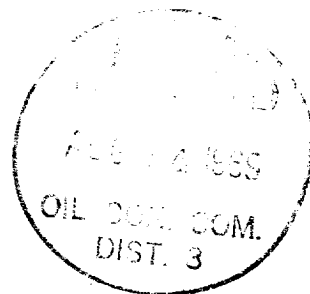

RECEIVED

AUG 13 1969

U. S. GEOLOGICAL SURVEY
FARMINGTON, N. M.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Area Engineer

DATE

August 12, 1969

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations; and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.