

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Place instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

DESIGNATION AND SERIAL NO.

SP 075557

IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR
El Paso Natural Gas Company

3. ADDRESS OF OPERATOR
Box 990, Farmington, New Mexico 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

800'N, 300'W

7. UNIT AGREEMENT NAME

Huerfano Unit

8. FARM OR LEASE NAME

Huerfano Unit

9. WELL NO.

215

10. FIELD AND POOL, OR WILDCAT

Basin Dakota

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

**Sec. 29, T-26-N, R-10-W
N. M. P. M.**

14. PERMIT NO.

15. ELEVATIONS (Show whether DE, RT, GR, etc.)

6498' GL.

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

FULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☒

REPAIRING WELL

☐
☐
☐
☐

FRACTURE TREATMENT

☒

ALTERING CASING

SHOOTING OR ACIDIZING

☐

ABANDONMENT*

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

2-9-71 Spudded well.

2-10-71 Ran 6 joints 3 5/8", 24#, J-55 casing (200') set at 215' w/160 sacks of cement circulated to surface. W.O.C. 12 hours. Held 600#/30 Min.

2-24-71 T. D. 6551'. Ran 203 joints 4 1/2", HX 10.5#, J-55 casing (6540') set at 6551'. Float collar at 5540'. Second stage tool at 4541', third stage at 2114'. Cemented first stage w/260 sacks, second stage w/210 sacks, third stage would not open. W.O.C. 18 hours.

2-25-71 P.B.T.D. 6540'. Perf. 6366-72', 6408-26', 6476-82', 6510-22' w/18 SPZ. Frac w/50,000# 20/40 sand, 50,000 gal. water. Dropped 3 sets of 18 balls each. Flushed w/110 bbls. water. Set bridge plug at 5007', perforated squeeze hole at 2140'. Set retrievable packer at 1941'. Squeezed through perfs at 2140' w/205 sacks cement.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE **Petroleum Engineer**

DATE **3-3-71**


(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

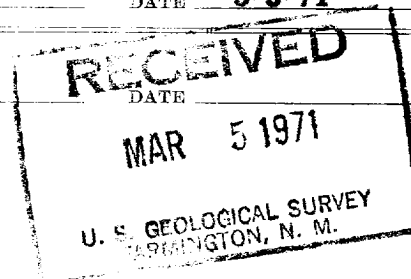

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.