

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE\*  
(Other instructions on re-  
verse side)Form approved  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF-078481-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Graham

9. WELL NO.

1A

10. FIELD AND POOL, OR WILDCAT

Blanco Mesaverde

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 4, T27N, R8W

12. COUNTY OR PARISH 13. STATE

San Juan N. Mex.

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Great Lakes Chemical Company

3. ADDRESS OF OPERATOR c/o Minerals Management Inc.

501 Airport Dr., Suite 105, Farmington, N. Mex. 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface

790' FEL, 880' FSL, Section 4, T27N, R8W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5973 GR - 5985 RT

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON\*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT\*


(Other) Production casing

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

4-19-76

Ran 113 jts. 5 1/2", 15.5#, K-55, ST&C casing. Set at 4650' KB.  
DV tool at 3336'. Cement 1st stage with 185 sx 50-50 pozmix with  
2% Gel with 2 1/2# Gilsonite per sx and 50 sx Class "B" Cement.  
Open DV tool and circulate 4 hours. Cement 2nd stage with 600 sx  
Halliburton Lite with 10# Gilsonite per sx and 50 sxs Class "B"  
Cement.

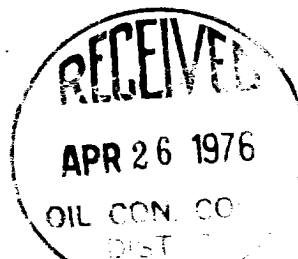

RECEIVED

APR 23 1976

U. S. GEOLOGICAL SURVEY  
FARMINGTON, N. M.

18. I hereby certify that the foregoing is true and correct

SIGNED

*J. Arnold Smith*

Area Manager

TITLE Minerals Management Inc. DATE 4-22-76

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side