

Form 9-331
(May 1963)UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 1336

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Monticello

9. WELL NO.

ly

10. FIELD AND POOL, OR WILDCAT

WAW - Pictured Cliffs

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec 3, T26N, R13W

12. COUNTY OR PARISH 13. STATE

San Juan

NM

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Dugan Production Corp.

3. ADDRESS OF OPERATOR

Box 234, Farmington, NM 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1170' FNL - 1450' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6201' GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

Completion

X

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

9-21-77

Moved in and rigged up Farmington Well Service swabbing unit. Blue Jet ran gamma-ray correlation and collar log. Swabbed 2-7/8" csg down to 1100'. Perf w/l 2-1/8" glass jet/ft 1359-1371' (12 holes). Swabbed csg, well making est 100 MCFGPD. Treated perfs by Allied Services w/250 gals 15% HCl reg acid. Breakdown pressure 2000 psi. Avg treating pressure 1400 psi. Flushed w/8 bbls wtr. Made 2 swab runs. Well kicked off making est 300 MCFGPD. Left flowing to atmosphere for 2 hrs.

9-22-77

Ran 43 jts 1-1/4" OD 2.3# J-55 Buttress IJ tbg w/cross pin in btm jt for swab stop. TE 1365.64' set @ 1363' GR. Nippled up wellhead and blew well for 2 hrs thru tbg. Well making est 125 MCFGPD. Shut-in.

18. I hereby certify that the foregoing is true and correct

SIGNED

Jim L. Jacobs

TITLE

Geologist

DATE

9-27-77


(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

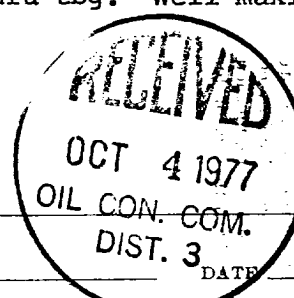

SEP 28 1977