




LOCATE WELL CORRECTLY

U. S. LAND OFFICE Santa Fe
SERIAL NUMBER 077304
LEASE OR PERMIT TO PROSPECT
Madeline H. Galt

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

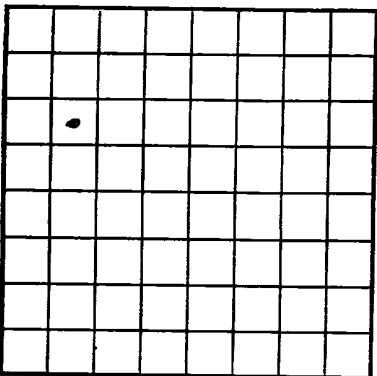

LOG OF OIL OR GAS WELL

Company Stanolind Oil and Gas Co. Address Box 591, Tulsa, Oklahoma
Lessor or Tract Madeline H. Galt Field Fulcher-Kate State New Mexico
Well No. G-1 Sec. 1 T. 27-N R. 10-W Meridian NPM County San Juan
Location 1787 ft. [S.] of N Line and 895 ft. [E.] of N Line of Section 1 Elevation 6040
(Denotes floor relative to sea level)

The information given herewith is a complete and correct record of the well and all work done thereon so far as can be determined from all available records.

Signed H. O. Spurr
Title Production Foreman

Date August 13, 1951 Title Production Foreman

The summary on this page is for the condition of the well at above date.

Commenced drilling July 2, 1951 Finished drilling July 9, 1951

OIL OR GAS SANDS OR ZONES

(Denote gas by G)

No. 1, from 1989 to 2073 (G) No. 4, from _____ to _____
No. 2, from _____ to _____ No. 5, from _____ to _____
No. 3, from _____ to _____ No. 6, from _____ to _____
IMPORTANT WATER SANDS
No. 1, from _____ to _____ No. 3, from _____ to _____
No. 2, from _____ to _____ No. 4, from _____ to _____

CASING RECORD

Size casing	Weight per foot	Threads per inch	Make	Amount	Kind of shoe	Cut and pulled from	Perforated		Purpose
							From—	To—	
<u>9"</u>	<u>24</u>	<u>8</u>	<u>National</u>	<u>110'</u>	<u>Slip Type</u>				
<u>5 1/2"</u>	<u>17</u>	<u>8</u>	<u>National</u>	<u>200'</u>	<u>Open End</u>				
<u>1"</u>	<u>1.68</u>	<u>11 1/2</u>	<u>Reg.</u>	<u>200'</u>	<u>Float Shoe</u>		<u>2073</u>	<u>2094</u>	<u>Siphon String</u>

MUDDING AND CEMENTING RECORD

Size casing	Where set	Number sacks of cement	Method used	Mud gravity	Amount of mud used
<u>9"</u>	<u>118'</u>	<u>75</u>	<u>Displacement</u>		
<u>5 1/2"</u>	<u>1995'</u>	<u>75</u>	<u>Displacement</u>		

PLUGS AND ADAPTERS

Heaving plug—Material _____ Length _____ Depth set _____
Adapters—Material _____ Size _____

SHOOTING RECORD

Size	Shell used	Explosive used	Quantity	Date	Depth shot	Depth cleaned out
<u>1 1/2" Sp Shot</u>		<u>300</u>	<u>482</u>	<u>7-17-51</u>	<u>2072-2006</u>	<u>2102</u>

TOOLS USED

Rotary tools were used from 0 feet to 2132 feet, and from _____ feet to _____ feet
Cable tools were used from 1980 feet to 2102 (Cleaning Out) feet and from _____ feet to _____ feet

DATES

August 2, 1951 Put to producing _____, 19____
The production for the first 24 hours was _____ barrels of fluid of which _____ % was oil; _____ %
emulsion; _____ % water; and _____ % sediment. Gravity, °Bé. _____
If gas well, cu. ft. per 24 hours 648,000 Gallons gasoline per 1,000 cu. ft. of gas _____
Rock pressure, lbs. per sq. in. 474

EMPLOYEES

John C. Poelm, Driller H. H. Sutton, Driller
C. E. Romaine, Driller _____, Driller

FORMATION RECORD

FROM—	TO—	TOTAL FEET	FORMATION
<u>0</u>	<u>122</u>	<u>122</u>	<u>Surface sands and gravel</u>
<u>122</u>	<u>1980</u>	<u>1858</u>	<u>Sand and shale</u>
<u>1980</u>	<u>1989</u>	<u>9</u>	<u>Coal</u>
<u>1989</u>	<u>2073</u>	<u>84</u>	<u>Sand (TPC - 1989)</u>
<u>2073</u>	<u>2132</u>	<u>59</u>	<u>Shale and shaley sand</u>

(OVER)

16-43094-2

