

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well gas well other _____

2. NAME OF OPERATOR
Amoco Production Company

3. ADDRESS OF OPERATOR
501 Airport Drive Farmington, NM 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1570' FSL X 1840' FEL
AT TOP PROD. INTERVAL: same
AT TOTAL DEPTH: same

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

5. LEASE
SF-079596

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Martin Gas Com "G"

9. WELL NO.
1E

10. FIELD OR WILDCAT NAME
Basin Dakota

11. SEC., T., R., M. OR BLK. AND SURVEY OR AREA
NW/4, SE/4 Section 14, T27N, R10W

12. COUNTY OR PARISH
San Juan

13. STATE
New Mexico

14. API NO.
30-045-24205

15. ELEVATIONS (SHOW DF, KDB, AND WD)
6393' GL


REQUEST FOR APPROVAL TO:	SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF <input type="checkbox"/>	<input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	<input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	<input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	<input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	<input type="checkbox"/>
MULTIPLE COMPLETE <input type="checkbox"/>	<input type="checkbox"/>
CHANGE ZONES <input type="checkbox"/>	<input type="checkbox"/>
ABANDON* <input type="checkbox"/>	<input type="checkbox"/>
(other) <u>completion</u>	

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Completion operations commenced on 7-14-80. Total depth of the well is 6952' and plugback depth is 6914'. Perforated intervals 6677-6691', 6718-6725', and 6763-6800' with 2 spf, a total of 116, .38" holes. Land 2-3/8" tubing 6804', blew the well dry with air. Released the rig on 7-16-80 and put the well on flow test.

Moved in and rigged up service unit again on 8-5-80 and pulled tubing. Sand-water fraced with 78,000 gal frac fluid and 266,000# 20-40 sand. Landed 2-3/8" tubing at 6804', swabbed the well and released the rig on 8-7-80.

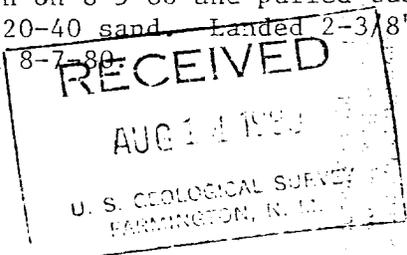

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct
Original Signed By
SIGNED E. E. SVOBODA TITLE Dist. Adm. Supvr. DATE 8-13-80

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

NMOCC

*See Instructions on Reverse Side

Handwritten initials