

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 078423

6. IF INDIAN, ALLOTTEE OR TRIBE NAME


SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL GAS WELL OTHER

2. NAME OF OPERATOR
El Paso Natural Gas Company

3. ADDRESS OF OPERATOR
Box 990, Farmington, New Mexico 87401

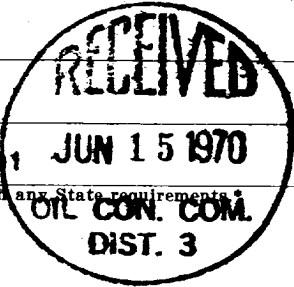

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
1350'S, 905'W

7. UNIT AGREEMENT NAME
San Juan 29-7 Unit

8. FARM OR LEASE NAME
San Juan 29-7 Unit

9. WELL NO.
86 (QWVQ)

10. FIELD AND POOL, OR WILDCAT
Blanco Mesa Verde

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 17, T-29-N, R-7-W
N.M.P.M.

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6346' GL

12. COUNTY OR PARISH 13. STATE
Rio Arriba New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)
PULL OR ALTER CASING
MULTIPLE COMPLETE
ABANDON*
CHANGE PLANS

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other) Squeeze
REPAIRING WELL
ALTERING CASING
ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

On 5-29-70 cut off stuck tubing at 5297', pulled tubing, set cement retainer at 5081'. Squeezed open hole w/150 sacks of cement. Perforated squeeze hole at 2495', set cement retainer at 2448', squeezed thru perf. w/125 sacks of cement.

On 6-2-70 T.D. 6033'. Ran 186 joints 4 1/2", 10.5#, K-55 casing (6027') set at 6033' w/125 sacks of cement. W.O.C. 18 hours.

On 6-3-70 P.B.T.D. 6022'. Perf. 5764-70', 5784-96', 5815-27', 5864-73', 5912-18', 5970-74 5994-6000' w/16 SPZ. Frac w/80,000# 20/40 sand, 38,000 gal. water, dropped 3 sets of 16 balls, flushed w/4030 gal. water. Set baffle at 5438', tested O, K. Perf. 5250-58', 5301-07', 5334-46', 5374-86' w/16 SPZ. Frac w/44,000# 20/40 sand, 37,900 gal. water, dropped 3 sets of 16 balls, flushed w/3600 gal. water.

18. I hereby certify that the foregoing is true and correct

SIGNED Original Signed J. H. WOOD

TITLE Petroleum Engineer

DATE 6-11-70

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

