

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

FORM APPROVED
OMB NO. 1004-0135

Expires: November 30, 2000

5. Lease Serial No.
SF-078951

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement Name and/or No.

8. Well Name and No.
SAN JUAN 29-7 UNIT 79B

9. API Well No.
3003926222

10. Field and Pool, or Exploratory Area
BLANCO MV/BASIN DK

11. County or Parish, and State
RIO ARRIBA NM

SUBMIT IN TRIPLICATE - Other instructions on reverse side.

1. Type of Well ☐ Oil Well ☒ Gas Well Other

2. Name of Operator
BURLINGTON RESOURCES OIL & GAS

3a. Address 3401 EAST 30TH
FARMINGTON, NM 87402

3b. Phone No.(include area code)
505.326.9727

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1850FWL 1500FSL


K-5-29-7

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
☐ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
☒ Subsequent Report	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	☐ Well Integrity
☐ Final Abandonment Notice	☐ Casing Repair	☐ New Construction	☐ Recomplete	☒ SUBCOM
	☐ Change Plans	☐ Plug and Abandon	☐ Temporarily Abandon	
	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

(3-7-01) MIRU. ND WH. NU BOP. SDON.(3-8-01) TOO H w/1 1/2" Mesaverde tbg. TIH, CO to pkr @ 5473'. SDON.(3-9-01) Blow well & CO. TOO H w/1 1/2" Dakota tbg & seal assembly. SDON.(3-10-01) TIH w/4 3/4" mill. Mill out 5 1/2" Model "D" pkr. SD for weekend.(3-12-01) TOO H w/pkr & mill. TIH, blow well & CO. SDON.(3-13-01) Blow well & CO. TOO H. TIH w/234 jts 2 3/8" 4.7# J-55 EUE tbg, landed @ 7336'. (SN @ 7334'). ND BOP. NU WH. RD. Rig released. Well will produce as a Mesaverde/Dakota commingle under DHC-298az.

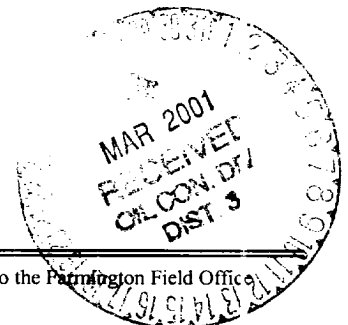

Electronic Submission #2997 verified by the BLM Well Information System for BURLINGTON RESOURCES OIL & GAS Sent to the Farmington Field Office
Committed to AFMSS for processing by Maurice Johnson on 03/20/2001

Name (Printed/Typed) PEGGY COLE

Title REPORT AUTHORIZER

Signature

Date 03/14/2001

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By

Title

MAR 22
Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office