

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424

5. LEASE DESIGNATION AND SERIAL NO.

SF 08246

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Florence

9. WELL NO.

42

10. FIELD AND POOL, OR WILDCAT

Blanco Mesaverte

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREASW/4 Section 27,
T. 29 N., R. 9 W.

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

1. OIL ☐ GAS ☒ OTHER
WELL WELL

2. NAME OF OPERATOR

Tenneco Oil Company

3. ADDRESS OF OPERATOR

P. O. Box 1714, Durango, Colorado

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

953' FSL 853' FwL Section 27, T. 29 N., R. 9 W.

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5609' GL

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL


ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Moved in workover rig, blew well down. Ran 7" retainer. Set at 3740'. Tested 7" casing to 500 psi, held ok. Squeeze cemented open hole with 350 sacks cement. WOC 18 hours. Drilled out cement to 3484'. Set whipstock at 3478' and re-drilled to T.D. of 4600'. Ran 144 jts 9.5# 4-1/2" casing. Landed at 4600'. Cemented in two stages with DV tool at 3400'. First stage, cemented with 170 sacks cement. Second stage with 135 sacks cement circulated to surface. Cleaned out to T.D. Perforated 3 holes each at 4548, 4494, 4419, 4411, 4397, 4381, 4528 and 2 holes each at 4471, 4449, 4432. Fraced with 50,000 gallons water and 50,000 lbs. 20-40 sand. Perforated with 3 holes each at 4053, 3994, 3873, 3845, 3817, 3764, 4136 and 2 holes each at 4026, 3949, 3926, 3911, 3838. Fraced with 50,000 gallons water and 50,000 lbs. 20-40 sand. Cleaned out to T.D. Ran 2-3/8" EUE tubing. Landed at 4519. Now blowing and cleaning well.

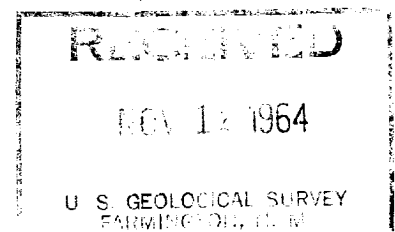

18. I hereby certify that the foregoing is true and correct

SIGNED Original Signed By:
J. H. WATKINS

TITLE

District Office Supervisor

DATE 11-10-64

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.