

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE\*  
(Other instructions on re-  
verse side)Form approved.  
Budget Bureau No. 42-R1424.

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT-" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	5. LEASE DESIGNATION AND SERIAL NO. NM-014378
2. NAME OF OPERATOR TEXACO, Inc. Attention: A. R. Marx	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P.O. Box EE, Cortez, Colorado 81321	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface SW $\frac{1}{4}$ and NE $\frac{1}{4}$ Sec. 23 G-23-29N-12W	8. FARM OR LEASE NAME H.J. Loe Federal B
14. PERMIT NO.	9. WELL NO. 2-R
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 5656' GR (GRADED)	10. FIELD AND POOL, OR WILDCAT Basin Dakota
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 23, T29N, R12W
	12. COUNTY OR PARISH San Juan
	13. STATE N. Mex.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) _____	

(Other) Flow Test New Well


(NOTE: Report results of multiple completion or Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

TEXACO plans to complete this new well as follows:

1. Perforate pay zones in Dakota with 2 JSPF.
2. Flow test well thru production unit and separator and measure pressures.
3. Treat down annulus with 75,000 gallons gelled water (Halliburton - "Versagel") and 110,000# 20-40 sand. Gelled water will contain 350 SCF/BBL CO.
4. SI well until pressure stabilizes and gel breaks.
5. Flow well thru production unit and separator to recover load water and clean up well.
6. When recovery is complete, SI well for seven day buildup.
7. Flow well and test for IP.

ALL GAS PRODUCED DURING TESTING WILL BE FLARED.

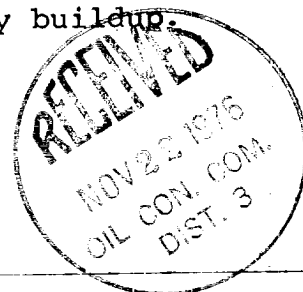

18. I hereby certify that the foregoing is true and correct

SIGNED A. R. Marx TITLE Field Foreman DATE 11-19-76

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side