

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

SF 078316

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Florance

9. WELL NO.

47

10. FIELD AND POOL, OR WILDCAT

Blanco Mesaverde

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 5, T30N, R9W

12. COUNTY OR PARISH 13. STATE

San Juan

N.M.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Tenneco Oil Company

3. ADDRESS OF OPERATOR

Box 1714, Durango, Colorado

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1450' FNL

1650' FFL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6260 DF

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)



REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)*

Well plugged as follows: 9-13-65 rig up pulled 4666' of 1-1/2" tubing.
Cleaned out to 4810. Set cement retainer at 4572 and cemented shot hole
w/275 sx. Recemented w/50 sx - 48 sx below retainer and 2 sx on top of retainer.
Tried to pull 4-1/2 casing - could not recover any. Perf at 3200 w/4 holes. Cemented
P.C. w/75 sx with retainer set at 3115. Set retainer at 750. Cemented with 350 sx
310 sx below retainer and 40 sx above retainer. Set 10 sx cement plug at surface.
Welded on dry hole marker. Released rig 9-15-65. Job complete. Plugging
operations witnessed by Mr. Dick Karbl and Mr. John Ward, USGS Representatives.

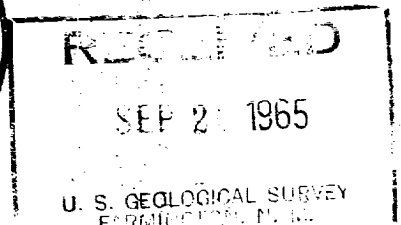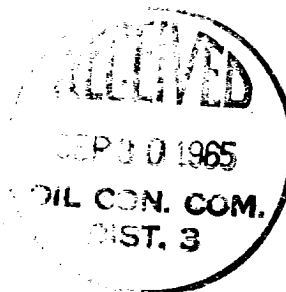

18. I hereby certify that the foregoing is true and correct

SIGNED HAROLD C. NICHOLS

H. C. Nichols

TITLE Senior Production Clerk

DATE 9-21-65

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side