

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		5. LEASE DESIGNATION AND SERIAL NO. 14-20-0603-7116
2. NAME OF OPERATOR Standard Oil Company of Texas A Division of Chevron Oil Co.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME Navajo Tribal
3. ADDRESS OF OPERATOR 3610 Avenue B - Snyder, Texas		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface Unit F; 1930 FWL and 1980 FWL of Section 35, T-31N, R-18W		8. FARM OR LEASE NAME Navajo Tribal 21
14. PERMIT NO.		9. WELL NO. 1
15. ELEVATIONS (Show whether DF, RT, GR, etc.) DF 5026		10. FIELD AND POOL, OR WILDCAT Indesignated
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 35, T-31, R-18
		12. COUNTY OR PARISH 13. STATE San Juan New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☒	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)


17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

Casing Detail

13-3/8" 48' at 79'. Cemented to surface.
9-5/8" 36' at 859'. Cemented to surface.
5 1/2" 9.5', 11.6' at 7006'. Cemented with 400 ann.

Abandonment Procedure

1. Load casing with 11.0 lb/gal mud. Squeeze cement perforations 6672-6772'.
2. Determine free point, shoot off and recover 5 1/2" casing (est. 750' recoverable).
3. Spot cement plugs 100' over casing stub, 50' in casing and 50' above, 2350-2550'. 1150-1250', 10 ann. at surface.
4. Remove wellhead equipment, weld steel plate on 13-3/8" casing, clean up and level location, install abandoned well marker.

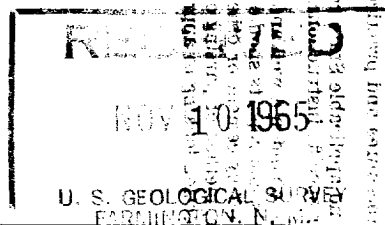

18. I hereby certify that the foregoing is true and correct

SIGNED

R. Davidson

TITLE

Lead Drilling Engineer

DATE

October 8, 1965

(This space for Federal or State Office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1983-O-906229

907-851

