

NO. OF COPIES RECEIVED	5
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	3

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)


1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator Consolidated Oil & Gas Inc.		8. Farm or Lease Name Kline 16
3. Address of Operator P.O. Box 2038, Farmington, New Mexico		9. Well No. 1-10
4. Location of Well UNIT LETTER G 1830 FEET FROM THE North LINE AND 1550 FEET FROM THE East LINE, SECTION 10 TOWNSHIP 31 North RANGE 13 West NMPM.		10. Field and Pool, or Wildcat Mesaverde & Dakota
15. Elevation (Show whether DF, RT, GR, etc.) 5715 G.L.		12. County SAN JUAN

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Move in completion rig, killed well with 60 barrels of water. pulled 1" and 1 1/2" tubing. Ran Mc Colough corrosion log. Log indicated holes at 3758, 3735, 3728 and 3700, set bridge plug at 3840 pressured up to 1500# held O.K., set full bore packer at 3300, pressured up on back side to 1500# held O.K. Squeezed well with 175 sacks. W.O.C. pressured up held O.K. Drilled out cement and re ran 1" and 1 1/2" tubing back in well.

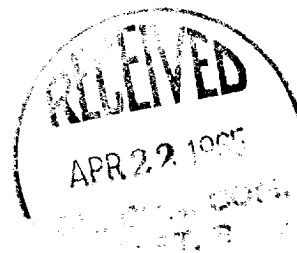

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED *Clyde Phillips* TITLE Production Foreman DATE 4-20-65

Original Signed Emory C. Arnold APPROVED BY Emory C. Arnold TITLE Superior Dist # 3 DATE APR 22 1965

CONDITIONS OF APPROVAL, IF ANY: