

TO: Mr. Ernest Valdez - State Land Office
P.O. BOX 1148
310 Old Santa Fe Trail
Santa Fe NM 87504

FROM

DUGAN PRODUCTION CORP.
P. O. BOX 208
FARMINGTON, N. M. 87401
(505) 325-1821

SUBJECT

Dugan Production - Big Catch #1 Re Entry

State Ge # LG 4574

DATE

9-24-87

MESSAGE

Dear Valdez,

Attached for your files is a copy of our Sunday notice (Form C-103) reporting the commencement of re-entry operations on the Subject well. Also Attached is a copy of our Daily report which presents operations thru 9/24/87.

We have also installed a well ID sign in accordance with the requirements of OGD Rule #103 which was done on 8/25/87 upon moving in the drilling Rig.

Should you need additional information prior to our next 30 day Progress Report, please feel free to contact me.

SIGNED

Respectfully

SEND WHITE COPY RETAIN YELLOW COPY

John Roe

cc: FRANK Chavez - OGD-AZtec

RECEIVED
SEP 25 1987
OIL CON. DIV.
DIST. 3

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-7

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
LG 4544	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator DUGAN PRODUCTION CORP.		8. Farm or Lease Name Big Catch
3. Address of Operator P.O. Box 208, Farmington, NM 87499		9. Well No. 1
4. Location of Well UNIT LETTER <u>H</u> <u>1650</u> FEET FROM THE <u>North</u> LINE AND <u>1170</u> FEET FROM THE <u>East</u> LINE, SECTION <u>16</u> TOWNSHIP <u>31N</u> RANGE <u>13W</u> NMPM.		10. Field and Pool, or Wildcat Wildcat-FR; Wildcat-PC
15. Elevation (Show whether DF, RT, GR, etc.) 5756' GL; 5767' RKB		12. County San Juan

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input checked="" type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8/25/87


Moved in Morrow Drilling Co. rig. Removed dry hole marker, dug pits, install BOP. Picked up 7-5/8" bit and start re-entry.

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signed Jim L. Jacobs TITLE Geologist DATE 9-24-87

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

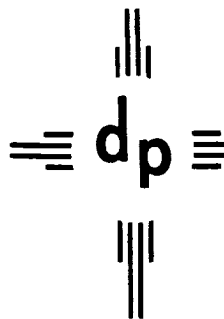

dugan production corp.

DUGAN PRODUCTION CORP.
Big Catch #1
(Formerly
1650' FNL - 1170' FEL
Unit H, Sec. 16, T31N, R13W, NMPM
San Juan County, NM

Note: This is not a new well.
DPC is re-entering an
abandoned well.

DAILY REPORT

- 8-25-87 M.I. & R.U. Morrow Drilling Company. Remove dry hole marker, dig pits and collar out, install and test BOP and shut down for night.
- 8-26-87 G.I.H. with 7-5/8" bit and ream 8-3/4" hole. Hit bridges @ 230', 250', 320', 390' and 400'. Ream 3 hours @ 406' and made 3'. T.O.H. and shut down for night.
- 8-27-87 G.I.H. with 6-3/4" button bit, drill 3 hours and made 10". Bottom 1" took 1 hour. T.O.H. Change bit and G.I.H. with 4-3/4" button bit. Drill 2 hours and did not make any hole. T.O.H. Change bit and G.I.H. with 6-1/8" mill bit. Drill 3 hours and made 1". T.O.H. and shut down for night.
- 8-28-87 Lay down drill pipe. Move Morrow's big rig off of hole and move Morrow's little rig over hole. Rode Morrow's big rig to the Phillip's #1.
- 8-29-87 Shut down - weekend.
- 8-30-87 Shut down - weekend.
- 8-31-87 Work on rig pump and run 2 joints of drill pipe in hole. Attempt to level rig and shut down for night.
- 9-1-87 Tear down mud pump, level and support rig with timbers. Pull 1 joint of drill pipe, install flow line and work on draw-works. Shut down for night.
- 9-2-87 Waiting on parts for mud pump.
thru
9-24-87

