

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 1301 W. Grand Ave., Artesia, NM 88210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 March 4, 2004

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-025-36731
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Triple "X" 6 State
8. Well Number 1
9. OGRID Number 017891
10. Pool name or Wildcat Triple X Delaware

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
 Oil Well Gas Well Other

2. Name of Operator
 Pogo Producing Company

3. Address of Operator
 P. . Box 10340, Midland, TX 79702-7340

4. Well Location
 Unit Letter D : 330 feet from the North line and 1310 feet from the West line
 Section 6 Township 24S Range 33E NMPMLea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
 3642'

CONFIDENTIAL

Pit or Below-grade Tank Application (For pit or below-grade tank closures, a form C-144 must be attached)

Pit Location: UL Sect Twp Rng Pit type Depth to Groundwater Distance from nearest fresh water well
 Distance from nearest surface water Below-grade Tank Location UL Sect Twp Rng ;
 feet from the line and feet from the line

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:


- PERFORM REMEDIAL WORK PLUG AND ABANDON
- TEMPORARILY ABANDON CHANGE PLANS
- PULL OR ALTER CASING MULTIPLE COMPLETION
- OTHER:

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ALTERING CASING
- COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT
- CASING TEST AND CEMENT JOB
- OTHER:

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

See Attached.

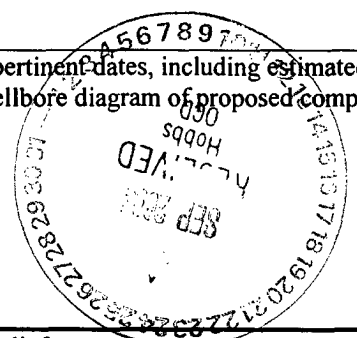

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative OCD-approved plan .

SIGNATURE Cathy Wright TITLE Sr. Eng. Tech DATE 09/20/04

Type or print name Cathy Wright E-mail address: 432-685-8100 Telephone No.

(This space for State use)

APPROVED BY [Signature] TITLE PETROLEUM ENGINEER DATE DEC 1 4 2004

Conditions of approval, if any:

Pogo Producing Company
Triple X 6 State #1
D/6/T24S/R33E
Lea County, NM
30-025-36731

CONFIDENTIAL

Spud & Set Surface Csg – MIRU Patterson UTI #78. Spud well @ 06:00 hrs 07/18/04. Drld 17-1/2" hole to 885'. TD reached @ 10:15 hrs 07/19/04. Ran 21 jts 13-3/8" 61# J-55 ST&C csg. Cmt'd w/ 600 sks 65:35 POZ C @ 12.8 ppg followed by 200 sks Cl "C" + 2% CaCl₂ @ 14.8 ppg. Circ 250 sks to surface. Plug down @ 17:00 hrs 07/19/04. WOC 17-1/2 hrs. Make cut-off. Weld on WH. NU BOP's & test ok.

Intermediate Csg – Drld 11" hole to 4920'. TD reached @ 22:00 hrs 07/25/04. Ran 112 jts 8-5/8" 32# K-55 & HCK-55 LT&C csg. Cmt'd w/ 1150 sks 65:35 POZ C @ 12.4 ppg followed by 200 sks Cl "C" + 1% CaCl₂ @ 14.8 ppg. Circ 234 sks to surface. WOC 14 hrs. Make cut-off. Install WH. NU BOP's & test ok.

TD & Prod Csg – Drld 7-7/8" hole to 9200'. TD reached @ 16:00 hrs 08/04/04. Logged well w/ Baker Atlas. Ran 203 jts 4-1/2" 11.6# J-55 & N-80 LT&C csg. Cmt'd 1st stage w/ 1000 sks Cl "H" + add @ 15.7 ppg. Circ 209 sks to surface. Cmt'd 2nd stage w/ 900 sks Cl "C" + add @ 14.1 ppg. CBL ran 08/20/04. TOC @ 3520'.