

Submit 1 Copy To Appropriate District Office  
District I - (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240  
District II - (575) 748-1283  
811 S. First St., Artesia, NM 88210  
District III - (505) 334-6178  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV - (505) 476-3460  
1220 S. St. Francis Dr., Santa Fe, NM 87505

**HOBBS OCD**

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised July 18, 2013

SEP 15 2016

RECEIVED

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-025-35011
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. 19552
7. Lease Name or Unit Agreement Name North Hobbs Unit (G/SA)
8. Well Number <del>342</del> 734
9. OGRID Number 157984
10. Pool name or Wildcat Hobbs (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator Occidental Permian Ltd	
3. Address of Operator P.O. Box 4294, Houston, TX 77210	
4. Well Location Unit Letter <u>O</u> : <u>511</u> feet from the <u>South</u> line and <u>2275</u> feet from the <u>East</u> line Section <u>33</u> Township <u>18S</u> Range <u>38E</u> NMPM County <u>Lea</u>	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3644' KB	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

<b>E-PERMITTING</b> <SWD <u>INJECTION</u> > CONVERSION <u>      </u> RBDMS <u>MB</u> <input type="checkbox"/> RETURN TO <u>      </u> TA <u>      </u> <input type="checkbox"/> CSNG <u>      </u> ENVIRO <u>      </u> CHG LOC <u>      </u> <input type="checkbox"/> INT TO PA <u>      </u> P&A NR <u>      </u> P&A R <u>      </u> <input type="checkbox"/>	<b>SUBSEQUENT REPORT OF:</b> REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> P AND A <input type="checkbox"/> CASING/CEMENT JOB <input type="checkbox"/> OTHER: TEMPORARILY ABANDON <input checked="" type="checkbox"/>
--	--

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

MIRU x NDWH x NUBOP. POOH 123 jts tbg x ESP. Found cable burnt. RIH 5 1/2" CIBP @ 4025' w/ 6 sx cmt. RIH 5 1/2" test pkr @ 3965' x test CIBP. Isolated leak from 2861' - 2910'. Pulled pkr to 2910' and ran acid job w/ 400 gals 15% Ferchek acid. RIH TP @ 2924' x pkr @ 2421' x squeezed leak w/ 50 sx cmt. POOH pkr x TP x RUH 4 3/4" bit x drill cmt to 2930'. RD x NDBOP x NUWH.

Ran MIT. Chart attached. \*\*\* WELL IS CURRENTLY TA'D \*\*\*

This Approval of Temporary  
Abandonment Expires 8/31/2018

Spud Date:

08/17/16

Rig Release Date:

08/31/16

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE April Hood TITLE Regulatory Coordinator DATE 09/13/2016


Type or print name April Hood E-mail address: April\_Hood@Oxy.com PHONE: 713-366-5771

For State Use Only

APPROVED BY: Malay Brown TITLE Dist. Supervisor DATE 9/15/2016

Conditions of Approval (if any):



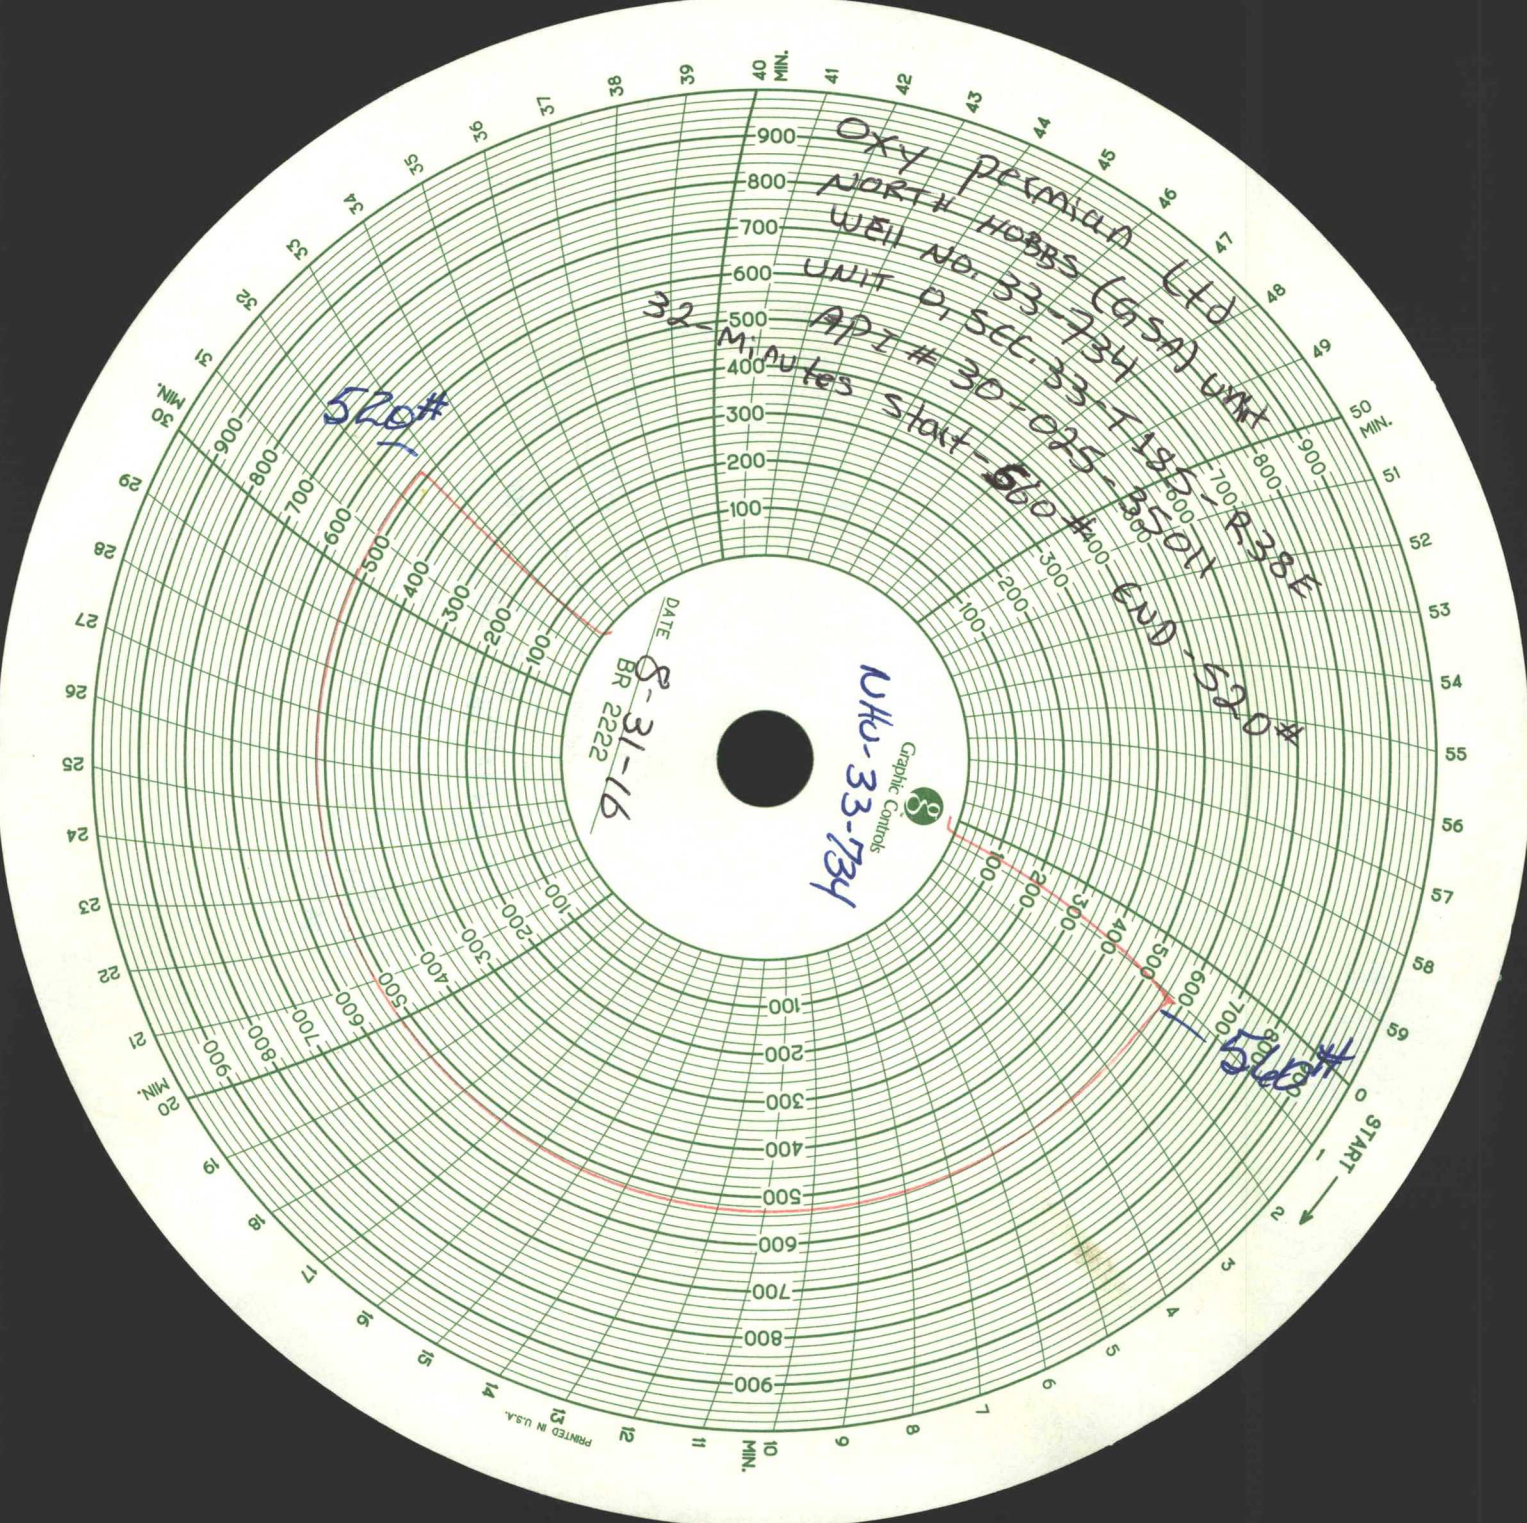

DATE  
8-31-16  
BR 2222

LHO-33-734  
Graphic Controls

OXY PERMAN  
NORTH HOBBS (GSA) UNIT  
WELL NO. 33-734  
UNIT O. 5CL-33-T 185-R-38E  
APT # 30-025-35011  
Start-560#-END-520#

520#

560#

START

PRINTED IN U.S.A.