

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

811 South First, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.	30-025-20125
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	B-155-1
7. Lease Name or Unit Agreement Name:	New Mexico O State NCT-1
8. Well No.	17
9. Pool name or Wildcat	Vacuum Wolfcamp, Vacuum Upper Penn, Vacuum Devonian
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. **Type of Well:**
Oil Well Gas Well Other

2. **Name of Operator**
Texaco Exploration & Production, Inc.

3. **Address of Operator**
P. O. Box 3109, Midland, TX 79702

4. **Well Location**
Unit Letter N : 760 feet from the South line and 2080 feet from the West line
Section 36 Township 17-S Range 34-E NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

- R/U on Z-Side Tbg stuck, cut Tbg @ 9230' unable to pull 2 3/8" Tbg cut 2 3/8" Tbg @ 8000' unable to pull - able to pump into Perfs. Sqz Perfs w/100 sx 9300'-8000' Tag inside 2 3/8" Tbg @ 7961' cut Tbg @ 7500' free fill 3 1/2" Csg w/250 Sx 7500'-1625' Tag @ 1736' (Devonian)
- R/U on Y-Side set 2 7/8" CIBP @ 9350' (Penn) fill 2 7/8" Csg w/185 Sx plug 9350'-1625' Tag @ 1810'
- R/U on X-Side Tag CIBP @ 9000' (Wolfcamp) fill 2 7/8" Csg w/180 Sx 9000'-1625' Tag @ 1756'
- Cut 2 7/8" Csg on Y-Side unable to pull Sqz 75 Sx 1625'-1200' Tag @ 1157' - fill 2 7/8" Csg w/35 Sx 1157 to Surf
- Fill 3 1/2" Csg on Z-Side 1736' to Surf w/85 Sx
- Fill 2 7/8" Csg 1756' to Surf w/45 Sx
- Install dry hole marker. 10/11/01

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE Poly Abalos TITLE MANAGER

Type or print name POLY ABALOS

(This space for State use)

APPROVED BY [Signature] TITLE Asst Rep
Conditions of approval, if any:

DATE 1-29-07

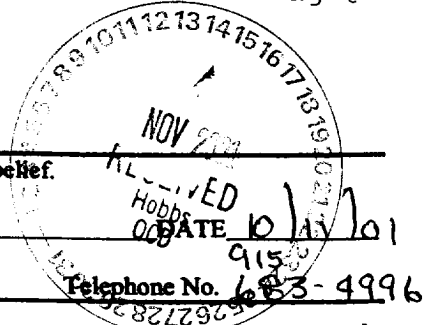

GWW

50

8