

NEW MEXICO OIL CONSERVATION COMMISSION

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State Fee

5. State Oil & Gas Lease No.
B-155-1

7. Unit Agreement Name
-

8. Farm or Lease Name
NM '0' St. NCT-1

9. Well No.
18

10. Field and Pool, or Wildcat
Vacuum Penn-
Vacuum Wolfcamp

12. County
Lea

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO REOPEN WELLS IN A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT TO DRILL (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL GAS WELL OTHER

2. Name of Operator
TEXACO Inc.

3. Address of Operator
P.O. Box 728 Hobbs, New Mexico 88240

4. Location of Well
UNIT LETTER H 1880 FEET FROM THE North LINE AND 560 FEET FROM THE East LINE, SECTION 36 TOWNSHIP 17-S RANGE 34-E N.M.P.M.

13. Elevation (Show whether DF, RT, CR, etc.)
4005' (DF)

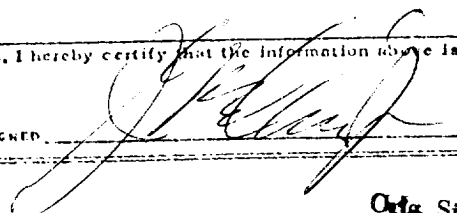
16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

<p>NOTICE OF INTENTION TO:</p> <p>PERFORM REMEDIAL WORK <input type="checkbox"/></p> <p>TEMPORARILY ABANDON <input type="checkbox"/></p> <p>PULL OR ALTER CASING <input type="checkbox"/></p> <p>OTHER <input type="checkbox"/></p>	<p>PLUG AND ABANDON <input type="checkbox"/></p> <p>CHANGE PLANS <input type="checkbox"/></p> <p>OTHER <input type="checkbox"/></p>	<p>SUBSEQUENT REPORT OF:</p> <p>REMEDIAL WORK <input type="checkbox"/></p> <p>COMMENCE DRILLING OPNS. <input type="checkbox"/></p> <p>CASING TEST AND CEMENT JOB <input type="checkbox"/></p> <p>OTHER <input checked="" type="checkbox"/> Add'l cement in 9-5/8" csg</p>	<p>ALTERING CASING <input type="checkbox"/></p> <p>PLUG AND ABANDONMENT <input type="checkbox"/></p>
---	---	---	--

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Rigged up. Install BOP.
- Set CIBP in abandoned Glorieta string @ 5990'. Set RBP in Penn string @ 6000'. Set RBP in Wolfcamp string @ 6012'. Load Penn & Wolfcamp string.
- Perforate 2-7/8" Glorieta string w/2-JS @ 4908', 3-JS @ 4805'.
- Squeeze perms 4908' & 4805' w/135 sx Class 'C' cement. Tested OK. Pull RBP from Penn & Wolfcamp.
- Install production equipment. Test and return to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED:  TITLE: Asst. Dist. Supt. DATE: 5-19-78

APPROVED BY: Jerry Sauton TITLE: DATE: 1978

CONDITIONS OF APPROVAL, IF ANY: None