

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-20958	
5. Indicate Type of Lease STATE ☒ FEE ☐	
6. State Oil & Gas Lease No. 011025	
7. Lease Name or Unit Agreement Name New Mexico CG NCT-1	
8. Well No. 2	
9. Pool name or Wildcat Vacuum Glorietta	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3985 DF	

SUNDY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
Texaco E&P Inc.

3. Address of Operator
P.O. Box 3109 Midland, Tx 79702

4. Well Location
Unit Letter H : 2310 Feet From The North Line and 400 Feet From The East Line

Section 30 Township 17S Range 35E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3985 DF

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Notify NMOCD of intent to plug and abandon talked w/Jerry Sexton 1-27-95
2. This well has 2-7/8" tub for production csg.
3. TIH w/2-1/16" work string to 5932' CICR csg. w/ 25# per bbl salt gel w/10# brine. 1-30-95
4. 1-30-95 Spot 10sx cmt. f/5932-5526.
5. 1-30-95 Spot 5 sx cmt f/4500-4297.
6. 1-31-95 Perf @ 4s per/ft. @ 2900' Set CICR @ 2500 sq. 145sx below CICR; Shut in @ 900 PSI Cap cmt. ret. w/5sx cmt.
7. 2-1-95 RUWL cut 2-7/8" csg. @ 1706; Spot 100sx cmt. @ 1706' WOC tag @ 1479
8. 2-1-95 Spot 100sx cmt. @ 350 CAL TOC 154'.
9. 2-1-95 Spot 30sx cmt. @ 50 to surface WOC & tag @ 15'.
10. 2-1-95 Spot 10sx cmt. @ 15 to surface.
11. 2-2-95 RD pulling unit & rmt equip. Dig out cellar cut off well head cap well & install dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE P&A Supervisor DATE 2-2-95

TYPE OR PRINT NAME J. Calder TELEPHONE NO 1-800-543-6772

(This space for State Use)


APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE MAY 08 1995

CONDITIONS OF APPROVAL, IF ANY:

JC

P&A: 2-02-95

TEXACO E&P INC.
NM "CG" State NCT-1 No. 2
API# 3002520958

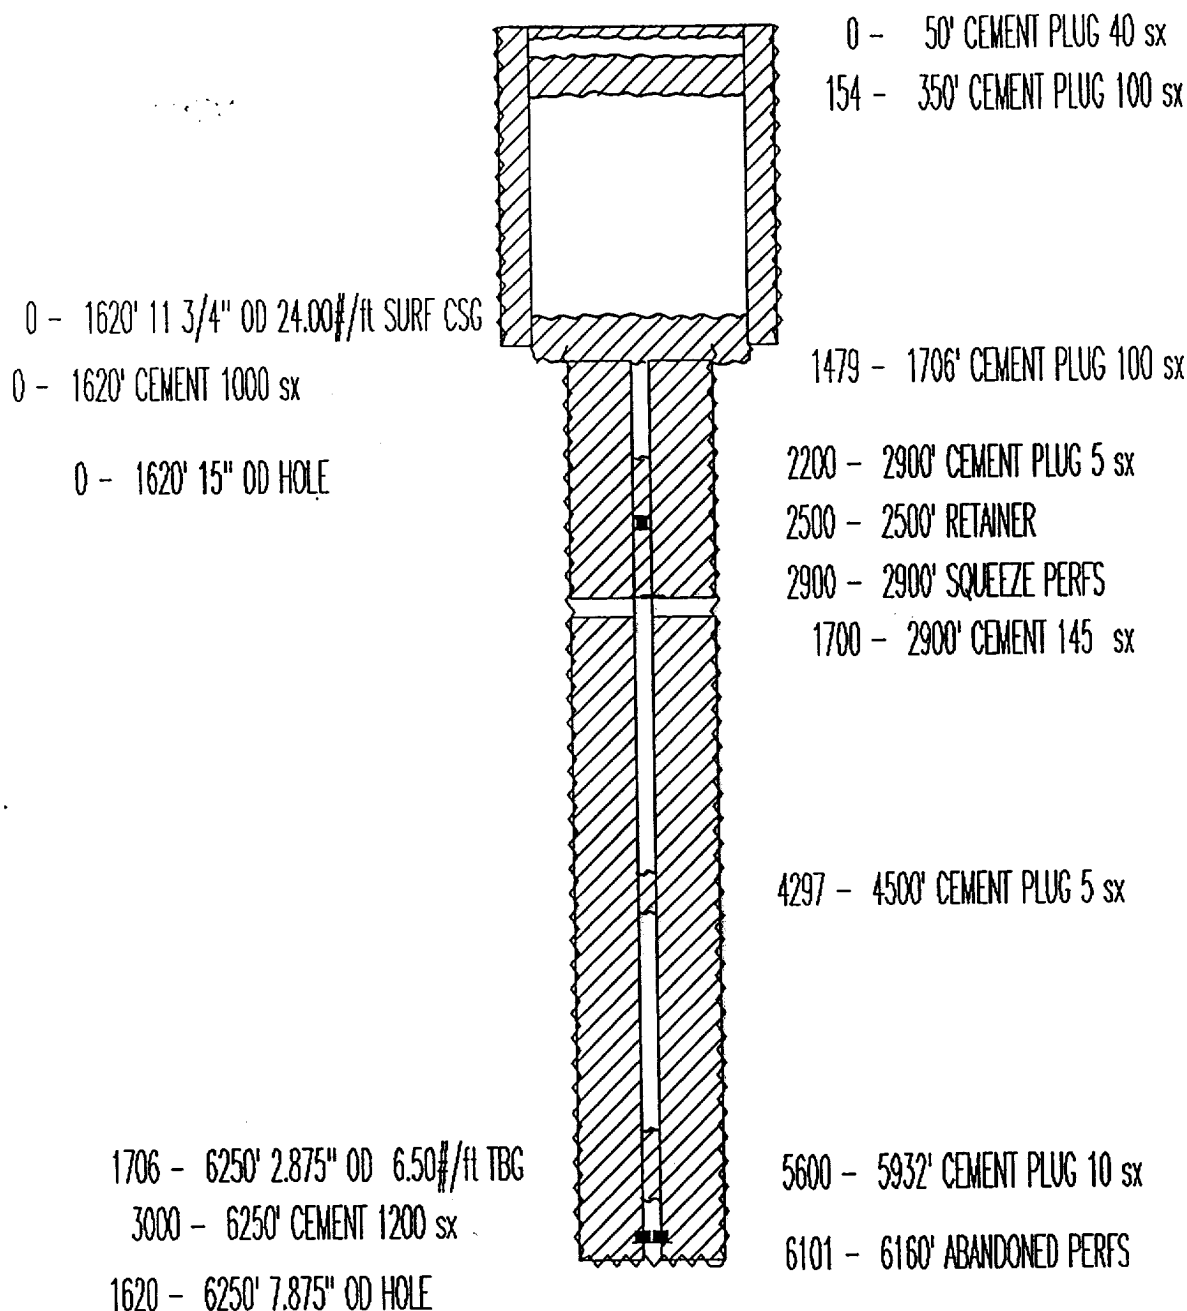

2310 FNL & 400 FEL
SEC 30, TWN 17 S, RANGE 35 E
ELEVATION: 3985 ES
COMPLETION DATE: 06-25-64

COMPLETION INTERVAL: 6101 - 6160 (GLOR)

RECEIVED

FEB 27 1995

RECORDS
OFFICE