

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 1301 W. Grand Avenue, Artesia, NM 88210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised March 25, 1999

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-025-08713	
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>	
6. State Oil & Gas Lease No.	
7. Lease Name (or Unit Acquisition) Name Eunice Monument South Unit	
8. Lease No. 421	
9. Lease State or Location Eunice Monument Grayburg, S.A.	

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well
 Oil Well Gas Well Other

2. Operator Name
 Chevron USA, Inc.

3. Address of Operator
 15 Smith Rd. Midland, Tx 79705

4. Well Location
 Unit Letter M : 660 feet from the South line and 660 feet from the West line
 Section 16 Township 21-s Range 36-E NMPM County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)


11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Tag 7" CIBP @ 3750'(Grayburg-San Andres-Queen) Spot 75sx plug fr/3750' to 3400' Tag @ 3330'
2. Displace hole w/MLF, 9.5# Brine w/25# Gel p/BBI.
3. Spot 40sx plug fr/2600' to 2400' (B-salt) Tag @ 2373'
4. Perf 4 holes @ 1800' sqz perf w/75sx fr/1800' to 1500' (9" shoe, T-salt) Tag @ 1308'
5. Csg leak fr/1308' to 1150' sqz leak w/75sx fr/1308' to 1150' Tag @ 1119'
6. Perf 4 holes @ 350' sqz perf w/80sx fr/350' to surf Tag @ surf(12 1/2" shoe)
7. Install dry hole marker 8-02-02

Approved as to plugging of the Well Bore.
 Liability under bond is retained until
 surface restoration is completed.

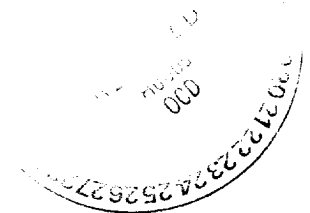

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE MANAGER/SUNSET WELL DATE 8-02-02

Type or print name JIMMY BAGLEY Telephone No. 915 520-8756
 (This space for State use)

APPROVED BY _____ TITLE _____ DATE _____
 Conditions of approval, if any:

FEB - 7 2003

GWW