

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Reports
04/13/2021

Well Name: WEST BISTI COAL 23 Well Location: T25N / R13W / SEC 23 / County or Parish/State: SAN

SESE / 36.382106 / 108.182522 JUAN / NM

Well Number: 1T Type of Well: OTHER Allottee or Tribe Name:

Lease Number: NMNM61273 Unit or CA Name: Unit or CA Number:

US Well Number: 3004532223 Well Status: Gas Well Shut In Operator: DJR OPERATING LLC

Notice of Intent

Type of Submission: Notice of Intent

Type of Action Plug and Abandonment

Date Sundry Submitted: 01/27/2021 Time Sundry Submitted: 09:25

Date proposed operation will begin: 01/27/2021

Procedure Description: DJR Operating, LLC requests permission to Plug & Abandon the subject well according to the attached Procedure, Current & Proposed Wellbore Diagram and Reclamation Plan.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Reclamation_Plan_West_Bisti_Coal_23_1T_20210127092529.pdf

Proposed_WBD_West_Bisti_Coal_23_1T_20210127092520.pdf

Current_WBD_West_Bisti_Coal_23_1T_20210127092513.pdf

PA_Procedure_West_Bisti_Coal_23_1T_20210127092507.pdf

well Name: WEST BISTI COAL 23

Well Location: T25N / R13W / SEC 23 / County or Parish/State: SAN

SESE / 36.382106 / 108.182522

JUAN / NM

Well Number: 1T Type of Well: OTHER Allottee or Tribe Name:

Lease Number: NMNM61273 Unit or CA Name: Unit or CA Number:

US Well Number: 3004532223 Well Status: Gas Well Shut In Operator: DJR OPERATING LLC

Conditions of Approval

Specialist Review

General_Requirement_P_A_20210316105409.pdf

Additional Reviews

25N13W23PKpc_West_Bisti_Coal_23_1T_20210406120022.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: FORD Signed on: JAN 27, 2021 09:25 AM

Name: DJR OPERATING LLC Title: Regulatory Specialist Street Address: 1 Road 3263

City: Aztec State: NM

Phone: (505) 632-3476

Email address: sford@djrllc.com

Field Representative

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: JOE D KILLINS BLM POC Title: Petroleum Engineer

BLM POC Phone: 5055647731 BLM POC Email Address: jkillins@blm.gov

Disposition: Approved **Disposition Date:** 04/13/2021

Signature: Joe D Killins

Plug and Abandonment Procedure

for

DJR Operating, LLC
West Bisti Coal 23 1T
API # 30-045-32223

SE/SE, Unit P, Sec. 23, T25N, R13W

San Juan County, NM

I.

- 1. Hold pre-job meeting, comply with all NMOCD, BLM and environmental regulations.
- 2. Check and record tubing, casing and bradenhead pressures.
- 3. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum.
- 4. Trip out of hole with rods and pump. Lay down to be sent in for storage/salvage.
- 5. ND WH, NU BOP, function test BOP.
- 6. Trip out of hole with 2 3/8" tubing. LD tubing to be sent in for storage/salvage.

II.

- 7. PU workstring, TIH with bit and scraper, make sure that the bit and scraper will go below 1160'. TOOH.
- 8. PU and RIH with a 5 ½" cement retainer. Set the CR at +/- 1160". Pressure test tubing to 1000 psi, sting out of CR, test casing to 600 psi. If casing does not test, contact engineering.

Provided that casing test was good, proceed to step 9.

- 9. RU cement equipment. Pump water to assure that tubing is clear.
- 10. Plug 1. Mix and attempt to pump 10 sx class G cement through cement retainer and displace with 5.1 bbl water. If zone pressures up, sting back out of retainer and continue with Plug 2.

- 11. Plug 2. Fruitland, Kirtland, Ojo Alamo, and surface casing shoe. From 1160' to surface, mix and pump cement until cement circulation is achieved at surface.
- 12. RD cementing equipment. Cut off wellhead, fill annuli with cement as necessary. Install P&A marker as per regulatory requirements. Record GPS coordinates for P&A marker and the final P&A report. Photograph the P&A marker and attach to the report.
- 13. RD and MO all rig and cement equipment. Assure that location is free of trash and contamination before moving off.
- 14. Send all reports and attachments to DJR Aztec office for regulatory filings.


Note: All cement is to be Class G mixed at 15.8 ppg, yield 1.15 cu ft / sx. Cement volumes are based on inside capacities + 50' excess and outside capacities + 100 % excess.

DJR Operating, LLC Current Wellbore Diagram

West Bisti Coal 23 1T

API # 30-045-32223 SE/SE, Unit P, Sec 23, T25N, R13W San Juan County, NM

GL 6384' KB N/A Spud Date 1/4/2006

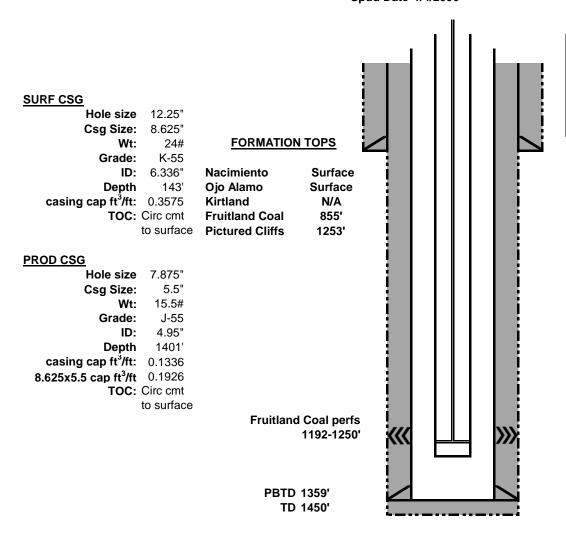

Production Tubing/Rod Detail

MA, SN, 37 jts. 2.375" tbg.


2"x1.5"x12' RWAC, .75"x4' stabilizer sub, 4x1.25" K bars, 43x.75" rods, .75"x6'x2' rod subs, 1.25"x16' polished rod, 1.5"x10' liner.

DJR Operating, LLC Proposed Wellbore Diagram

West Bisti Coal 23 1T

API # 30-045-32223 SE/SE, Unit P, Sec 23, T25N, R13W San Juan County, NM

GL 6384' KB N/A Spud Date 1/4/2006

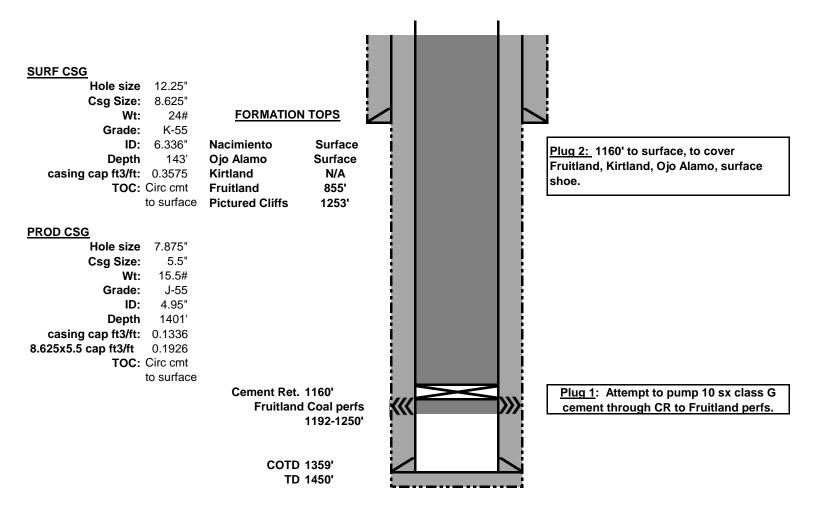

GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
 - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
 - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
 - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
 - 4.1 The cement shall be as specified in the approved plugging plan.
 - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.3 Surface plugs may be no less than 50' in length.
 - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
 - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

2

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
 - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
 - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H_2S .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

(October 2012 Revision)

BLM FLUID MINERALS Geologic Report

Date Completed: 4/2/2021

Well No. West Bisti Coal 23 #1T (API# 30-045-32223)			Location	972	FSL	&	870	FEL
Lease No.	ease No. NMNM-061273		Sec. 23	T25N		R13W		
Operator	DJR Operating, LLC		County	San Juan State		New Mexico)	
Total Depth	1450'	PBTD 1359'	Formation	tion Fruitland Coal (producing), Pictured Cliffs (TD)			s (TD)	
Elevation (GL)	6384'	Elevation (K	Elevation (KB)					

Geologic Formations	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose Fm					Surface/Fresh water sands
Nacimiento Fm					Fresh water sands
Ojo Alamo Ss	Surface	50			Aquifer (fresh water)
Kirtland Shale	50			855	
Fruitland Fm			855	1253	Coal/Gas/Possible water
Pictured Cliffs Ss			1253	PBTD	Gas
Lewis Shale					
Chacra					
Cliff House Ss					Water/Possible gas
Menefee Fm					Coal/Ss/Water/Possible O&G
Point Lookout Ss					Probable water/Possible O&G
Mancos Shale					
Gallup					O&G/Water
Graneros Shale					
Dakota Ss					O&G/Water

Remarks:

P & A

- BLM formation top estimate for the Kirtland formation varies from operator pick. No change to the P&A procedure is required (entire well bore will be cemented to surface).
- Log analysis of reference well #2 indicates the Nacimiento and Ojo Alamo sands investigated likely contain fresh water (≤5,000 ppm TDS). P&A procedure has cement from the cement retainer @ 1160' to Surface which will protect freshwater sands in this well bore.
- Fruitland Coal perforations @ 1192'-1250'.

Reference Well:

- 1) **Formation Tops** Same
- 2) Water Analysis Giant E & P Co. Carson Unit #23 1980' FSL, 1980' FEL Sec. 19, T25N, R11W GL 6438' KB 6447'

Prepared by: Chris Wenman

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 23865

COMMENTS

Operator:			OGRID:	Action Number:	Action Type:
DJR OPERATING, LLC	1 Road 3263	Aztec, NM87410	371838	23865	C-103F

Created By	Comment	Comment Date
kpickford	KP GEO Review 4/17/2021	04/17/2021

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 23865

CONDITIONS OF APPROVAL

Operator:			OGRID:	Action Number:	Action Type:
DJR OPERATING, LLC	1 Road 3263	Aztec, NM87410	371838	23865	C-103F

OCD Reviewer	Condition
kpickford	Notify NMOCD 24 Hours Prior to beginning operations