



U.S. Department of the Interior
BUREAU OF LAND MANAGEMENT

Sundry Print Report

06/03/2021

Well Name: WEST BISTI COAL 13	Well Location: T25N / R13W / SEC 13 / NWNW / 36.405006 / 108.175369	County or Parish/State: SAN JUAN / NM
Well Number: 2T	Type of Well: OTHER	Allottee or Tribe Name:
Lease Number: NMNM33917	Unit or CA Name:	Unit or CA Number:
US Well Number: 3004533136	Well Status: Gas Well Shut In	Operator: DJR OPERATING LLC

Notice of Intent

Type of Submission: Notice of Intent**Type of Action** Plug and Abandonment**Date Sundry Submitted:** 01/27/2021**Time Sundry Submitted:** 09:23**Date proposed operation will begin:** 01/27/2021

Procedure Description: DJR Operating, LLC requests permission to Plug & Abandon the subject well according to the attached Procedure, Current & Proposed Wellbore Diagram and Reclamation Plan.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Reclamation_Plan_West_Bisti_Coal_13_2T_20210127092318.pdf

Proposed_WBD_West_Bisti_Coal_13_2T_20210127092308.pdf

Current_WBD_West_Bisti_Coal_13_2T_20210127092300.pdf

PA_Procedure_West_Bisti_Coal_13_2T_20210127092253.pdf

Well Name: WEST BISTI COAL 13	Well Location: T25N / R13W / SEC 13 / NWNW / 36.405006 / 108.175369	County or Parish/State: SAN JUAN / NM
Well Number: 2T	Type of Well: OTHER	Allottee or Tribe Name:
Lease Number: NMNM33917	Unit or CA Name:	Unit or CA Number:
US Well Number: 3004533136	Well Status: Gas Well Shut In	Operator: DJR OPERATING LLC

Conditions of Approval**Additional Reviews**

25N13W13DKpc_West_Bisti_Coal_13_2T_20210512081507.pdf

BLM Point of Contact**BLM POC Name:** VIRGIL S LUCERO**BLM POC Phone:** 5055647752**Disposition:** Returned to Reviewer**Signature:** null**BLM POC Title:** PET**BLM POC Email Address:** VLUCERO@BLM.GOV**Disposition Date:** 05/13/2021

BLM POC Name: DAVE J MANKIEWICZ

BLM POC Phone: 5055647760

Disposition: Approved

Signature: 

BLM POC Title: AFM-Minerals

BLM POC Email Address: DMANKIEW@BLM.GOV

Disposition Date: 6/3/2021

Plug and Abandonment Procedure
for
DJR Operating, LLC
West Bisti Coal 13 2T
API # 30-045-33136
NW/NW, Unit D, Sec. 13, T25N, R13W
San Juan County, NM

I.

1. Hold pre-job meeting, comply with all NMOCD, BLM and environmental regulations.
2. Check and record tubing, casing and bradenhead pressures.
3. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum.
4. Trip out of hole with rods and pump. Lay down to be sent in for storage/salvage.
5. ND WH, NU BOP, function test BOP.
6. Trip out of hole with 2 3/8" tubing. LD tubing to be sent in for storage/salvage.

II.

7. PU workstring, TIH with bit and scraper, make sure that the bit and scraper will go below 1280'. TOOH.
8. PU and RIH with a 5 1/2" cement retainer. Set the CR at +/- 1280'. Pressure test tubing to 1000 psi, sting out of CR, test casing to 600 psi. If casing does not test, contact engineering.

Provided that casing test was good, proceed to step 9.

9. RU cement equipment. Pump water to assure that tubing is clear.
10. Plug 1. Mix and attempt to pump 10 sx class G cement through cement retainer and displace with 5.1 bbl water. If zone pressures up, sting back out of retainer and continue with Plug 2.

11. Plug 2. Fruitland, Kirtland, Ojo Alamo, and surface casing shoe. From 1280' to surface, mix and pump cement until cement circulation is achieved at surface.
12. RD cementing equipment. Cut off wellhead, fill annuli with cement as necessary. Install P&A marker as per regulatory requirements. Record GPS coordinates for P&A marker and the final P&A report. Photograph the P&A marker and attach to the report.
13. RD and MO all rig and cement equipment. Assure that location is free of trash and contamination before moving off.
14. Send all reports and attachments to DJR Aztec office for regulatory filings.

Note: All cement is to be Class G mixed at 15.8 ppg, yield 1.15 cu ft / sx. Cement volumes are based on inside capacities + 50' excess and outside capacities + 100 % excess.

DJR Operating, LLC

Current Wellbore Diagram

West Bisti Coal 13 2T

API # 30-045-33136

NW/NW, Unit D, Sec 13, T25N, R13W
San Juan County, NM

GL 6274'

KB N/A

Spud Date 3/31/2006

SURF CSG

Hole size 12.25"
Csg Size: 8.625"
Wt: 24#
Grade: K-55
ID: 6.336"
Depth 133'
casing cap ft³/ft: 0.3575
TOC: Circ cmt
to surface

FORMATION TOPS


Nacimiento	Surface
Ojo Alamo	N/A
Kirtland	211'
Fruitland Coal	1050'
Pictured Cliffs	1367'

PROD CSG

Hole size 7.875"
Csg Size: 5.5"
Wt: 15.5#
Grade: J-55
ID: 4.95"
Depth 1465'
casing cap ft³/ft: 0.1336
8.625x5.5 cap ft³/ft 0.1926
TOC: Circ cmt
to surface

Fruitland Coal perms
1317-64'

PBTD 1426'
TD 1501'

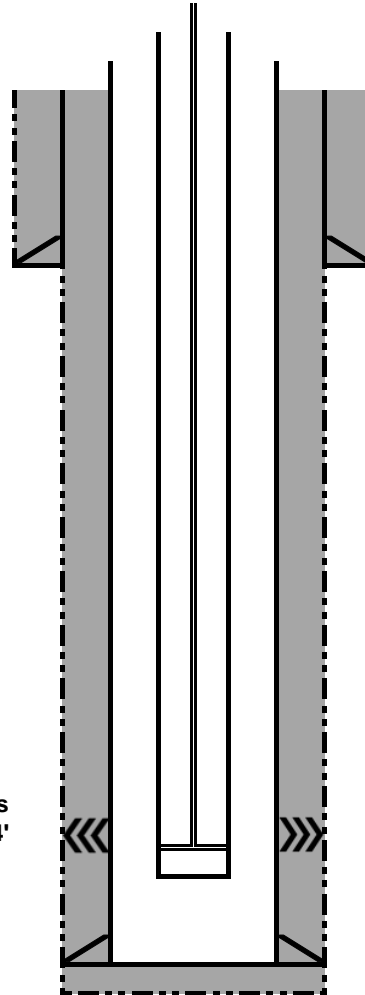**Production Tubing/Rod Detail**

NC, 1 jt. 2.375" tbg, SN, 41 jts. 2.375" tbg.
2"x1.5"x12' RWAC, 4' stabilizer sub, 3 K bars, 50x.75" plain rods, 8'x8'x.75" rod subs, 16' polished rod with 8' liner.

1/27/2021

DJR Operating, LLC
Proposed Wellbore Diagram

West Bisti Coal 13 2T

API # 30-045-33136

NW/NW, Unit D, Sec 13, T25N, R13W
 San Juan County, NM

GL 6274'

KB N/A

Spud Date 3/31/2006

SURF CSG

Hole size 12.25"
 Csg Size: 8.625"
 Wt: 24#
 Grade: K-55
 ID: 6.336"
 Depth 133'
 casing cap ft3/ft: 0.3575
 TOC: Circ cmt
 to surface

FORMATION TOPS

Nacimiento	Surface
Ojo Alamo	N/A
Kirtland	211'
Fruitland	1050'
Pictured Cliffs	1367'


Plug 2: 1280' to surface, to cover
 Fruitland, Kirtland, Ojo Alamo, surface
 shoe.

PROD CSG

Hole size 7.875"
 Csg Size: 5.5"
 Wt: 15.5#
 Grade: J-55
 ID: 4.95"
 Depth 1465'
 casing cap ft3/ft: 0.1336
 8.625x5.5 cap ft3/ft 0.1926
 TOC: Circ cmt
 to surface

Cement Ret. 1280'
 Fruitland Coal perfs
 1317-64'

COTD 1426'
 TD 1501'

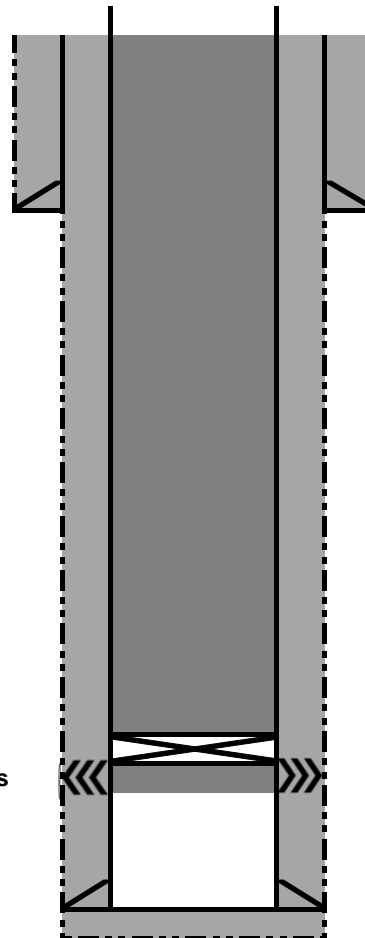

Plug 1: Attempt to pump 10 sx class G
 cement through CR to Fruitland perfs.

**GENERAL REQUIREMENTS FOR
PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES
FARMINGTON FIELD OFFICE**

1.0 The approved plugging plans may contain variances from the following minimum general requirements.

1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.

1.2 Requirements may be added to address specific well conditions.

2.0 Materials used must be accurately measured. (densometer/scales)

3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.

3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.

4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.

4.1 The cement shall be as specified in the approved plugging plan.

4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.

4.3 Surface plugs may be no less than 50' in length.

4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.

4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.

4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. **If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.**

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

- 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
- 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H₂S.

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

(October 2012 Revision)

BLM FLUID MINERALS Geologic Report

Date Completed: 3/18/2021

Well No. West Bisti Coal 13 #2T (API# 30-045-33136)			Location	1255	FNL	&	1230	FEL
Lease No. NMNM-033917			Sec. 13	T25N			R13W	
Operator DJR Operating, LLC			County	San Juan		State	New Mexico	
Total Depth	1501'	PBTD	1426'	Formation Fruitland Coal (producing), Pictured Cliffs (TD)				
Elevation (GL) 6274'				Elevation (KB)				

Geologic Formations	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose Fm					Surface/Fresh water sands
Nacimiento Fm	Surface	100	Surface		Fresh water sands
Ojo Alamo Ss	100			211	Aquifer (fresh water)
Kirtland Shale			211	1050	
Fruitland Fm			1054	1367	Coal/Gas/Possible water
Pictured Cliffs Ss			1367	PBTD	Gas
Lewis Shale					
Chacra					
Cliff House Ss					Water/Possible gas
Menefee Fm					Coal/Ss/Water/Possible O&G
Point Lookout Ss					Probable water/Possible O&G
Mancos Shale					
Gallup					O&G/Water
Graneros Shale					
Dakota Ss					O&G/Water

Remarks:

P & A

- BLM formation top estimate for the Ojo Alamo formation varies from operator pick. No change to the P&A procedure is required (entire well bore will be cemented to surface).
- Log analysis of reference well #2 indicates the Nacimiento and Ojo Alamo sands investigated likely contain fresh water ($\leq 5,000$ ppm TDS). P&A procedure has cement from the cement retainer @ 1280' to Surface which will protect freshwater sands in this well bore.
- Fruitland Coal perforations @ 1317'-1364'.

Reference Well:

1) **Formation Tops**
Same

2) **Water Analysis**
Giant E & P Co.
Carson Unit #23
1980' FSL, 1980' FEL
Sec. 19, T25N, R11W
GL 6438' KB 6447'

Prepared by: Chris Wenman

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

COMMENTS

Action 30648

COMMENTS

Operator: DJR OPERATING, LLC 1 Road 3263 Aztec, NM 87410	OGRID: 371838
	Action Number: 30648
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By	Comment	Comment Date
kpickford	KP GEO Review 6/10/2021	6/11/2021

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 30648

CONDITIONS

Operator: DJR OPERATING, LLC 1 Road 3263 Aztec, NM 87410	OGRID: 371838
	Action Number: 30648
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	6/11/2021