

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Reports

Well Name: SAN JUAN 27-4 UNIT Well Location: T27N / R4W / SEC 29 / County or Parish/State: RIO

NWNW / 36.549042 / -107.278854 ARRIBA / NM

Well Number: 113 Type of Well: CONVENTIONAL GAS Allottee or Tribe Name:

WELL

Lease Number: NMSF080670 Unit or CA Name: SAN JUAN 27-4 Unit or CA Number:

UNIT--PC NMNM78408C

US Well Number: 3003921016 Well Status: Producing Gas Well Operator: HILCORP ENERGY

COMPANY

### **Notice of Intent**

**Sundry ID:** 2712094

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 01/23/2023 Time Sundry Submitted: 09:50

Date proposed operation will begin: 02/06/2023

**Procedure Description:** Hilcorp Energy Company requests permission to P&A the subject well per the attached procedures, current and proposed wellbore schematics. A closed loop system will be used. A pre-disturbance site visit was not conducted as surface is Forest.

## **Surface Disturbance**

Is any additional surface disturbance proposed?: No

### **NOI Attachments**

## **Procedure Description**

 $SJ\_27\_4\_Unit\_113\_P\_A\_NOI\_Procedure\_20230123094927.pdf$ 

Page 1 of 2

eceived by OCD: 2/2/2023 7:11:31 AM Well Name: SAN JUAN 27-4 UNIT Well Location: T27N / R4W / SEC 29 /

NWNW / 36.549042 / -107.278854

Well Status: Producing Gas Well

County or Parish/State: Rige 2 of

ARRIBA / NM

Well Number: 113 Type of Well: CONVENTIONAL GAS

**Allottee or Tribe Name:** 

Lease Number: NMSF080670 Unit or CA Name: SAN JUAN 27-4

**UNIT--PC** 

**Unit or CA Number:** NMNM78408C

**Operator: HILCORP ENERGY** 

COMPANY

# **Conditions of Approval**

#### **Additional**

27N04W29DKpc\_San\_Juan\_27\_4\_Unit\_113\_20230201112321.pdf

### **Authorized**

General\_Requirement\_PxA\_20230201170540.pdf

2712094\_NOIA\_113\_3003921016\_KR\_02012023\_20230201170504.pdf

### **Operator**

**US Well Number: 3003921016** 

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: KANDIS ROLAND Signed on: JAN 23, 2023 09:50 AM

Name: HILCORP ENERGY COMPANY

Title: Operation Regulatory Tech Street Address: 382 Road 3100

City: Farmington State: NM

Phone: (505) 599-3400

Email address: kroland@hilcorp.com

### **Field**

**Representative Name:** 

**Street Address:** 

City:

State:

Zip:

Phone:

**Email address:** 

## **BLM Point of Contact**

**BLM POC Name: KENNETH G RENNICK** 

**BLM POC Phone:** 5055647742

**Disposition:** Approved

Signature: Kenneth Rennick

**BLM POC Title:** Petroleum Engineer

BLM POC Email Address: krennick@blm.gov

Disposition Date: 02/01/2023

Page 2 of 2




# HILCORP ENERGY COMPANY San Juan 27-4 Unit 113 NOTICE OF INTENT TO PERMANENTLY ABANDON

**API #:** 3003921016

		JOB PROCEDURES
✓ ✓	NMOCD BLM	Contact OCD and BLM (where applicable) 24 hrs prior to MIRU. Comply with all NMOCD, BLM (where applicable), and HEC safety and environmental regulations.
1.	MIRU service rig	and associated equipment, record all pressures on wellbore.
2.	Load well, ND tre	ee, NU BOPs and test.
3.	MU 2-7/8" 6.5# 0	GR, clear to top perf for CIBP. MU 2-7/8" 6.5# CIBP and set @ 3,976' (PC Top Perf @ 4,026').
4.	Load well with in	shibited brine & circulate clean. Pressure test the csg to 560 psi. Monitor for 30 minutes.
5.	RU ELU, run CB	L from 3,976' to surface. Send CBL to Houston, NMOCD, BLM as needed. Adjust following plug design per CBL.
6.		- 3,976' (CIBP @ 3,976'   Picutred Cliffs Top Perf: 4,026'   Fruitland Top 3,837'   Kirtland Top 3,647'   Ojo Top 3,502') Pump 14sx III "Select" cement and spot a 574' inside plug to cover CIBP & all tops.
7.		c holes in the 2-7/8" csg @ 178'. Establish circulation up annulus.  78' (Surface shoe @ 128') Pump 39sx (9.5bbl) of Class III "Select" cement and spot a 168' inside/outside plug to cover the surface shoe.
8.	LD tubing. ND B	OP and cut off wellhead below surface casing flange as per NMOCD. Top off cement at surface as needed. Weld new P&A maker.




# HILCORP ENERGY COMPANY San Juan 27-4 Unit 113 NOTICE OF INTENT TO PERMANENTLY ABANDON

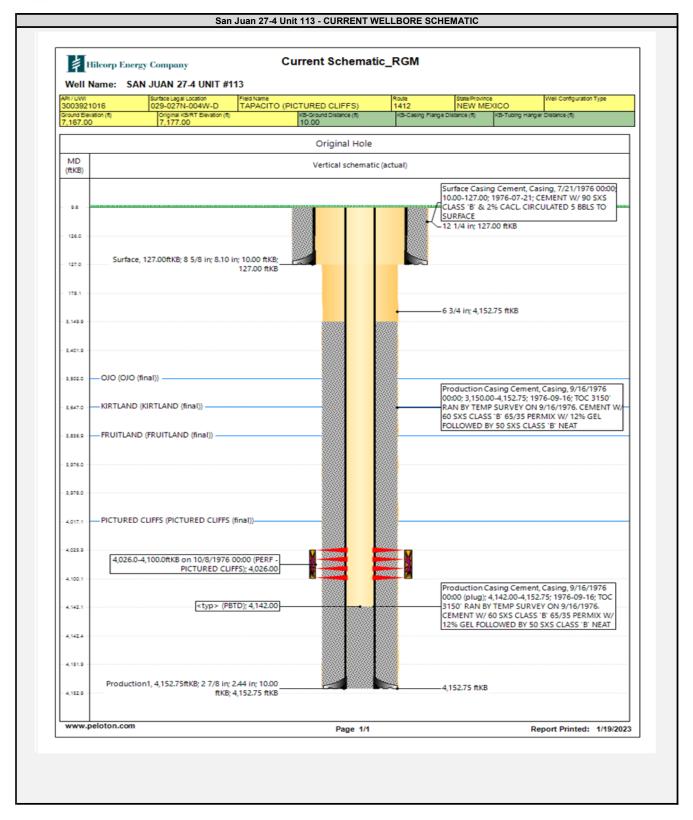



# HILCORP ENERGY COMPANY San Juan 27-4 Unit 113 NOTICE OF INTENT TO PERMANENTLY ABANDON

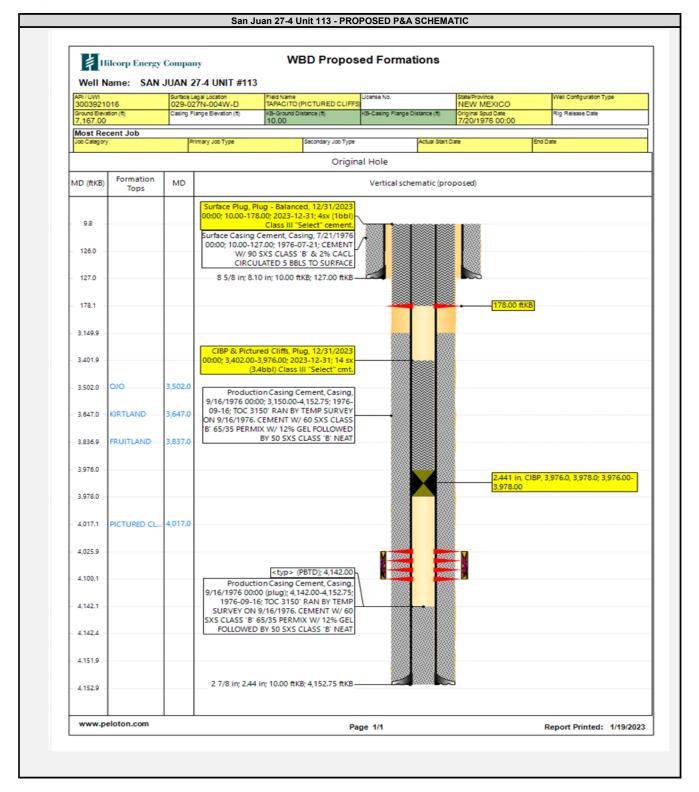

# BLM FLUID MINERALS P&A Geologic Report

**Date Completed:** 2/1/2023

Well No. San Juan 27-4 Unit #113 (A	Location	840	FNL	&	940	FWL	
Lease No. NMSF080670	Sec. 29	T27N			R04W		
Operator Hilcorp Energy Compan	County	Rio Arriba		State	New Mexico		
Total Depth 4153'	PBTD 4142'	Formation	Pictured	Cliffs			
Elevation (GL)	Elevation (KB) 7177'						

<b>Geologic Formations</b>	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose					
Nacimiento			Surface	3502	Surface/Possible freshwater sands
Ojo Alamo Ss			3502	3647	Aquifer (possible freshwater)
Kirtland Shale			3647	3837	Possible gas
Fruitland			3837	4017	Coal/Gas/Water
Pictured Cliffs Ss			4017	PBTD	Gas
Lewis Shale					
Chacra					
Cliff House Ss					
Menefee					
Point Lookout Ss					
Mancos Shale					
Gallup					
Greenhorn					
Graneros Shale					
Dakota Ss					
Morrison					

Remarks:

P & A

- Pictured Cliffs perfs 4026' – 4100'.

Reference Well:
1) Formation Tops
Same

# GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
  - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
  - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
  - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
  - 4.1 The cement shall be as specified in the approved plugging plan.
  - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.3 Surface plugs may be no less than 50' in length.
  - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
  - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

2

- 5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.
  - 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
  - 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
  - 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
  - 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
  - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
  - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain  $H_2S$ .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

(October 2012 Revision)

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

AFMSS 2 Sundry ID 2712094

Attachment to notice of Intention to Abandon

Well: San Juan 27-4 Unit 113

### **CONDITIONS OF APPROVAL**

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 2/1/2023

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 181879

#### **CONDITIONS**

Operator:	OGRID:
HILCORP ENERGY COMPANY	372171
1111 Travis Street Houston, TX 77002	Action Number: 181879
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By		Condition Date
kpickford	CBL required	2/2/2023
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	2/2/2023
kpickford	Adhere to BLM approved COAs and plugs. See BLM COAs and GEO report.	2/2/2023