Form 3160-3 FORM APPROVED OMB No. 1004-0137 (June 2015) Expires: January 31, 2018 **UNITED STATES** DEPARTMENT OF THE INTERIOR 5. Lease Serial No. BUREAU OF LAND MANAGEMENT APPLICATION FOR PERMIT TO DRILL OR REENTER 6. If Indian, Allotee or Tribe Name 7. If Unit or CA Agreement, Name and No. DRILL REENTER 1a. Type of work: 1b. Type of Well: Oil Well Gas Well Other 8. Lease Name and Well No. 1c. Type of Completion: Hydraulic Fracturing Single Zone Multiple Zone 2. Name of Operator 9. API Well No. 30-015-55435 10. Field and Pool, or Exploratory 3a. Address 3b. Phone No. (include area code) 4. Location of Well (Report location clearly and in accordance with any State requirements.\*) 11. Sec., T. R. M. or Blk. and Survey or Area At surface At proposed prod. zone 14. Distance in miles and direction from nearest town or post office\* 12. County or Parish 13. State 15. Distance from proposed\* 16. No of acres in lease 17. Spacing Unit dedicated to this well location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any) 18. Distance from proposed location\* 19. Proposed Depth 20. BLM/BIA Bond No. in file to nearest well, drilling, completed, applied for, on this lease, ft. 21. Elevations (Show whether DF, KDB, RT, GL, etc.) 22. Approximate date work will start\* 23. Estimated duration 24. Attachments The following, completed in accordance with the requirements of Onshore Oil and Gas Order No. 1, and the Hydraulic Fracturing rule per 43 CFR 3162.3-3 (as applicable) 1. Well plat certified by a registered surveyor. 4. Bond to cover the operations unless covered by an existing bond on file (see 2. A Drilling Plan. Item 20 above). 3. A Surface Use Plan (if the location is on National Forest System Lands, the 5. Operator certification. SUPO must be filed with the appropriate Forest Service Office). 6. Such other site specific information and/or plans as may be requested by the 25. Signature Name (Printed/Typed) Date Title Approved by (Signature) Name (Printed/Typed) Date Title Office Application approval does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Conditions of approval, if any, are attached. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction



(Continued on page 2)

\*(Instructions on page 2)

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone: (575) 393-6161 Fax: (575) 393-0720

District III

<u>District II</u> 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

1000 Rio Brazos Road, Aztec, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170 <u>District IV</u>

1220 S. St. Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3460 Fax: (505) 476-3462

#### State of New Mexico

# Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr.

Santa Fe, NM 87505

Form C-102
Revised August 1, 2011
Submit one copy to appropriate
District Office

☐ AMENDED REPORT


#### WELL LOCATION AND ACREAGE DEDICATION PLAT

<sup>1</sup> API Number		<sup>2</sup> Pool Code [98220]	PURPLE SAGE; WOLFCAMP (GAS)				
30-015-55435		[76220]	TORIEL SAGE, WOLFCAMI (GAS)				
<sup>4</sup> Property Code		5 P	roperty Name	<sup>6</sup> Well Number			
319562	319562		LUSITANO 27-34 FED COM				
<sup>7</sup> OGRID No.		8 O	<sup>9</sup> Elevation				
6137		DEVON ENERGY PRO	3337.2				

<sup>10</sup> Surface Location

					~ 0.11100	e notation			
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
A	27	25 S	31 E		235	NORTH	1034	EAST	EDDY
" Bottom Hole Location If Different From Surface									
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
P	34	25 S	31 E		20	SOUTH	990	EAST	EDDY
12 Dedicated Acre	s 13 Joint	or Infill	Consolidation	n Code			15 Order No.		
640-NS	L								

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

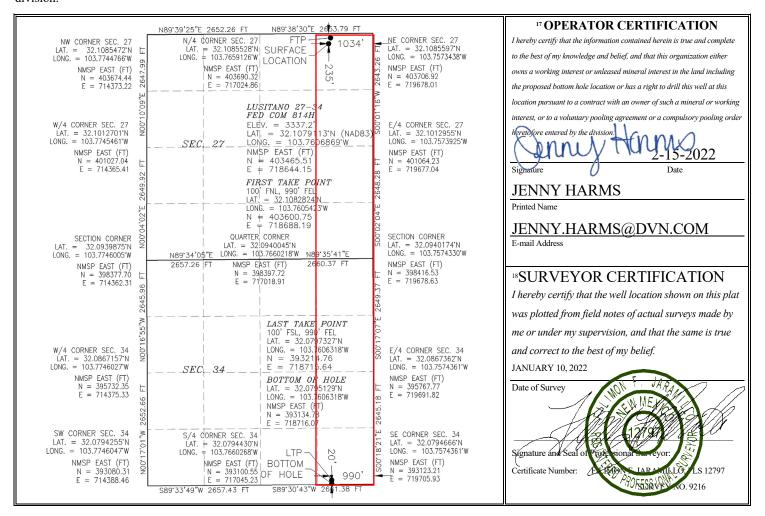

Intent	t X	As Dril	led											
API#														
DEV	rator Nai /ON EN MPANY	IERGY P	RODUG	CTION	I		erty N ITAN			FED	COI	М		Well Number 814H
Kick C	Off Point	(KOP)												
UL	Section 27	Township 25S	Range 31E	Lot	Feet 58 FNL		From N	I/S	Feet 991		From	n E/W	County EDDY	
Latitu	ide 108304	76			Longitu -103.		2861		I				NAD 83	
First 1	Гаke Poir	nt (FTP)												
UL <b>A</b>	Section 27	Township 25S	Range 31E	Lot	Feet 100		From N		Feet 990		From	n E/W ST	County EDDY	
Latitu 32.1	l 08282	4			Longitu 103.7		423		I				NAD 83	
Last T	ake Poin	t (LTP)												
UL P	Section 34	Township 25S	Range 31E	Lot	Feet 100	From	n N/S JTH	Feet 990		From		Count		
Latitu 32.0	ode 079732	7			Longitu 103.7		318					NAD 83		
Is this	well the	defining v	vell for th	e Horiz	ontal Sp	oacing	Unit?		N					
Is this	well an	infill well?		Υ	]									
	l is yes p ng Unit.	lease prov	ide API if	availab	le, Oper	rator <b>N</b>	Name :	and v	vell n	umbei	r for I	Definir	ng well fo	r Horizontal
API#			]											
Ope	rator Nai	me:				Prop	erty N	lame	:					Well Number

KZ 06/29/2018

# State of New Mexico Energy, Minerals and Natural Resources Department

Submit Electronically
Via E-permitting

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

# NATURAL GAS MANAGEMENT PLAN

This Natural Gas Management Plan must be submitted with each Application for Permit to Drill (APD) for a new or recompleted well.

# Section 1 - Plan Description Effective May 25, 2021

I. Operator: DEVON ENE	RGY PRODUCTI	ION COMPANY, LP	OGRID: 613	37	Date:	2 I <sub>1</sub> I <sub>2022</sub>
II. <b>Type:</b> ▶ Original □	☐ Amendment	due to□ 19.15.27.	9.D(6)(a) NMA	C □ 19.15.27.9.D(	6)(b) NMAC 🗆 (	Other.
If Other, please describe	:					
III. <b>Well(s):</b> Provide the be recompleted from a si					vells proposed to	be drilled or proposed to
Well Name	API	ULSTR	Footages	Anticipated Oil BBL/D	Anticipated Gas MCF/D	Anticipated Produced Water BBL/D
See attachment.						
IV. Central Delivery Pov. Anticipated Schedul proposed to be recomple  Well Name	e: Provide the	following informat			rell or set of wells	
See attachment						
VI. Separation Equipm  VII. Operational Pract Subsection A through F  VIII. Best Managemen during active and planne	tices:  Attacle of 19.15.27.8  t Practices:	h a complete descr NMAC.  Attach a complete	iption of the act	ions Operator will	take to comply v	-

NATURAL GAS MANAGEMENT PLAN Section 1 - Plan Description

III. Well(s): Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

Well Name	Central Delivery Point Name:	API	ULSTR	FOOTA	AGES				Anticipated Produced Water BBL/D
Lusitano 27-34 Fed 812H	Lusitano 27 CTB 4		27-25S-31E	1492 FWL	235 FNL	WFMP B100	(+/-)6319mcfd/(+/	/-)886bopd/(+/	-)4728bwpd
Lusitano 27-34 Fed 822H	Lusitano 27 CTB 4		27-25S-31E	1522 FWL	235 FNL	WFMP B200	(+/-)7968mcfd/(+/	/-)528bopd/(+/	/-)4567bwpd
Lusitano 27-34 Fed 832H	Lusitano 27 CTB 4		27-25S-31E	1552 FWL	235 FNL	WFMP B300	(+/-)7968mcfd/(+/	/-)528bopd/(+/	/-)4567bwpd
Lusitano 27-34 Fed Com 524H	Lusitano 27 CTB 4		27-25S-31E	1905 FEL	385 FNL	AVLN B	(+/-)5663 mcfd/(+/	-/-)1408bopd/(	+/-)3169 bwpd
Lusitano 27-34 Fed Com 124H (535H)	Lusitano 27 CTB 4		27-25S-31E	1875 FEL	385 FNL	2BSLT	(+/-)3736mcfd/(+/-	-)1291bopd/(+	/-)5000bwpd
Lusitano 27-34 Fed Com 234H (525H)	Lusitano 27 CTB 4		27-25S-31E	1845 FEL	385 FNL	2BSSS	(+/-) 3749mcfd/(+/	/-)1384bopd/(-	+/-)5713bwpd
Lusitano 27-34 Fed Com 526H	Lusitano 27 CTB 4		27-25S-31E	1815 FEL	385 FNL	AVLN B	(+/-)5663 mcfd/(+/	-/-)1408bopd/(	+/-)3169 bwpd
Lusitano 27-34 Fed Com 813H	Lusitano 27 CTB 4		27-25S-31E	1754 FEL	235 FNL	WFMP B100	(+/-)6319mcfd/(+/	/-)886bopd/(+/	/-)4728bwpd
Lusitano 27-34 Fed Com 823H	Lusitano 27 CTB 4		27-25S-31E	1724 FEL	235 FNL	WFMP B200	(+/-)7968mcfd/(+/	/-)528bopd/(+/	/-)4567bwpd
Lusitano 27-34 Fed Com 833H	Lusitano 27 CTB 4		27-25S-31E	1694 FEL	235 FNL	WFMP B300	(+/-)7968mcfd/(+/	/-)528bopd/(+/	/-)4567bwpd
Lusitano 27-34 Fed Com 814H	Lusitano 27 CTB 4		27-25S-31E	1034 FEL	235 FNL	WFMP B100	(+/-)6319mcfd/(+/	/-)886bopd/(+/	'-)4728bwpd
Lusitano 27-34 Fed Com 824H	Lusitano 27 CTB 4		27-25S-31E	1004 FEL	235 FNL	WFMP B200	(+/-)7968mcfd/(+/	/-)528bopd/(+/	'-)4567bwpd
Lusitano 27-34 Fed Com 834H	Lusitano 27 CTB 4		27-25S-31E	974 FEL	235 FNL	WFMP B300	(+/-)7968mcfd/(+/	/-)528bopd/(+/	/-)4567bwpd
Lusitano 34-15 Fed 533H	Lusitano 34 CTB 1		34-25S-31E	1730 FWL	610 FNL	AVLN B	(+/-)5663 mcfd/(+,	-/-)1408bopd/(	+/-)3169 bwpd
Lusitano 34-15 Fed 123H	Lusitano 34 CTB 1		34-25S-31E	1760 FWL	610 FNL	2BSLT	(+/-)3736mcfd/(+/-	-)1291bopd/(+	/-)5000bwpd
Lusitano 34-15 Fed 233H	Lusitano 34 CTB 1		34-25S-31E	1790 FWL	610 FNL	2BSSS	(+/-) 3749mcfd/(+/	/-)1384bopd/(-	+/-)5713bwpd
Lusitano 34-15 Fed 523H	Lusitano 34 CTB 1		34-25S-31E	1820 FWL	610 FNL	AVLN B	(+/-)5663 mcfd/(+,	-/-)1408bopd/(	+/-)3169 bwpd

V. Anticipated Schedule: Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

			TO 0	Completion		First
		1	TD Reached		Initial Flow	Production
Well Name	API	Spud Date	Date	ent Date	back Date	Date
Lusitano 27-34 Fed 812H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/2023
Lusitano 27-34 Fed 822H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 27-34 Fed 832H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 27-34 Fed Com 524H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/2023
Lusitano 27-34 Fed Com 124H (535H)		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/2023
Lusitano 27-34 Fed Com 234H (525H)		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 27-34 Fed Com 526H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/2023
Lusitano 27-34 Fed Com 813H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 27-34 Fed Com 823H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 27-34 Fed Com 833H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 27-34 Fed Com 814H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 27-34 Fed Com 824H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 27-34 Fed Com 834H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 34-15 Fed 533H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 34-15 Fed 123H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 34-15 Fed 233H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202
Lusitano 34-15 Fed 523H		2/11/2023	3/13/2023	7/11/2023	7/11/2023	7/11/202

\*dates above are subject to change

## Section 2 - Enhanced Plan EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

🗵 Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

#### IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF

#### X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

- **XI. Map.**  $\square$  Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.
- **XII.** Line Capacity. The natural gas gathering system D will D will not have capacity to gather 100% of the anticipated natural gas production volume from the well prior to the date of first production.
- **XIII.** Line Pressure. Operator D does D does not anticipate that its existing well(s) connected to the same segment, or portion, of the natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s).
- D Attach Operator's plan to manage production in response to the increased line pressure.
- **XIV. Confidentiality:** D Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information provided in Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific information for which confidentiality is asserted and the basis for such assertion.

## **Section 3 - Certifications**

# Effective May 25, 2021

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal:

- 🖾 Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or
- D Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system. If Operator checks this box, Operator will select one of the following:

**Well Shut-In.** D Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or

**Venting and Flaring Plan.** D Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including:

- (a) power generation on lease;
- **(b)** power generation for grid;
- (c) compression on lease;
- (d) liquids removal on lease;
- (e) reinjection for underground storage;
- (f) reinjection for temporary storage;
- (g) reinjection for enhanced oil recovery;
- (h) fuel cell production; and
- (i) other alternative beneficial uses approved by the division.

## **Section 4 - Notices**

- 1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:
- (a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or
- (b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.
- 2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

I certify that, after reasonable inquiry, the statements in and attached to this Natural Gas Management Plan are true and correct to the best of my knowledge and acknowledge that a false statement may be subject to civil and criminal penalties under the Oil and Gas Act.



#### VI. Separation Equipment

Devon Energy Production Company, L.P. utilizes a "stage separation" process in which oil and gas separation is carried out through a series of separators operating at successively reduced pressures. Hydrocarbon liquids are produced into a high-pressure inlet separator, then carried through one or more lower pressure separation vessels before entering the storage tanks. The purpose of this separation process is to attain maximum recovery of liquid hydrocarbons from the fluids and allow maximum capture of produced gas into the sales pipeline. Devon utilizes a series of Low-Pressure Compression units to capture gas off the staged separation and send it to the sales pipeline. This process minimizes the amount of flash gas that enters the end-stage storage tanks that is subsequently vented or flared.



#### VII. Operational Practices

Devon Energy Production Company, L. P. will employ best management practices and control technologies to maximize the recovery and minimize waste of natural gas through venting and flaring.

- During drilling operations, Devon will utilize flares and/or combustors to capture and control
  natural gas, where technically feasible. If flaring is deemed technically in-feasible, Devon will
  employ best management practices to minimize or reduce venting to the extent possible.
- During completions operations, Devon will utilize Green Completion methods to capture gas
  produced during well completions that is otherwise vented or flared. If capture is technically
  in-feasible, flares and/or combustors will be used to capture and control flow back fluids
  entering into frac tanks during initial flowback. Upon indication of first measurable hydrocarbon
  volumes, Devon will turn operations to onsite separation vessels and flow to the gathering
  pipeline.
- During production operations, Devon will take every practical effort to minimize waste of natural gas through venting and flaring by:
  - Designing and constructing facilities in a manner consistent to achieve maximum capture and control of hydrocarbon liquids & produced gas
  - Utilizing a closed-loop capture system to collect and route produced gas to sales line via low pressure compression, or to a flare/combustor
  - o Flaring in lieu of venting, where technically feasible
  - Utilizing auto-ignitors or continuous pilots, with thermocouples connected to Scada, to quickly detect and resolve issues related to malfunctioning flares/combustors
  - Employ the use of automatic tank gauging to minimize storage tank venting during loading events
  - o Installing air-driven or electric-driven pneumatics & combustion engines, where technically feasible to minimize venting to the atmosphere
  - Confirm equipment is properly maintained and repaired through a preventative maintenance and repair program to ensure equipment meets all manufacturer specifications
  - Conduct and document AVO inspections on the frequency set forth in Part 27 to detect and repair any onsite leaks as quickly and efficiently as is feasible



## VIII. Best Management Practices during Maintenance

Devon Energy Production Company, L.P. will utilize best management practices to minimize venting during active and planned maintenance activities. Devon is operating under guidance that production facilities permitted under NOI permits have no provisions to allow high pressure flaring and high pressure flaring is only allowed in disruption scenarios so long as the duration is less than eight hours. When technically feasible, flaring during maintenance activities will be utilized in lieu of venting to the atmosphere. Devon will work with third-party operators during scheduled maintenance of downstream pipeline or processing plants to address those events ahead of time to minimize venting. Actions considered include identifying alternative capture approaches or planning to temporarily reduce production or shut in the well to address these circumstances.

## Lusitano 27-34 Fed Com 814H

## 1. Geologic Formations

TVD of target	12205	Pilot hole depth	N/A
MD at TD:	22567	Deepest expected fresh water	

#### **Basin**

Dasin	Depth	Water/Mineral	
T4!			II J - *
Formation	(TVD)	Bearing/Target	Hazards*
	from KB	Zone?	
Rustler	868		
Salt	1325		
Base of Salt	4074		
Delaware	4306		
Cherry Canyon	5467		
Brushy Canyon	6680		
1st Bone Spring Lime	8264		
Bone Spring 1st	9283		
Bone Spring 2nd	9978		
3rd Bone Spring Lime	10402		
Bone Spring 3rd	11195		
Wolfcamp	11656		

<sup>\*</sup>H2S, water flows, loss of circulation, abnormal pressures, etc.

2. Casing Program (Primary Design)

	Wt Casing I		Interval	Casing Interval				
Hole Size	Csg. Size	(PPF)	Grade	Conn	From (MD)	To (MD)	From (TVD)	To (TVD)
17 1/2	13 3/8	48	H40	STC	0	893	0	893
9 7/8	8 5/8	32	P110	TLW	0	11195	0	11195
7 7/8	5 1/2	17	P110	ВТС	0	22567	0	12205

<sup>•</sup> All casing strings will be tested in accordance with Onshore Oil and Gas Order #2 IILB.1.h Must have table for contingency casing.

3. Cementing Program (Primary Design)

Casing	# Sks	TOC	Wt.	Yld (ft3/sack)	Slurry Description
Surface	685	Surf	13.2	1.44	Lead: Class C Cement + additives
Total	446	Surf	9	3.27	Lead: Class C Cement + additives
Int 1	465	4000' above	13.2	1.44	Tail: Class H / C + additives
Int 1	As Needed	Surf	13.2	1.44	Squeeze Lead: Class C Cement + additives
Intermediate	446	Surf	9	3.27	Lead: Class C Cement + additives
Squeeze	465	4000' above	13.2	1.44	Tail: Class H / C + additives
Production	117	9731	9	3.27	Lead: Class H /C + additives
Troduction	1434	11731	13.2	1.44	Tail: Class H / C + additives

Casing String	% Excess
Surface	50%
Intermediate 1	30%
Intermediate 1 (Two Stage)	25%
Prod	10%

4. Pressure Control Equipment (Three String Design)

BOP installed and tested before drilling which hole?	Size?	Min. Required WP	Ty	ype	<b>√</b>	Tested to:	
			Annular		X	50% of rated working pressure	
Int 1	13-58"	5M	Blind	d Ram	X		
IIIL I	15-38	JIVI	Pipe	Ram		5M	
			Doub	le Ram	X	3101	
			Other*			]	
			Annular (5M)		X	100% of rated working pressure	
Don't sellen	13-5/8"	101/1	Blind Ram		X		
Production		10M	Pipe Ram			101/	
			Double Ram		X	10M	
			Other*				
			Annul	ar (5M)			
	Blind Ram						
			Pipe Ram			1	
			Double Ram			]	
			Other*			1	
N A variance is requested for	A variance is requested for the use of a diverter on the surface casing. See attached for schematic.						
Y A variance is requested to 1	A variance is requested to run a 5 M annular on a 10M system						

5. Mud Program (Three String Design)

Section	Туре	Weight (ppg)
Surface	FW Gel	8.5-9
Intermediate	DBE / Cut Brine	10-10.5
Production	OBM	10-10.5

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times.

What will be used to monitor the loss or gain of fluid?	PVT/Pason/Visual Monitoring
E	C

6. Logging and Testing Procedures

- 00 0	** - *888 *** - *** - *** - ***						
Logging, C	Logging, Coring and Testing						
	Will run GR/CNL from TD to surface (horizontal well - vertical portion of hole). Stated logs run will be in the						
X	Completion Report and sbumitted to the BLM.						
	No logs are planned based on well control or offset log information.						
	Drill stem test? If yes, explain.						
	Coring? If yes, explain.						

Additional	logs planned	Interval
	Resistivity	Int. shoe to KOP
	Density	Int. shoe to KOP
X	CBL	Production casing
X	Mud log	Intermediate shoe to TD
	PEX	

7. Drilling Conditions

Condition	Specfiy what type and where?
BH pressure at deepest TVD	6664
Abnormal temperature	No

Mitigation measure for abnormal conditions. Describe. Lost circulation material/sweeps/mud scavengers.

Hydrogren Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the operator will comply with the provisions of Onshore Oil and Gas Order #6. If Hydrogen Sulfide is encountered measured values and formations will be provided to the RLM

Cheountered	cheountered measured values and formations will be provided to the BEW.					
N	H2S is present					
Y	H2S plan attached.					

#### 8. Other facets of operation

Is this a walking operation? Potentially

- 1 If operator elects, drilling rig will batch drill the surface holes and run/cement surface casing; walking the rig to next wells on the pad.
- 2 The drilling rig will then batch drill the intermediate sections and run/cement intermediate casing; the wellbore will be isolated with a blind flange and pressure gauge installed for monitoring the well before walking to the
- 3 The drilling rig will then batch drill the production hole sections on the wells with OBM, run/cement production casing, and install TA caps or tubing heads for completions.

NOTE: During batch operations the drilling rig will be moved from well to well however, it will not be removed

#### Lusitano 27-34 Fed Com 814H

from the pad until all wells have production casing run/cemented.

Will be pre-setting casing? Potentially

- 1 Spudder rig will move in and batch drill surface hole.
  - a. Rig will utilize fresh water based mud to drill surface hole to TD. Solids control will be handled entirely on a closed loop basis.,
- 2 After drilling the surface hole section, the spudder rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
- $^{3}$  The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- 4 A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with a pressure gauge installed on the wellhead.
- 5 Spudder rig operations is expected to take 4-5 days per well on a multi-well pa.
- 6 The NMOCD will be contacted and notified 24 hours prior to commencing spudder rig operations.
- 7 Drilling operations will be performed with drilling rig. A that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
  - a. The NMOCD will be contacted / notified 24 hours before the drilling rig moves back on to the pad with the pre-set surface casing.

Attachments	
X	Directional Plan
	Other, describe



## U.S. Department of the Interior **BUREAU OF LAND MANAGEMENT**

# **Drilling Plan Data Report**

09/03/2024

**APD ID:** 10400083394 Submission Date: 02/17/2022

Operator Name: DEVON ENERGY PRODUCTION COMPANY LP

Well Name: LUSITANO 27-34 FED COM Well Number: 814H

Well Type: OIL WELL Well Work Type: Drill

Highlighted data reflects the most recent changes

**Show Final Text** 

# **Section 1 - Geologic Formations**

Formation			True Vertical	Measured		Mineral Resources	Producing
ID	Formation Name	Elevation		Depth	Lithologies		Formatio
14049893	UNKNOWN	3335	0	Ö	ALLUVIUM, OTHER : Surface	NONE	N
14049894	RUSTLER	2467	868	868	SANDSTONE	NONE	N
14049898	TOP SALT	2010	1325	1325	SALT	NONE	N
14049896	BASE OF SALT	-739	4074	4074	SALT	NONE	N
14049902	BELL CANYON	-971	4306	4306	SANDSTONE	NATURAL GAS, OIL	N
14049903	CHERRY CANYON	-2132	5467	5467	SANDSTONE	NATURAL GAS, OIL	N
14049904	BRUSHY CANYON	-3345	6680	6680	SANDSTONE	NATURAL GAS, OIL	N
14049905	BONE SPRING LIME	-4929	8264	8264	LIMESTONE	NATURAL GAS, OIL	N
14049895	BONE SPRING	-5948	9283	9283	SANDSTONE	NATURAL GAS, OIL	N
14049892	BONE SPRING 2ND	-6643	9978	9978	SANDSTONE	NATURAL GAS, OIL	N
14049906	BONE SPRING LIME	-7067	10402	10402	LIMESTONE	NATURAL GAS, OIL	N
14049900	BONE SPRING 3RD	-7860	11195	11195	SANDSTONE	NATURAL GAS	N
14049899	WOLFCAMP	-8321	11656	11656	SANDSTONE	NATURAL GAS, OIL	Y
14049901	STRAWN	-10813	14148	14148	LIMESTONE	NATURAL GAS, OIL	N

## **Section 2 - Blowout Prevention**



# Commitment Runs Deep



Design Plan
Operation and Maintenance Plan
Closure Plan

SENM - Closed Loop Systems June 2010

#### I. Design Plan

Devon uses MI SWACO closed loop system (CLS). The MI SWACO CLS is designed to maintain drill solids at or below 5%. The equipment is arranged to progressively remove solids from the largest to the smallest size. Drilling fluids can thus be reused and savings is realized on mud and disposal costs. Dewatering may be required with the centrifuges to insure removal of ultra fine solids.

The drilling location is constructed to allow storm water to flow to a central sump normally the cellar. This insures no contamination leaves the drilling pad in the event of a spill. Storm water is reused in the mud system or stored in a reserve fluid tank farm until it can be reused. All lubricants, oils, or chemicals are removed immediately from the ground to prevent the contamination of storm water. An oil trap is normally installed on the sump if an oil spill occurs during a storm.

A tank farm is utilized to store drilling fluids including fresh water and brine fluids. The tank farm is constructed on a 20 ml plastic lined, bermed pad to prevent the contamination of the drilling site during a spill. Fluids from other sites may be stored in these tanks for processing by the solids control equipment and reused in the mud system. At the end of the well the fluids are transported from the tank farm to an adjoining well or to the next well for the rig.


Prior to installing a closed-loop system on site, the topsoil, if present, will be stripped and stockpiled for use as the final cover or fill at the time of closure.

Signs will be posted on the fence surrounding the closed-loop system unless the closed-loop system is located on a site where there is an existing well, that is operated by Devon.

#### II. Operations and Maintenance Plan

*Primary Shakers:* The primary shakers make the first removal of drill solids from the drilling mud as it leaves the well bore. The shakers are sized to handle maximum drilling rate at optimal screen size. The shakers normally remove solids down to 74 microns.

Mud Cleaner: The Mud Cleaner cleans the fluid after it leaves the shakers. A set of hydrocyclones are sized to handle 1.25 to 1.5 times the maximum circulating rate. This ensures all the fluid is being processed to an average cut point of 25 microns. The wet discharged is dewatered on a shaker equipped with ultra fine mesh screens and generally cut at 40 microns.

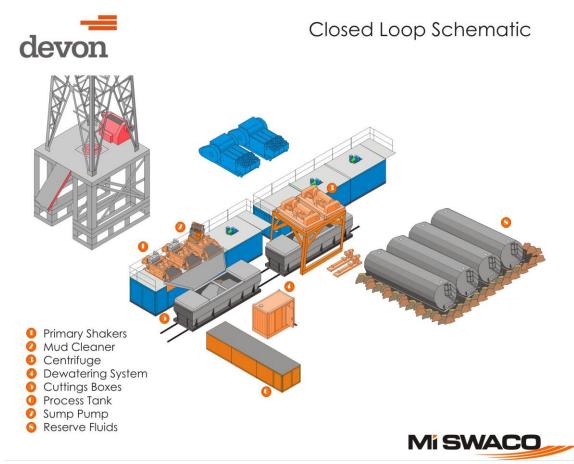

Centrifuges: The centrifuges can be one or two in number depending on the well geometry or depth of well. The centrifuges are sized to maintain low gravity solids at 5% or below. They may or may not need a dewatering system to enhance the removal rates. The centrifuges can make a cut point of 8-10 microns depending on bowl speed, feed rate, solids loading and other factors.

The centrifuge system is designed to work on the active system and be flexible to process incoming fluids from other locations. This set-up is also dependant on well factors.

Dewatering System: The dewatering system is a chemical mixing and dosing system designed to enhance the solids removal of the centrifuge. Not commonly used in shallow wells. It may contain pH adjustment, coagulant mixing and dosing, and polymer mixing and dosing. Chemical flocculation binds ultra fine solids into a mass that is within the centrifuge operating design. The

dewatering system improves the centrifuge cut point to infinity or allows for the return of clear water or brine fluid. This ability allows for the ultimate control of low gravity solids.

Cuttings Boxes: Cuttings boxes are utilized to capture drill solids that are discarded from the solids control equipment. These boxes are set upon a rail system that allows for the removal and replacement of a full box of cuttings with an empty one. They are equipped with a cover that insures no product is spilled into the environment during the transportation phase.

*Process Tank*: (Optional) The process tank allows for the holding and process of fluids that are being transferred into the mud system. Additionally, during times of lost circulation the process tank may hold active fluids that are removed for additional treatment. It can further be used as a mixing tank during well control conditions.

Sump and Sump Pump: The sump is used to collect storm water and the pump is used to transfer this fluid to the active system or to the tank for to hold in reserve. It can also be used to collect fluids that may escape during spills. The location contains drainage ditches that allow the location fluids to drain to the sump.

Reserve Fluids (Tank Farm): A series of frac tanks are used to replace the reserve pit. These are steel tanks that are equipped with a manifold system and a transfer pump. These tanks can contain any number of fluids used during the drilling process. These can include fresh water, cut brine, and saturated salt fluid. The fluid can be from the active well or reclaimed fluid from other locations. A 20 ml liner and berm system is employed to ensure the fluids do not migrate to the environment during a spill.

If a leak develops, the appropriate division district office will be notified within 48 hours of the discovery and the leak will be addressed. Spill prevention is accomplished by maintaining pump packing, hoses, and pipe fittings to insure no leaks are occurring. During an upset condition the source of the spill is isolated and repaired as soon as it is discovered. Free liquid is removed by a diaphragm pump and returned to the mud system. Loose topsoil may be used to stabilize the spill and the contaminated soil is excavated and placed in the cuttings boxes. After the well is finished and the rig has moved, the entire location is scrapped and testing will be performed to determine if a release has occurred.

All trash is kept in a wire mesh enclosure and removed to an approved landfill when full. All spent motor oils are kept in separate containers and they are removed and sent to an approved recycling center. Any spilled lubricants, pipe


dope, or regulated chemicals are removed from soil and sent to landfills approved for these products.

These operations are monitored by Mi Swaco service technicians. Daily logs are maintained to ensure optimal equipment operation and maintenance. Screen and chemical use is logged to maintain inventory control. Fluid properties are monitored and recorded and drilling mud volumes are accounted for in the mud storage farm. This data is kept for end of well review to insure performance goals are met. Lessons learned are logged and used to help with continuous improvement.

A MI SWACO field supervisor manages from 3-5 wells. They are responsible for training personnel, supervising installations, and inspecting sites for compliance of MI SWACO safety and operational policy.

#### III. Closure Plan

A maximum 340' X 340' caliche pad is built per well. All of the trucks and steel tanks fit on this pad. All fluid cuttings go to the steel tanks to be hauled by various trucking companies to an agency approved disposal.

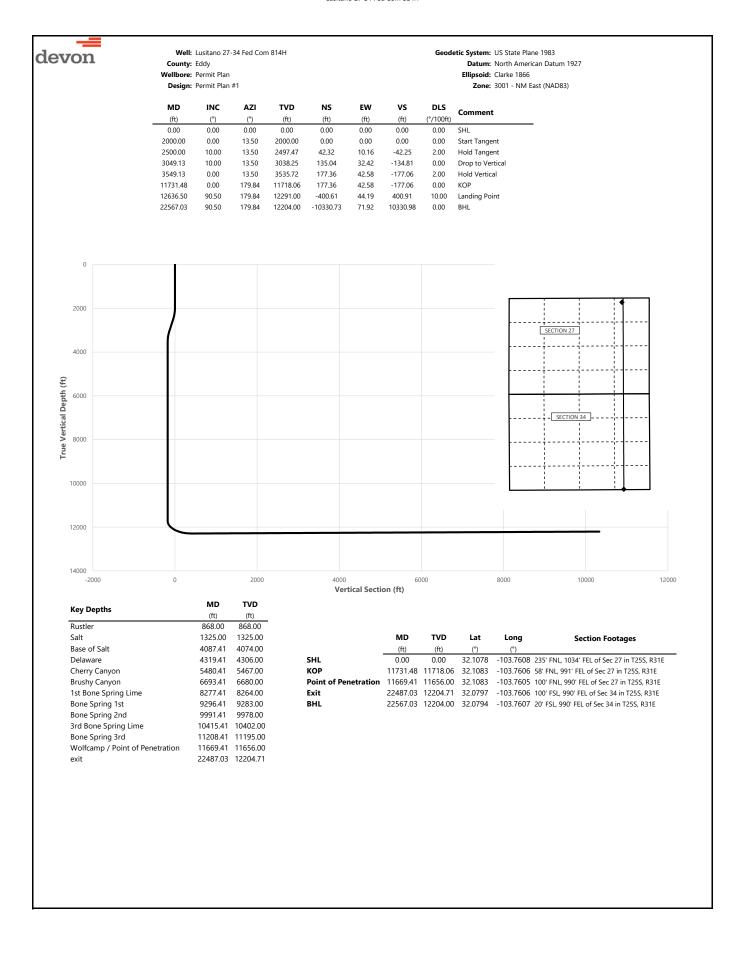



County: Eddy
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

**Datum:** North American Datum 1927 **Ellipsoid:** Clarke 1866

	Design:	Permit Plan	#1					<b>Zone:</b> 3001 - NM East (NAD83)
MD	INC	AZI	TVD	NS	EW	vs	DLS	Comment
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	
0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	SHL
100.00 200.00	0.00	13.50 13.50	100.00 200.00	0.00 0.00	0.00	0.00	0.00	
300.00	0.00	13.50	300.00	0.00	0.00	0.00	0.00	
400.00	0.00	13.50	400.00	0.00	0.00	0.00	0.00	
500.00	0.00	13.50	500.00	0.00	0.00	0.00	0.00	
600.00	0.00	13.50	600.00	0.00	0.00	0.00	0.00	
700.00	0.00	13.50	700.00	0.00	0.00	0.00	0.00	
800.00	0.00	13.50	800.00	0.00	0.00	0.00	0.00	
868.00	0.00	13.50	868.00	0.00	0.00	0.00	0.00	Rustler
900.00 1000.00	0.00	13.50 13.50	900.00 1000.00	0.00 0.00	0.00	0.00	0.00	
1100.00	0.00	13.50	1100.00	0.00	0.00	0.00	0.00	
1200.00	0.00	13.50	1200.00	0.00	0.00	0.00	0.00	
1300.00	0.00	13.50	1300.00	0.00	0.00	0.00	0.00	
1325.00	0.00	13.50	1325.00	0.00	0.00	0.00	0.00	Salt
1400.00	0.00	13.50	1400.00	0.00	0.00	0.00	0.00	
1500.00	0.00	13.50	1500.00	0.00	0.00	0.00	0.00	
1600.00 1700.00	0.00	13.50 13.50	1600.00 1700.00	0.00 0.00	0.00	0.00	0.00	
1800.00	0.00	13.50	1800.00	0.00	0.00	0.00	0.00	
1900.00	0.00	13.50	1900.00	0.00	0.00	0.00	0.00	
2000.00	0.00	13.50	2000.00	0.00	0.00	0.00	0.00	Start Tangent
2100.00	2.00	13.50	2099.98	1.70	0.41	-1.69	2.00	-
2200.00	4.00	13.50	2199.84	6.79	1.63	-6.77	2.00	
2300.00	6.00	13.50	2299.45	15.26	3.66	-15.23	2.00	
2400.00 2500.00	8.00	13.50	2398.70	27.11	6.51	-27.06	2.00	Hold Tangent
2600.00	10.00 10.00	13.50 13.50	2497.47 2595.95	42.32 59.21	10.16 14.21	-42.25 -59.10	2.00 0.00	Hold Langent
2700.00	10.00	13.50	2694.43	76.09	18.27	-75.96	0.00	
2800.00	10.00	13.50	2792.91	92.98	22.32	-92.82	0.00	
2900.00	10.00	13.50	2891.39	109.86	26.38	-109.67	0.00	
3000.00	10.00	13.50	2989.87	126.75	30.43	-126.53	0.00	
3049.13	10.00	13.50	3038.25	135.04	32.42	-134.81	0.00	Drop to Vertical
3100.00	8.98	13.50	3088.43	143.20	34.38	-142.95	2.00	
3200.00 3300.00	6.98 4.98	13.50 13.50	3187.45 3286.90	156.70 166.83	37.62 40.05	-156.43 -166.55	2.00 2.00	
3400.00	2.98	13.50	3386.66	173.59	41.67	-173.29	2.00	
3500.00	0.98	13.50	3486.59	176.95	42.48	-176.65	2.00	
3549.13	0.00	13.50	3535.72	177.36	42.58	-177.06	2.00	Hold Vertical
3600.00	0.00	179.84	3586.59	177.36	42.58	-177.06	0.00	
3700.00	0.00	179.84	3686.59	177.36	42.58	-177.06	0.00	
3800.00	0.00	179.84	3786.59	177.36	42.58	-177.06	0.00	
3900.00 4000.00	0.00	179.84 179.84	3886.59 3986.59	177.36 177.36	42.58 42.58	-177.06 -177.06	0.00	
4087.41	0.00	179.84	4074.00	177.36	42.58	-177.06	0.00	Base of Salt
4100.00	0.00	179.84	4086.59	177.36	42.58	-177.06	0.00	
4200.00	0.00	179.84	4186.59	177.36	42.58	-177.06	0.00	
4300.00	0.00	179.84	4286.59	177.36	42.58	-177.06	0.00	
4319.41	0.00	179.84	4306.00	177.36	42.58	-177.06	0.00	Delaware
4400.00 4500.00	0.00	179.84 179.84	4386.59 4486.59	177.36 177.36	42.58 42.58	-177.06 -177.06	0.00	
4600.00	0.00	179.84	4586.59	177.36	42.58	-177.06 -177.06	0.00	
4700.00	0.00	179.84	4686.59	177.36	42.58	-177.06	0.00	
4800.00	0.00	179.84	4786.59	177.36	42.58	-177.06	0.00	
4900.00	0.00	179.84	4886.59	177.36	42.58	-177.06	0.00	
5000.00	0.00	179.84	4986.59	177.36	42.58	-177.06	0.00	
5100.00	0.00	179.84	5086.59	177.36	42.58	-177.06 -177.06	0.00	
5200.00 5300.00	0.00	179.84 179.84	5186.59 5286.59	177.36 177.36	42.58 42.58	-177.06 -177.06	0.00	
5400.00	0.00	179.84	5386.59	177.36	42.58	-177.06	0.00	
5480.41	0.00	179.84	5467.00	177.36	42.58	-177.06	0.00	Cherry Canyon
5500.00	0.00	179.84	5486.59	177.36	42.58	-177.06	0.00	
5600.00	0.00	179.84	5586.59	177.36	42.58	-177.06	0.00	
5700.00	0.00	179.84	5686.59	177.36	42.58	-177.06	0.00	
5800.00	0.00	179.84	5786.59	177.36	42.58	-177.06 177.06	0.00	
5900.00 6000.00	0.00	179.84 179.84	5886.59 5986.59	177.36 177.36	42.58 42.58	-177.06 -177.06	0.00	
6100.00	0.00	179.84	6086.59	177.36	42.58	-177.06	0.00	
6200.00	0.00	179.84	6186.59	177.36	42.58	-177.06	0.00	



County: Eddy
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

**Datum:** North American Datum 1927 **Ellipsoid:** Clarke 1866

Design: Permit Plan #1								Zone: 3001 - NM East (NAD83)			
MD	INC	AZI	TVD	NS	EW	vs	DLS				
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	Comment			
6300.00	0.00	179.84	6286.59	177.36	42.58	-177.06	0.00				
6400.00	0.00	179.84	6386.59	177.36	42.58	-177.06	0.00				
6500.00	0.00	179.84	6486.59	177.36	42.58	-177.06	0.00				
6600.00	0.00	179.84	6586.59	177.36	42.58	-177.06	0.00				
6693.41	0.00	179.84	6680.00	177.36	42.58	-177.06	0.00	Brushy Canyon			
6700.00	0.00	179.84	6686.59	177.36	42.58	-177.06	0.00				
6800.00	0.00	179.84	6786.59	177.36	42.58	-177.06	0.00				
6900.00	0.00	179.84	6886.59	177.36	42.58	-177.06	0.00				
7000.00	0.00	179.84	6986.59		42.58	-177.06	0.00				
	0.00	179.84		177.36		-177.06	0.00				
7100.00			7086.59	177.36	42.58						
7200.00	0.00	179.84	7186.59	177.36	42.58	-177.06	0.00				
7300.00	0.00	179.84	7286.59	177.36	42.58	-177.06	0.00				
7400.00	0.00	179.84	7386.59	177.36	42.58	-177.06	0.00				
7500.00	0.00	179.84	7486.59	177.36	42.58	-177.06	0.00				
7600.00	0.00	179.84	7586.59	177.36	42.58	-177.06	0.00				
7700.00	0.00	179.84	7686.59	177.36	42.58	-177.06	0.00				
7800.00	0.00	179.84	7786.59	177.36	42.58	-177.06	0.00				
7900.00	0.00	179.84	7886.59	177.36	42.58	-177.06	0.00				
8000.00	0.00	179.84	7986.59	177.36	42.58	-177.06	0.00				
8100.00	0.00	179.84	8086.59	177.36	42.58	-177.06	0.00				
8200.00	0.00	179.84	8186.59	177.36	42.58	-177.06	0.00				
8277.41	0.00	179.84	8264.00	177.36	42.58	-177.06	0.00	1st Bone Spring Lime			
8300.00	0.00	179.84	8286.59	177.36	42.58	-177.06	0.00	· -			
8400.00	0.00	179.84	8386.59	177.36	42.58	-177.06	0.00				
8500.00	0.00	179.84	8486.59	177.36	42.58	-177.06	0.00				
8600.00	0.00	179.84	8586.59	177.36	42.58	-177.06	0.00				
8700.00	0.00	179.84	8686.59	177.36	42.58	-177.06	0.00				
8800.00	0.00	179.84	8786.59	177.36	42.58	-177.06	0.00				
8900.00	0.00	179.84	8886.59	177.36	42.58	-177.06	0.00				
9000.00	0.00	179.84	8986.59	177.36	42.58	-177.06	0.00				
9100.00	0.00	179.84	9086.59	177.36	42.58	-177.06					
							0.00				
9200.00	0.00	179.84	9186.59	177.36	42.58	-177.06	0.00	Barris Carlos And			
9296.41	0.00	179.84	9283.00	177.36	42.58	-177.06	0.00	Bone Spring 1st			
9300.00	0.00	179.84	9286.59	177.36	42.58	-177.06	0.00				
9400.00	0.00	179.84	9386.59	177.36	42.58	-177.06	0.00				
9500.00	0.00	179.84	9486.59	177.36	42.58	-177.06	0.00				
9600.00	0.00	179.84	9586.59	177.36	42.58	-177.06	0.00				
9700.00	0.00	179.84	9686.59	177.36	42.58	-177.06	0.00				
9800.00	0.00	179.84	9786.59	177.36	42.58	-177.06	0.00				
9900.00	0.00	179.84	9886.59	177.36	42.58	-177.06	0.00				
9991.41	0.00	179.84	9978.00	177.36	42.58	-177.06	0.00	Bone Spring 2nd			
10000.00	0.00	179.84	9986.59	177.36	42.58	-177.06	0.00				
10100.00	0.00	179.84	10086.59	177.36	42.58	-177.06	0.00				
10200.00	0.00	179.84	10186.59	177.36	42.58	-177.06	0.00				
10300.00	0.00	179.84	10286.59	177.36	42.58	-177.06	0.00				
10400.00	0.00	179.84	10386.59	177.36	42.58	-177.06	0.00				
10415.41	0.00	179.84	10402.00	177.36	42.58	-177.06	0.00	3rd Bone Spring Lime			
10500.00	0.00	179.84	10486.59	177.36	42.58	-177.06	0.00	<del> </del>			
10600.00	0.00	179.84	10586.59	177.36	42.58	-177.06	0.00				
10700.00	0.00	179.84	10686.59	177.36	42.58	-177.06	0.00				
10800.00	0.00	179.84	10686.59		42.58	-177.06	0.00				
10900.00				177.36 177.36							
	0.00	179.84	10886.59	177.36	42.58	-177.06	0.00				
11000.00	0.00	179.84	10986.59	177.36	42.58	-177.06	0.00				
11100.00	0.00	179.84	11086.59	177.36	42.58	-177.06	0.00				
11200.00	0.00	179.84	11186.59	177.36	42.58	-177.06	0.00	Deve Codes 2nd			
11208.41	0.00	179.84	11195.00	177.36	42.58	-177.06	0.00	Bone Spring 3rd			
11300.00	0.00	179.84	11286.59	177.36	42.58	-177.06	0.00				
11400.00	0.00	179.84	11386.59	177.36	42.58	-177.06	0.00				
11500.00	0.00	179.84	11486.59	177.36	42.58	-177.06	0.00				
11600.00	0.00	179.84	11586.59	177.36	42.58	-177.06	0.00				
11669.41	0.00	179.84	11656.00	177.36	42.58	-177.06	0.00	Wolfcamp / Point of Penetration			
11700.00	0.00	179.84	11686.59	177.36	42.58	-177.06	0.00				
11731.48	0.00	179.84	11718.06	177.36	42.58	-177.06	0.00	KOP			
11800.00	6.85	179.84	11786.43	173.27	42.59	-172.97	10.00				
11900.00	16.85	179.84	11884.17	152.76	42.65	-152.45	10.00				
12000.00	26.85	179.84	11976.87	115.58	42.75	-115.28	10.00				
12100.00	36.85	179.84	12061.70	62.87	42.90	-62.57	10.00				
12200.00	46.85	179.84	12136.09	-3.76	43.09	4.06	10.00				
12300.00	56.85	179.84	12197.78	-82.30	43.31	82.60	10.00				
12400.00	66.85	179.84	12244.90	-170.37	43.55	170.66	10.00				



County: Eddy
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

**Datum:** North American Datum 1927 **Ellipsoid:** Clarke 1866

	Design: Permit Plan #1						<b>Zone:</b> 3001 - NM East (NAD83)				
MD	INC	AZI	TVD	NS	EW	vs	DLS				
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	Comment			
2500.00	76.85	179.84	12276.00	-265.27	43.82	265.57	10.00				
2600.00	86.85	179.84	12290.16	-364.13	44.09	364.43	10.00				
2636.50	90.50	179.84	12291.00	-400.61	44.19	400.91	10.00	Landing Point			
2700.00	90.50	179.84	12290.44	-464.12	44.37	464.41	0.00				
2800.00	90.50	179.84	12289.57	-564.11	44.65	564.41	0.00				
2900.00	90.50	179.84	12288.69	-664.11	44.93	664.40	0.00				
3000.00	90.50	179.84	12287.82	-764.10	45.21	764.40	0.00				
3100.00 3200.00	90.50 90.50	179.84 179.84	12286.94 12286.06	-864.10 -964.10	45.49 45.77	864.40 964.39	0.00				
3300.00	90.50	179.84	12285.19	-1064.09	46.05	1064.39	0.00				
3400.00	90.50	179.84	12284.31	-1164.09	46.33	1164.38	0.00				
3500.00	90.50	179.84	12283.44	-1264.08	46.61	1264.38	0.00				
3600.00	90.50	179.84	12282.56	-1364.08	46.89	1364.37	0.00				
3700.00	90.50	179.84	12281.68	-1464.07	47.17	1464.37	0.00				
3800.00	90.50	179.84	12280.81	-1564.07	47.45	1564.36	0.00				
3900.00	90.50	179.84	12279.93	-1664.07	47.73	1664.36	0.00				
4000.00 4100.00	90.50 90.50	179.84 179.84	12279.06 12278.18	-1764.06 -1864.06	48.01	1764.35 1864.35	0.00				
4200.00	90.50	179.84	12277.30	-1964.05	48.29 48.56	1964.34	0.00				
4300.00	90.50	179.84	12276.43	-2064.05	48.84	2064.34	0.00				
4400.00	90.50	179.84	12275.55	-2164.04	49.12	2164.33	0.00				
4500.00	90.50	179.84	12274.68	-2264.04	49.40	2264.33	0.00				
4600.00	90.50	179.84	12273.80	-2364.04	49.68	2364.32	0.00				
4700.00	90.50	179.84	12272.92	-2464.03	49.96	2464.32	0.00				
4800.00	90.50	179.84	12272.05	-2564.03	50.24	2564.32	0.00				
4900.00	90.50	179.84	12271.17	-2664.02	50.52	2664.31 2764.31	0.00				
5000.00 5100.00	90.50 90.50	179.84 179.84	12270.30 12269.42	-2764.02 -2864.01	50.80 51.08	2864.30	0.00				
5200.00	90.50	179.84	12268.54	-2964.01	51.36	2964.30	0.00				
5300.00	90.50	179.84	12267.67	-3064.01	51.64	3064.29	0.00				
5400.00	90.50	179.84	12266.79	-3164.00	51.92	3164.29	0.00				
5500.00	90.50	179.84	12265.92	-3264.00	52.20	3264.28	0.00				
5600.00	90.50	179.84	12265.04	-3363.99	52.48	3364.28	0.00				
5700.00	90.50	179.84	12264.17	-3463.99	52.76	3464.27	0.00				
5800.00	90.50	179.84	12263.29	-3563.99	53.04	3564.27	0.00				
5900.00	90.50	179.84	12262.41	-3663.98	53.32	3664.26	0.00				
6000.00 6100.00	90.50 90.50	179.84 179.84	12261.54 12260.66	-3763.98 -3863.97	53.60 53.88	3764.26 3864.25	0.00				
6200.00	90.50	179.84	12259.79	-3963.97	54.15	3964.25	0.00				
6300.00	90.50	179.84	12258.91	-4063.96	54.43	4064.24	0.00				
6400.00	90.50	179.84	12258.03	-4163.96	54.71	4164.24	0.00				
6500.00	90.50	179.84	12257.16	-4263.96	54.99	4264.24	0.00				
6600.00	90.50	179.84	12256.28	-4363.95	55.27	4364.23	0.00				
6700.00	90.50	179.84	12255.41	-4463.95	55.55	4464.23	0.00				
6800.00	90.50	179.84	12254.53	-4563.94	55.83	4564.22	0.00				
6900.00 7000.00	90.50	179.84	12253.65	-4663.94 4762.92	56.11	4664.22	0.00				
7000.00 7100.00	90.50 90.50	179.84 179.84	12252.78 12251.90	-4763.93 -4863.93	56.39 56.67	4764.21 4864.21	0.00				
7200.00	90.50	179.84	12251.90		56.95	4964.20	0.00				
7300.00	90.50	179.84	12250.15		57.23	5064.20	0.00				
7400.00	90.50	179.84	12249.27	-5163.92	57.51	5164.19	0.00				
7500.00	90.50	179.84	12248.40		57.79	5264.19	0.00				
7600.00	90.50	179.84	12247.52	-5363.91	58.07	5364.18	0.00				
7700.00	90.50	179.84	12246.65	-5463.90	58.35	5464.18	0.00				
7800.00	90.50	179.84	12245.77	-5563.90	58.63	5564.17	0.00				
7900.00	90.50	179.84	12244.89	-5663.90 5763.89	58.91 50.10	5664.17 5764.16	0.00				
8000.00	90.50 90.50	179.84 179.84	12244.02 12243.14	-5763.89 -5863.89	59.19 59.47	5764.16 5864.16	0.00				
8200.00	90.50	179.84	12243.14	-5963.88	59.75	5964.16	0.00				
8300.00	90.50	179.84	12241.39	-6063.88	60.02	6064.15	0.00				
8400.00	90.50	179.84	12240.51	-6163.88	60.30	6164.15	0.00				
8500.00	90.50	179.84	12239.64	-6263.87	60.58	6264.14	0.00				
8600.00	90.50	179.84	12238.76	-6363.87	60.86	6364.14	0.00				
8700.00	90.50	179.84	12237.89	-6463.86	61.14	6464.13	0.00				
8800.00	90.50	179.84	12237.01	-6563.86	61.42	6564.13	0.00				
8900.00	90.50	179.84	12236.13	-6663.85	61.70	6664.12	0.00				
9000.00	90.50	179.84	12235.26	-6763.85	61.98	6764.12	0.00				
9100.00	90.50	179.84 179.84	12234.38 12233.51	-6863.85 -6963.84	62.26 62.54	6864.11 6964.11	0.00				
	ዓበ 50				uc14	UJU4.11	0.00				
9200.00	90.50 90.50	179.84		-7063.84	62.82	7064.10	0.00				



County: Eddy
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

**Datum:** North American Datum 1927 **Ellipsoid:** Clarke 1866

MD	INC	AZI	TVD	NS	EW	vs	DLS	Comment
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	Comment
19400.00	90.50	179.84	12231.75	-7163.83	63.10	7164.10	0.00	<del>-</del>
19500.00	90.50	179.84	12230.88	-7263.83	63.38	7264.09	0.00	
19600.00	90.50	179.84	12230.00	-7363.82	63.66	7364.09	0.00	
19700.00	90.50	179.84	12229.13	-7463.82	63.94	7464.08	0.00	
19800.00	90.50	179.84	12228.25	-7563.82	64.22	7564.08	0.00	
19900.00	90.50	179.84	12227.38	-7663.81	64.50	7664.08	0.00	
20000.00	90.50	179.84	12226.50	-7763.81	64.78	7764.07	0.00	
20100.00	90.50	179.84	12225.62	-7863.80	65.06	7864.07	0.00	
20200.00	90.50	179.84	12224.75	-7963.80	65.34	7964.06	0.00	
20300.00	90.50	179.84	12223.87	-8063.79	65.61	8064.06	0.00	
20400.00	90.50	179.84	12223.00	-8163.79	65.89	8164.05	0.00	
20500.00	90.50	179.84	12222.12	-8263.79	66.17	8264.05	0.00	
20600.00	90.50	179.84	12221.24	-8363.78	66.45	8364.04	0.00	
20700.00	90.50	179.84	12220.37	-8463.78	66.73	8464.04	0.00	
20800.00	90.50	179.84	12219.49	-8563.77	67.01	8564.03	0.00	
20900.00	90.50	179.84	12218.62	-8663.77	67.29	8664.03	0.00	
21000.00	90.50	179.84	12217.74	-8763.77	67.57	8764.02	0.00	
21100.00	90.50	179.84	12216.86	-8863.76	67.85	8864.02	0.00	
21200.00	90.50	179.84	12215.99	-8963.76	68.13	8964.01	0.00	
21300.00	90.50	179.84	12215.11	-9063.75	68.41	9064.01	0.00	
21400.00	90.50	179.84	12214.24	-9163.75	68.69	9164.00	0.00	
21500.00	90.50	179.84	12213.36	-9263.74	68.97	9264.00	0.00	
21600.00	90.50	179.84	12212.48	-9363.74	69.25	9364.00	0.00	
21700.00	90.50	179.84	12211.61	-9463.74	69.53	9463.99	0.00	
21800.00	90.50	179.84	12210.73	-9563.73	69.81	9563.99	0.00	
21900.00	90.50	179.84	12209.86	-9663.73	70.09	9663.98	0.00	
22000.00	90.50	179.84	12208.98	-9763.72	70.37	9763.98	0.00	
22100.00	90.50	179.84	12208.10	-9863.72	70.65	9863.97	0.00	
22200.00	90.50	179.84	12207.23	-9963.71	70.93	9963.97	0.00	
22300.00	90.50	179.84	12206.35	-10063.71	71.20	10063.96	0.00	
22400.00	90.50	179.84	12205.48	-10163.71	71.48	10163.96	0.00	
22487.03	90.50	179.84	12204.71	-10250.73	71.73	10250.98	0.00	exit
22500.00	90.50	179.84	12204.60	-10263.70	71.76	10263.95	0.00	
22567.03	90.50	179.84	12204.00	-10330.73	71.92	10330.98	0.00	BHL

TVD

(ft)

NS

(ft)

(ft)

County: Eddy Wellbore: Permit Plan Design: Permit Plan #1

AZI

(°)

INC

(°)

MD

(ft)

Geodetic System: US State Plane 1983

Datum: North American Datum 1927

Ellipsoid: Clarke 1866 **Zone:** 3001 - NM East (NAD83)

EW ٧S DLS Comment (°/100ft)

(ft)

# Devon Energy APD VARIANCE DATA

**OPERATOR NAME:** Devon Energy

## 1. SUMMARY OF Variance:

Devon Energy respectfully requests approval for the following additions to the drilling plan:

1. Potential utilization of a spudder rig to pre-set surface casing.

#### 2. Description of Operations

- 1. A spudder rig contractor may move in their rig to drill the surface hole section and pre-set surface casing on this well.
  - **a.** After drilling the surface hole section, the rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
  - **b.** Rig will utilize fresh water based mud to drill surface hole to TD.
- 2. The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- **3.** A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with needle valves installed on two wingvalves.
  - **a.** A means for intervention will be maintained while the drilling rig is not over the well.
- **4.** The BLM will be contacted and notified 24 hours prior to commencing spudder rig operations.
- **5.** Drilling operation will be performed with the big rig. At that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
  - **a.** The BLM will be contacted / notified 24 hours before the big rig moves back on to the pad with the pre-set surface casing.
- **6.** Devon Energy will have supervision on the rig to ensure compliance with all BLM and NMOCD regulations and to oversee operations.
- 7. Once the rig is removed, Devon Energy will secure the wellhead area by placing a guard rail around the cellar area.

#### **Devon Energy Annular Preventer Summary**

## 1. Component and Preventer Compatibility Table

The table below, which covers the drilling and casing of the 10M MASP portion of the well, outlines the tubulars and the compatible preventers in use. This table, combined with the mud program, documents that two barriers to flow can be maintained at all times, independent of the rating of the annular preventer.

Component	OD	Preventer	RWP
Drillpipe	4.5"	Fixed lower 4.5"	10M
		Upper 4.5-7" VBR	
HWDP	4.5"	Fixed lower 4.5"	10M
		Upper 4.5-7" VBR	
Drill collars and MWD tools	4.75"	Upper 4.5-7" VBR	10M
Mud Motor	4.75"	Upper 4.5-7" VBR	10M
Production casing	5.5"	Upper 4.5-7" VBR	10M
ALL	0-13-5/8"	Annular	5M
Open-hole	-	Blind Rams	10M

6-3/4" Production hole section, 10M requirement

VBR = Variable Bore Ram. Compatible range listed in chart.

#### 2. Well Control Procedures

Well control procedures are specific to the rig equipment and the operation at the time the kick occurs. Below are the minimal high-level tasks prescribed to assure a proper shut-in while drilling, tripping, running casing, pipe out of the hole (open hole), and moving the BHA through the BOPs. The pressure at which control is swapped from the annular to another compatible ram is variable, but the operator will document in the submission their operating pressure limit. The operator may chose an operating pressure less than or equal to RWP, but in no case will it exceed the RWP of the annular preventer.

#### General Procedure While Drilling

- 1. Sound alarm (alert crew)
- 2. Space out drill string
- 3. Shut down pumps (stop pumps and rotary)
- 4. Shut-in Well (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to the upper pipe ram.

#### **Devon Energy Annular Preventer Summary**

## **General Procedure While Tripping**

- 1. Sound alarm (alert crew)
- 2. Stab full opening safety valve and close
- 3. Space out drill string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to the upper pipe ram.

## General Procedure While Running Casing

- 1. Sound alarm (alert crew)
- 2. Stab crossover and full opening safety valve and close
- 3. Space out string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to compatible pipe ram.

# General Procedure With No Pipe In Hole (Open Hole)

- 1. Sound alarm (alert crew)
- 2. Shut-in with blind rams or BSR. (HCR and choke will already be in the closed position.)
- 3. Confirm shut-in
- 4. Notify toolpusher/company representative
- 5. Read and record the following:
  - a. SICP
  - b. Pit gain
  - c. Time
- 6. Regroup and identify forward plan

#### **Devon Energy Annular Preventer Summary**

#### General Procedures While Pulling BHA thru Stack

- 1. PRIOR to pulling last joint of drillpipe thru the stack.
  - a. Perform flowcheck, if flowing:
  - b. Sound alarm (alert crew)
  - c. Stab full opening safety valve and close
  - d. Space out drill string with tool joint just beneath the upper pipe ram.
  - e. Shut-in using upper pipe ram. (HCR and choke will already be in the closed position.)
  - f. Confirm shut-in
  - g. Notify toolpusher/company representative
  - h. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
  - i. Regroup and identify forward plan
- 2. With BHA in the stack and compatible ram preventer and pipe combo immediately available.
  - a. Sound alarm (alert crew)
  - b. Stab crossover and full opening safety valve and close
  - c. Space out drill string with upset just beneath the compatible pipe ram.
  - d. Shut-in using compatible pipe ram. (HCR and choke will already be in the closed position.)
  - e. Confirm shut-in
  - f. Notify toolpusher/company representative
  - g. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
  - h. Regroup and identify forward plan
- 3. With BHA in the stack and NO compatible ram preventer and pipe combo immediately available.
  - a. Sound alarm (alert crew)
  - b. If possible to pick up high enough, pull string clear of the stack and follow "Open Hole" scenario.
  - c. If impossible to pick up high enough to pull the string clear of the stack:
  - d. Stab crossover, make up one joint/stand of drillpipe, and full opening safety valve and close
  - e. Space out drill string with tooljoint just beneath the upper pipe ram.
  - f. Shut-in using upper pipe ram. (HCR and choke will already be in the closed position.)
  - g. Confirm shut-in
  - h. Notify toolpusher/company representative
  - i. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
  - i. Regroup and identify forward plan

A multibowl wellhead may be used. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested.

Devon proposes using a multi-bowl wellhead assembly. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.


- Wellhead will be installed by wellhead representatives.
- If the welding is performed by a third party, the wellhead representative will monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- Wellhead representative will install the test plug for the initial BOP test.
- Wellhead company will install a solid steel body pack-off to completely isolate the lower head after cementing intermediate casing. After installation of the pack-off, the pack-off and the lower flange will be tested to 5M, as shown on the attached schematic.
   Everything above the pack-off will not have been altered whatsoever from the initial nipple up. Therefore the BOP components will not be retested at that time.
- If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head will be cut and top out operations will be conducted.
- Devon will pressure test all seals above and below the mandrel (but still above the casing) to full working pressure rating.
- Devon will test the casing to 0.22 psi/ft or 1500 psi, whichever is greater, as per Onshore Order #2.


After running the surface casing, a 13-5/8" BOP/BOPE system with a minimum rating of 5M will be installed on the wellhead system and will undergo a 250 psi low pressure test followed by a 5,000 psi high pressure test. The 5,000 psi high and 250 psi low test will cover testing requirements a maximum of 30 days, as per Onshore Order #2. If the well is not complete within 30 days of this BOP test, another full BOP test will be conducted, as per Onshore Order #2.


After running the intermediate casing with a mandrel hanger, the 13-5/8" BOP/BOPE system with a minimum rating of 10M will be installed and tested, with 5M annular being tested to 100% of rated working pressure.

The pipe rams will be operated and checked each 24 hour period and each time the drill pipe is out of the hole. These tests will be logged in the daily driller's log. A 2" kill line and 3" choke line will be incorporated into the drilling spool below the ram BOP. In addition to the rams and annular preventer, additional BOP accessories include a kelly cock, floor safety valve, choke lines, and choke manifold rated at 10,000 psi WP.

Devon's proposed wellhead manufactures will be FMC Technologies, Cactus Wellhead, or Cameron.

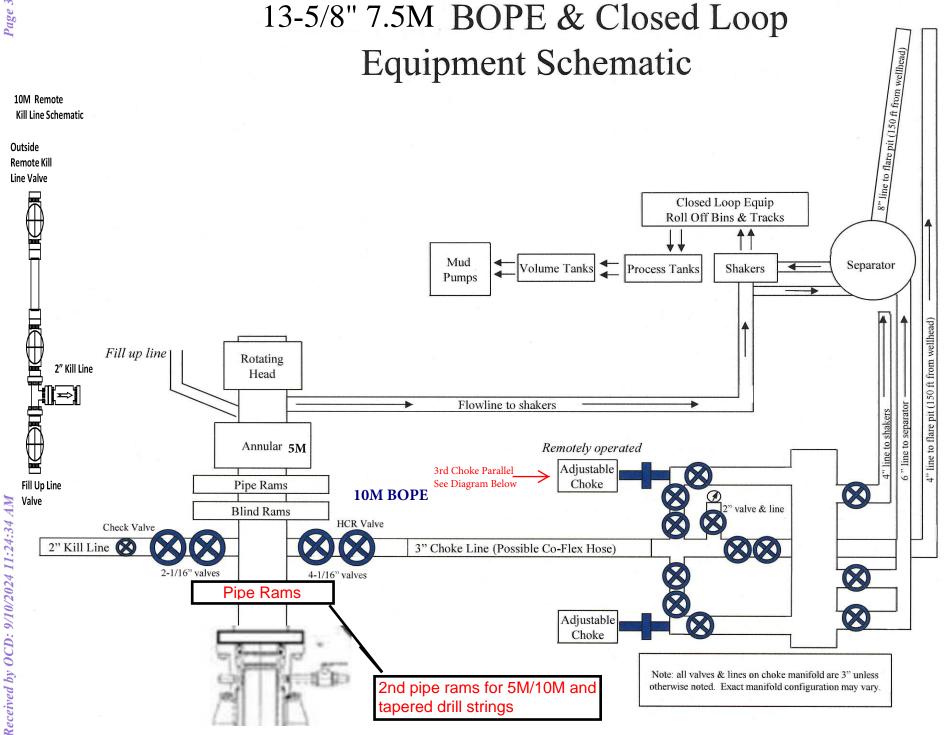

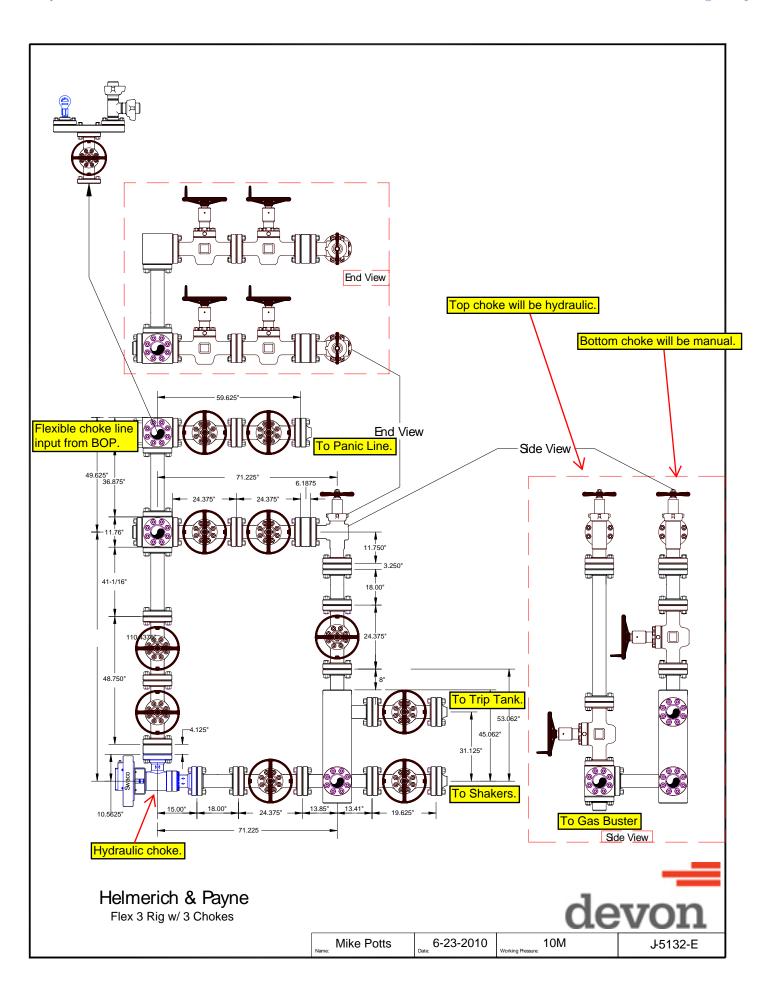

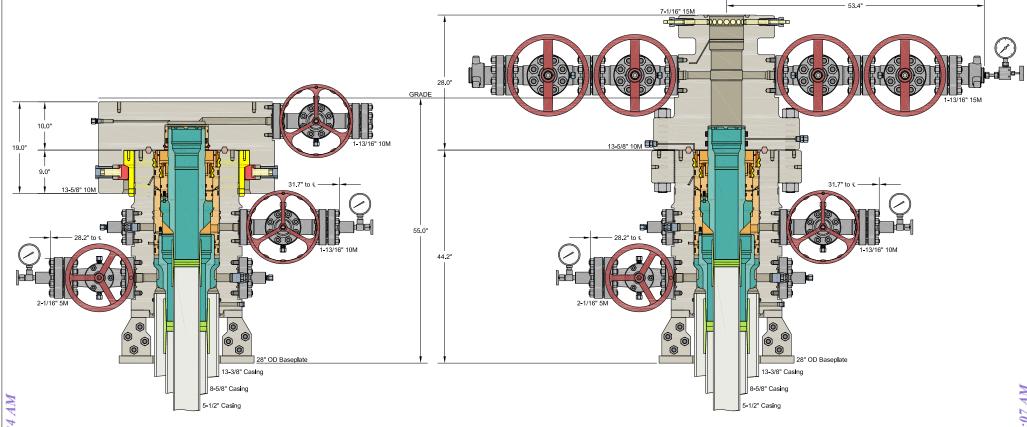

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

# CACTUS WELLHEAD LLC

13-3/8" x 8-5/8" x 5-1/2" 5M MBU-3T Wellhead System With 8-5/8" & 5-1/2" Pin Down Rotating Mandrel Hangers And 13-5/8" 10M x 7-1/16" 15M CTH-P-DBLHPS Tubing Head

# DEVON ENERGY CORPORATION

DLE DRAWN 10MAY18 APPRV ODE0002309

DRAWING NO.

# PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

**OPERATOR'S NAME:** Devon Energy Production Company LP

LEASE NO.: NMNM0016348

**LOCATION:** Section 27, T.25 S., R.31 E., NMPM

**COUNTY:** Eddy County, New Mexico

WELL NAME & NO.: Lusitano 27-34 Fed Com 814H

**SURFACE HOLE FOOTAGE:** 235'/N & 1034'/E **BOTTOM HOLE FOOTAGE** 20'/S & 990'/E

ATS/API ID: ATS-22-741 APD ID: 10400083394

Sundry ID: N/a

WELL NAME & NO.: Lusitano 27-34 Fed Com 824H

**SURFACE HOLE FOOTAGE:** 235'/N & 1004'/E **BOTTOM HOLE FOOTAGE** 20'/S & 660'/E **ATS/API ID: ATS-22-742** 

TS/API ID: ATS-22-742 APD ID: 10400083405

Sundry ID: N/a

COA

H2S	No ▼		
Potash	None		
Cave/Karst	Low		
Potential			
Cave/Karst	☐ Critical		
Potential			
Variance	None None	Flex Hose	C Other
Wellhead	Conventional and Multibow	/I <u> </u>	
Other	□4 String	Capitan Reef	□WIPP
		None -	
Other	Pilot Hole	Open Annulus	
	None 🔻		
Cementing	Contingency Squeeze	Echo-Meter	Primary Cement
	Int 1	None -	Squeeze
		_	None -
Special	□ Water	<b>▼</b> COM	□ Unit
Requirements	Disposal/Injection		
Special	☐ Batch Sundry		
Requirements			
Special	☐ Break Testing	□ Offline	☐ Casing
Requirements		Cementing	Clearance
Variance		_	

#### A. HYDROGEN SULFIDE

Hydrogen Sulfide (H2S) monitors shall be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the Hydrogen Sulfide area shall meet **43 CFR part 3170 Subpart 3176**, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, provide measured values and formations to the BLM.

#### **B. CASING**

- 1. The 13-3/8 inch surface casing shall be set at approximately 1200 feet (a minimum of 70 feet (Eddy County) into the Rustler Anhydrite, above the salt, and below usable fresh water) and cemented to the surface. The surface hole shall be 17 1/2 inch in diameter.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of

- six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
- b. Wait on cement (WOC) time for a primary cement job will be a minimum of **8** hours or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
- c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
- d. If cement falls back, remedial cementing will be done prior to drilling out that string.

Cement excess is less than 25%, more cement is required if washout occurs. Adjust cement volume and excess based on a fluid caliper or similar method that reflects the as-drilled size of the wellbore.

Intermediate casing must be kept fluid filled to meet BLM minimum collapse requirement.

- 2. The minimum required fill of cement behind the 8-5/8 inch intermediate casing is:
  - Cement to surface. If cement does not circulate see B.1.a, c-d above.
     Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.
     Cement excess is less than 25%, more cement is required if washout occurs. Adjust cement volume and excess based on a fluid caliper or similar method that reflects the as-drilled size of the wellbore.

Operator has proposed to pump down 13-3/8" X 8-5/8" annulus after primary cementing stage. Operator must run a CBL from TD of the 8-5/8" casing to surface. Submit results to the BLM.

If cement does not tie-back into the previous casing shoe, a third stage remediation BH may be performed. The appropriate BLM office shall be notified.

Production casing must be kept fluid filled to meet BLM minimum collapse requirement.

- 3. The minimum required fill of cement behind the 5-1/2 inch production casing is:
  - Cement should tie-back at least 200 feet into previous casing string.
     Operator shall provide method of verification.
     Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.
     Cement excess is less than 25%, more cement is required if washout occurs. Adjust cement volume and excess based on a fluid caliper or similar method that reflects the as-drilled size of the wellbore.

#### C. PRESSURE CONTROL

1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'

2.

#### Option 1:

- a. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **5000 (5M)** psi.
- b. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the 8-5/8 inch intermediate casing shoe shall be 10,000 (10M) psi. Variance is approved to use a 5000 (5M) Annular which shall be tested to 5000 (5M) psi.

#### **Option 2:**

Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the 13-3/8 inch surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 10,000 (10M) psi. Variance is approved to use a 5000 (5M) Annular which shall be tested to 5000 (5M) psi.

- a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
- b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- c. Manufacturer representative shall install the test plug for the initial BOP test.
- d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- e. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.

#### D. SPECIAL REQUIREMENT (S)

#### **Communitization Agreement**

• The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New

Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.

- The operator will submit an as-drilled survey well plat of the well completion, but are not limited to, those specified in 43 CFR part 3170 Subpart 3171
- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. When the Communitization Agreement number is known, it shall also be on the sign.

## **GENERAL REQUIREMENTS**

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)
  - Eddy County
     EMAIL or call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220,
     BLM\_NM\_CFO\_DrillingNotifications@BLM.GOV (575) 361-2822
  - Lea County
     Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575) 689-5981
- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
  - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
  - b. When the operator proposes to set surface casing with Spudder Rig
    - Notify the BLM when moving in and removing the Spudder Rig.
    - Notify the BLM when moving in the 2<sup>nd</sup> Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
    - BOP/BOPE test to be conducted per **43** CFR part **3170** Subpart **3172** as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 3. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a

digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

#### A. CASING

- 1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.
- 2. Wait on cement (WOC) for Potash Areas: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends, 2) until cement has been in place at least 24 hours. WOC time will be recorded in the driller's log. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. Wait on cement (WOC) for Water Basin: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.

- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.
- B. PRESSURE CONTROL
- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in 43 CFR part 3170 Subpart 3172 and API STD 53 Sec. 5.3.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
  - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
  - c. Manufacturer representative shall install the test plug for the initial BOP test.
  - d. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.
  - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
  - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after

installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead cement), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).

- b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the cement plug. The BOPE test can be initiated after bumping the cement plug with the casing valve open. (only applies to single stage cement jobs, prior to the cement setting up.)
- c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer and can be initiated immediately with the casing valve open. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to 43 CFR part 3170 Subpart 3172 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (8 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per 43 CFR

#### part 3170 Subpart 3172.

#### C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

#### D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

LVO 8/11/2023



Devon Energy Center 333 West Sheridan Avenue Oklahoma City, Oklahoma 73102-5015

# Hydrogen Sulfide (H₂S) Contingency Plan

For


Lusitano 27-34 Fed Com 814H


Sec-27 T-25S R-31E 235 FNL & 1034' FEL LAT. = 32.1079113 N (NAD83) LONG = 103.7606869 W

**Eddy County NM** 

## Lusitano 27-34 Fed Com 814H

This is an open drilling site. H<sub>2</sub>S monitoring equipment and emergency response equipment will be used within 500' of zones known to contain H<sub>2</sub>S, including warning signs, wind indicators and H<sub>2</sub>S monitor.

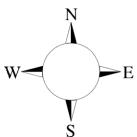

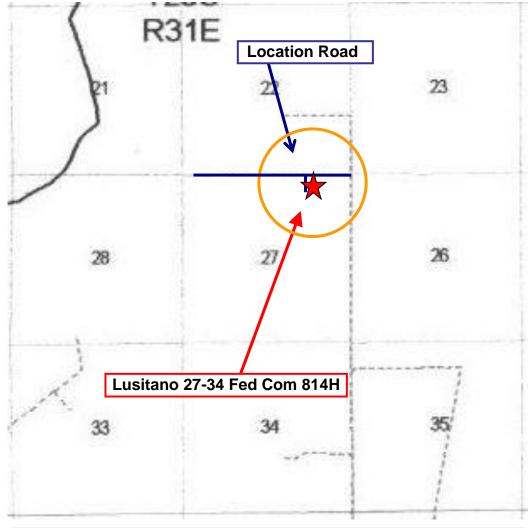

Assumed 100 ppm ROE = 3000' (Radius of Exposure)
100 ppm H2S concentration shall trigger activation of this plan.

#### **Escape**

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated from the location entrance road. Crews should then block the entrance to the location from the lease road so as not to allow anyone traversing into a hazardous area. The blockade should be at a safe distance outside of the ROE. There are no homes or buildings in or near the ROE.

**Assumed 100 ppm ROE = 3000'** 

## 100 ppm H<sub>2</sub>S concentration shall trigger activation of this plan.

#### **Emergency Procedures**

In the event of a release of gas containing H<sub>2</sub>S, the first responder(s) must

- Isolate the area and prevent entry by other persons into the 100 ppm ROE.
- Evacuate any public places encompassed by the 100 ppm ROE.
- Be equipped with H<sub>2</sub>S monitors and air packs in order to control the release.
- Use the "buddy system" to ensure no injuries occur during the response
- Take precautions to avoid personal injury during this operation.
- Contact operator and/or local officials to aid in operation. See list of phone numbers attached.
- Have received training in the
  - Detection of H₂S, and
  - Measures for protection against the gas,
  - Equipment used for protection and emergency response.

#### **Ignition of Gas Source**

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO<sub>2</sub>). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas

#### Characteristics of H<sub>2</sub>S and SO<sub>2</sub>

Common Name	Chemical Formula	Specific Gravity	Threshold Limit	Hazardous Limit	Lethal Concentration
Hydrogen Sulfide	H <sub>2</sub> S	1.189 Air = 1	10 ppm	100 ppm/hr	600 ppm
Sulfur Dioxide	SO <sub>2</sub>	2.21 Air = 1	2 ppm	N/A	1000 ppm

## **Contacting Authorities**

Devon Energy Corp. personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. Devon Energy Corp. Company response must be in coordination with the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER)

## **Hydrogen Sulfide Drilling Operation Plan**

## I. HYDROGEN SULFIDE (H2S) TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- 1. The hazards and characteristics of hydrogen sulfide (H<sub>2</sub>S)
- 2. The proper use and maintenance of personal protective equipment and life support systems.
- 3. The proper use of H<sub>2</sub>S detectors, alarms, warning systems, briefing areas, evacuation procedures, and prevailing winds.
- 4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- The effects of H<sub>2</sub>S metal components. If high tensile tubulars are to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- 3. The contents and requirements of the H<sub>2</sub>S Drilling Operations Plan.

There will be weekly H<sub>2</sub>S and well control drills for all personnel in each crew.

#### II. HYDROGEN SULFIDE TRAINING

Note: All  $H_2S$  safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonably expected to contain  $H_2S$ .

#### 1. Well Control Equipment

- A. Flare line
- B. Choke manifold Remotely Operated
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit
- D. Auxiliary equipment may include if applicable: annular preventer and rotating head.
- E. Mud/Gas Separator

## 2. Protective equipment for essential personnel:

30-minute SCBA units located at briefing areas, as indicated on well site diagram, with escape units available in the top doghouse. As it may be difficult to communicate audibly while wearing these units, hand signals shall be utilized.

Fire extinguishers are located at various locations around the rig. First Aid supplies are located in the top doghouse and the rig manger's office.

#### 3. H<sub>2</sub>S detection and monitoring equipment:

Portable H<sub>2</sub>S monitors positioned on location for best coverage and response. These units have warning lights which activate when H<sub>2</sub>S levels reach 10 ppm and audible sirens which activate at 15 ppm. Sensor locations:

- Bell nipple
- Possum Belly/Shale shaker
- Rig floor
- Choke manifold
- Cellar

#### 4. Visual warning systems:

- A. Wind direction indicators as shown on well site diagram
- B. Caution/Danger signs shall be posted on roads providing direct access to locations. Signs will be painted a high visibility yellow with black lettering of sufficient size to be reasonable distance from the immediate location. Bilingual signs will be used when appropriate.

### 5. Mud program:

The mud program has been designed to minimize the volume of H<sub>2</sub>S circulated to surface. Proper mud weight, safe drilling practices and the use of H<sub>2</sub>S scavengers will minimize hazards when penetrating H<sub>2</sub>S bearing zones.

## 6. Metallurgy:

All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold lines, and valves shall be H<sub>2</sub>S trim.

All elastomers used for packing and seals shall be H<sub>2</sub>S trim.

#### 7. Communication:

- a. Company personnel have/use cellular telephones in the field.
- **b.** Land line (telephone) communications at Office


#### 8. Well testing:

- a. Drill stem testing will be performed with a minimum number of personnel in the immediate vicinity, which are necessary to safety and adequately conduct the test. The drill stem testing will be conducted during daylight hours and formation fluids will not be flowed to the surface. All drill-stem-testing operations conducted in an H<sub>2</sub>S environment will use the closed chamber method of testing.
- **b.** There will be no drill stem testing.

Employee/Company Contact Representative   Position Rumber   Number   Numb	Jonathan F Jason Hilde Rich Down Josh Harve Laura Wrig Robert Glo Lane Frank Rickey Por Brock Vise  Agency Lea	epresentative Tisher (North) Ebrand (South) Ey Ey Ey Et Interrece  Call List  Hobbs  Lea County Communication State Police	Drilling Manager Drilling Manager Drilling VP EHS Manger EHS Supervisor EHS Professiona Lead EHS Lead EHS Lead EHS	Number 832-967-7912 405-552-6514 405-228-2415 405-228-2440 405-552-5334 575-703-5712 580-579-7052 903-720-8315	918-500-5536 832-969-8145 575-703-5712 580-579-7052 903-720-8315	
Jonathan Fisher (North)	Jonathan F Jason Hilde Rich Down Josh Harve Laura Wrig Robert Glo Lane Frank Rickey Por Brock Vise  Agency Lea	isher (North) ebrand (South) ey ey ht ver ter  Call List  Hobbs Lea County Communica State Police	Drilling Manager Drilling VP EHS Manger EHS Supervisor EHS Professiona Lead EHS Lead EHS Lead EHS	405-552-6514 405-228-2415 405-228-2440 405-552-5334 al 575-703-5712 580-579-7052 903-720-8315	832-969-8145 575-703-5712 580-579-7052 903-720-8315	
Rich Downey	Rich Down Josh Harve Laura Wrig Robert Glo Lane Frank Rickey Por Brock Vise Agency	ey ht ver ter  Call List Hobbs Lea County Communica State Police	Drilling VP EHS Manger EHS Supervisor EHS Professiona Lead EHS Lead EHS Lead EHS	405-228-2415 405-228-2440 405-552-5334 al 575-703-5712 580-579-7052 903-720-8315	832-969-8145 575-703-5712 580-579-7052 903-720-8315	
Josh Harvey	Josh Harve Laura Wrig Robert Glo Lane Frank Rickey Por Brock Vise  Agency Lea	ht ver ter  Call List Hobbs Lea County Communication State Police	EHS Manger EHS Supervisor EHS Professiona Lead EHS Lead EHS Lead EHS	405-228-2440 405-552-5334 al 575-703-5712 580-579-7052 903-720-8315	832-969-8145 575-703-5712 580-579-7052 903-720-8315	
Laura Wright         EHS Supervisor         405-552-5334         832-969-8145           Robert Glover         EHS Professional         575-703-5712         575-703-5712         575-703-5712         575-703-5712         575-703-5712         575-703-5712         575-703-5712         575-703-5712         575-703-5712         575-703-5712         575-703-5712         575-703-5712         803-73-7052         800-73-70-8315         903-720-8315 <td>Laura Wrig Robert Glo Lane Frank Rickey Por Brock Vise Agency</td> <td>ht ver ter  Call List  Hobbs Lea County Communica State Police</td> <td>EHS Supervisor EHS Professiona Lead EHS Lead EHS Lead EHS</td> <td>405-552-5334 al 575-703-5712 580-579-7052 903-720-8315</td> <td>832-969-8145 575-703-5712 580-579-7052 903-720-8315</td>	Laura Wrig Robert Glo Lane Frank Rickey Por Brock Vise Agency	ht ver ter  Call List  Hobbs Lea County Communica State Police	EHS Supervisor EHS Professiona Lead EHS Lead EHS Lead EHS	405-552-5334 al 575-703-5712 580-579-7052 903-720-8315	832-969-8145 575-703-5712 580-579-7052 903-720-8315	
Robert Glover	Robert Glov Lane Frank Rickey Por Brock Vise Agency	ter  Call List  Hobbs  Lea County Communica State Police	EHS Professiona Lead EHS Lead EHS Lead EHS	575-703-5712 580-579-7052 903-720-8315	575-703-5712 580-579-7052 903-720-8315	
Lead EHS   580-579-7052   580-579-7052	Lane Frank Rickey Por Brock Vise Agency Lea	Call List  Hobbs Lea County Communica State Police	Lead EHS Lead EHS Lead EHS	580-579-7052 903-720-8315	580-579-7052 903-720-8315	
Rickey Porter   Lead EHS   903-720-8315   903-720-8315   Brock Vise   Lead EHS   918-413-3291	Rickey Por Brock Vise  Agency  Lea	Call List  Hobbs Lea County Communication State Police	Lead EHS Lead EHS	903-720-8315	903-720-8315	
Agency   Call List	Agency Lea	Call List  Hobbs Lea County Communication State Police	Lead EHS			
Lea County Communication Authority   397-9265   State Police   397-9265   Sheriff's Office   397-9208   EPC (Local Emergency Planning Committee)   393-2870   NMOCD   393-6161   US Bureau of Land Management (Hobbs Office Closed)   393-0002	Agency Lea	Hobbs Lea County Communication State Police		918-413-3291	918-413-3291	
Lea County   Communication Authority   397-9265     State Police   397-9265     Sheriff's Office   397-9308     LEPC (Local Emergency Planning Committee)   393-2870     NMOCD   393-6161     US Bureau of Land Management (Hobbs Office Closed)   393-0002     Eddy County (575)     City Police   885-3137     City Police   885-2111     Sheriff's Office   887-7551     Ambulance   911     Fire Department   885-3125     LEPC (Local Emergency Planning Committee)   887-3798     US Bureau of Land Management (Carlsbad)   (575)-234-5909     NM Emergency Response Commission (Santa Fe)   (505) 476-9600     24 HR   (505) 827-9126     National Emergency Response Center   (800) 424-8802     National Pollution Control Center: Direct   (703) 872-6000     For Oil Spills   (800) 280-7118     Emergency Services   Wild Well Control (915) 699-0139   (915) 563-3356	<u>Lea</u>	Hobbs Lea County Communication State Police	ation Authority			
Lea County   Communication Authority   397-9265     State Police   397-9265     Sheriff's Office   397-9308     LEPC (Local Emergency Planning Committee)   393-2870     NMOCD   393-6161     US Bureau of Land Management (Hobbs Office Closed)   393-0002     Eddy County (575)     City Police   885-3137     City Police   885-2111     Sheriff's Office   887-7551     Ambulance   911     Fire Department   885-3125     LEPC (Local Emergency Planning Committee)   887-3798     US Bureau of Land Management (Carlsbad)   (575)-234-5909     NM Emergency Response Commission (Santa Fe)   (505) 476-9600     24 HR   (505) 827-9126     National Emergency Response Center   (800) 424-8802     National Pollution Control Center: Direct   (703) 872-6000     For Oil Spills   (800) 280-7118     Emergency Services   Wild Well Control (915) 699-0139   (915) 563-3356	<u>Lea</u>	Hobbs Lea County Communication State Police	ation Authority			
County (575)         Lea County Communication Authority         397-9265           State Police         885-3138           City Police         397-9265           Sheriff's Office         396-3611           Ambulance         911           Fire Department         393-2870           NMOCD         393-6161           US Bureau of Land Management (Hobbs Office Closed)         393-0002           Eddy County (575)         State Police         885-3137           City Police         885-2111           Sheriff's Office         887-7551           Ambulance         911           Fire Department         885-3125           LEPC (Local Emergency Planning Committee)         887-3798           US Bureau of Land Management (Carlsbad)         (575)-706-1920           (575)-234-5909         NM Emergency Response Commission (Santa Fe)         (505) 476-9600           24 HR         (505) 827-9126           National Emergency Response Center         (800) 424-8802           National Pollution Control Center: Direct         (703) 872-6000           For Oil Spills         (800) 280-7118           Emergency Services         Wild Well Control         (281) 784-4700           Cudd Pressure Control         (915) 699-0139         (915) 663-3356<		Lea County Communication State Police	ation Authority			
State Police   885-3138     City Police   397-9265     Sheriff's Office   396-3611     Ambulance   911     Fire Department   397-9308     LEPC (Local Emergency Planning Committee)   393-2870     NMOCD   393-6161     US Bureau of Land Management (Hobbs Office Closed)   393-0002     State Police   885-3137     City Police   885-3137     City Police   887-7551     Ambulance   911     Fire Department   885-3125     LEPC (Local Emergency Planning Committee)   887-3798     US Bureau of Land Management (Carlsbad)   (575)-706-1920     (575)-234-5909     NM Emergency Response Commission (Santa Fe)   (505) 827-9126     National Emergency Response Center   (800) 424-8802     National Pollution Control Center: Direct   (703) 872-6000     For Oil Spills   (800) 280-7118     Emergency Services     Wild Well Control   (281) 784-4700     Cudd Pressure Control   (915) 699-0139   (915) 563-3356	County	State Police	ation Authority			
City Police   397-9265					397-9265	
Sheriff's Office   396-3611     Ambulance   911     Fire Department   397-9308     LEPC (Local Emergency Planning Committee)   393-2870     NMOCD   393-6161     US Bureau of Land Management (Hobbs Office Closed)   393-0002	<u>(575)</u>	City Police				
Ambulance	_					
Fire Department	_					
LEPC (Local Emergency Planning Committee) 393-2870     NMOCD 393-6161     US Bureau of Land Management (Hobbs Office Closed) 393-0002	_					
NMOCD   393-6161     US Bureau of Land Management (Hobbs Office Closed)   393-0002	_	· · · · · · · · · · · · · · · · · · ·				
US Bureau of Land Management (Hobbs Office Closed) 393-0002	_					
Eddy   County (575)   State Police   885-3137	_					
County (575)         State Police         885-3137           City Police         885-2111           Sheriff's Office         887-7551           Ambulance         911           Fire Department         885-3125           LEPC (Local Emergency Planning Committee)         887-3798           US Bureau of Land Management (Carlsbad)         (575)-706-1920           (575)-234-5909         NM Emergency Response Commission (Santa Fe)         (505) 476-9600           24 HR         (505) 827-9126           National Emergency Response Center         (800) 424-8802           National Pollution Control Center: Direct         (703) 872-6000           For Oil Spills         (800) 280-7118           Emergency Services         Wild Well Control         (281) 784-4700           Cudd Pressure Control         (915) 699-0139         (915) 563-3356	_	US Bureau of Land Management (Hobbs Office Closed) 393				
County (575)         State Police         885-3137           City Police         885-2111           Sheriff's Office         887-7551           Ambulance         911           Fire Department         885-3125           LEPC (Local Emergency Planning Committee)         887-3798           US Bureau of Land Management (Carlsbad)         (575)-706-1920           (575)-234-5909         NM Emergency Response Commission (Santa Fe)         (505) 476-9600           24 HR         (505) 827-9126           National Emergency Response Center         (800) 424-8802           National Pollution Control Center: Direct         (703) 872-6000           For Oil Spills         (800) 280-7118           Emergency Services         Wild Well Control         (281) 784-4700           Cudd Pressure Control         (915) 699-0139         (915) 563-3356	Eddy Carlshad					
City Police       885-2111         Sheriff's Office       887-7551         Ambulance       911         Fire Department       885-3125         LEPC (Local Emergency Planning Committee)       887-3798         US Bureau of Land Management (Carlsbad)       (575)-706-1920         (575)-234-5909       (575)-234-5909         NM Emergency Response Commission (Santa Fe)       (505) 476-9600         24 HR       (505) 827-9126         National Emergency Response Center       (800) 424-8802         National Pollution Control Center: Direct       (703) 872-6000         For Oil Spills       (800) 280-7118         Emergency Services       (281) 784-4700         Cudd Pressure Control       (915) 699-0139       (915) 563-3356					885-3137	
Sheriff's Office       887-7551         Ambulance       911         Fire Department       885-3125         LEPC (Local Emergency Planning Committee)       887-3798         US Bureau of Land Management (Carlsbad)       (575)-706-1920         (575)-234-5909       (575)-234-5909         NM Emergency Response Commission (Santa Fe)       (505) 476-9600         24 HR       (505) 827-9126         National Emergency Response Center       (800) 424-8802         National Pollution Control Center: Direct       (703) 872-6000         For Oil Spills       (800) 280-7118         Emergency Services         Wild Well Control       (281) 784-4700         Cudd Pressure Control       (915) 699-0139       (915) 563-3356						
Ambulance       911         Fire Department       885-3125         LEPC (Local Emergency Planning Committee)       887-3798         US Bureau of Land Management (Carlsbad)       (575)-706-1920         (575)-234-5909       (575)-234-5909         NM Emergency Response Commission (Santa Fe)       (505) 476-9600         24 HR       (505) 827-9126         National Emergency Response Center       (800) 424-8802         National Pollution Control Center: Direct       (703) 872-6000         For Oil Spills       (800) 280-7118         Emergency Services       Wild Well Control       (281) 784-4700         Cudd Pressure Control       (915) 699-0139       (915) 563-3356		*				
LEPC (Local Emergency Planning Committee)       887-3798         US Bureau of Land Management (Carlsbad)       (575)-706-1920         (575)-234-5909       NM Emergency Response Commission (Santa Fe)       (505) 476-9600         24 HR       (505) 827-9126         National Emergency Response Center       (800) 424-8802         National Pollution Control Center: Direct       (703) 872-6000         For Oil Spills       (800) 280-7118         Emergency Services       Wild Well Control       (281) 784-4700         Cudd Pressure Control       (915) 699-0139       (915) 563-3356	-					
US Bureau of Land Management (Carlsbad) (575)-706-1920 (575)-234-5909  NM Emergency Response Commission (Santa Fe) (505) 476-9600  24 HR (505) 827-9126  National Emergency Response Center (800) 424-8802  National Pollution Control Center: Direct (703) 872-6000  For Oil Spills (800) 280-7118  Emergency Services  Wild Well Control (915) 699-0139 (915) 563-3356		Fire Department	885-3125			
NM Emergency Response Commission (Santa Fe) (505) 476-9600			887-3798			
NM Emergency Response Commission (Santa Fe)       (505) 476-9600         24 HR       (505) 827-9126         National Emergency Response Center       (800) 424-8802         National Pollution Control Center: Direct       (703) 872-6000         For Oil Spills       (800) 280-7118         Emergency Services       Wild Well Control       (281) 784-4700         Cudd Pressure Control       (915) 699-0139       (915) 563-3356		US Bureau of Land Mar	(575)-706-1920			
24 HR       (505) 827-9126         National Emergency Response Center       (800) 424-8802         National Pollution Control Center: Direct       (703) 872-6000         For Oil Spills       (800) 280-7118         Emergency Services       Wild Well Control       (281) 784-4700         Cudd Pressure Control       (915) 699-0139       (915) 563-3356						
National Emergency Response Center       (800) 424-8802         National Pollution Control Center: Direct       (703) 872-6000         For Oil Spills       (800) 280-7118         Emergency Services       (281) 784-4700         Cudd Pressure Control       (915) 699-0139       (915) 563-3356			nse Commission (S	Santa Fe)	•	
National Pollution Control Center: Direct       (703) 872-6000         For Oil Spills       (800) 280-7118         Emergency Services       (281) 784-4700         Wild Well Control       (915) 699-0139       (915) 563-3356		24 HR			(505) 827-9126	
For Oil Spills (800) 280-7118  Emergency Services  Wild Well Control (281) 784-4700  Cudd Pressure Control (915) 699-0139 (915) 563-3356		<u> </u>	(800) 424-8802			
Emergency Services           Wild Well Control         (281) 784-4700           Cudd Pressure Control         (915) 699-0139         (915) 563-3356	Ī	National Pollution Conti	(703) 872-6000			
Wild Well Control       (281) 784-4700         Cudd Pressure Control       (915) 699-0139       (915) 563-3356			(800) 280-7118			
Wild Well Control       (281) 784-4700         Cudd Pressure Control       (915) 699-0139       (915) 563-3356						
					(281) 784-4700	
	-	Cudd Pressure Control	(9	915) 699-0139	` ,	
Hallibulturi (5/5) /46-2/5/	ŀ	Halliburton	<u> </u>	•	(575) 746-2757	
B. J. Services (575) 746-3569	ŀ	B. J. Services			` ,	
<del></del>						

Give	Native Air – Emergency Helicopter – Hobbs	(575) 347-9836
GPS	For Air Ambulance - Eddy County Dispatch	(575)-616-7155
position:	For Air Ambulance - Lea County (LCCA)	(575)-397-9265
	Poison Control (24/7)	(800) 222-1222
	Oil & Gas Pipeline 24 Hour Service	(800) 364-4366
	NOAA – Website - www.nhc.noaa.gov	
	National Pollution Control Center	202-795-6958
	NPCC – Oil Spills	800-280-7118
	BNSF Railroad Resource Operations	800-832-5452
	NM OSHA – Santa Fe	505-222-9595
	NM OSHA (Reporting)	877-610-6742
		505-476-8700

Prepared in conjunction with Dave Small

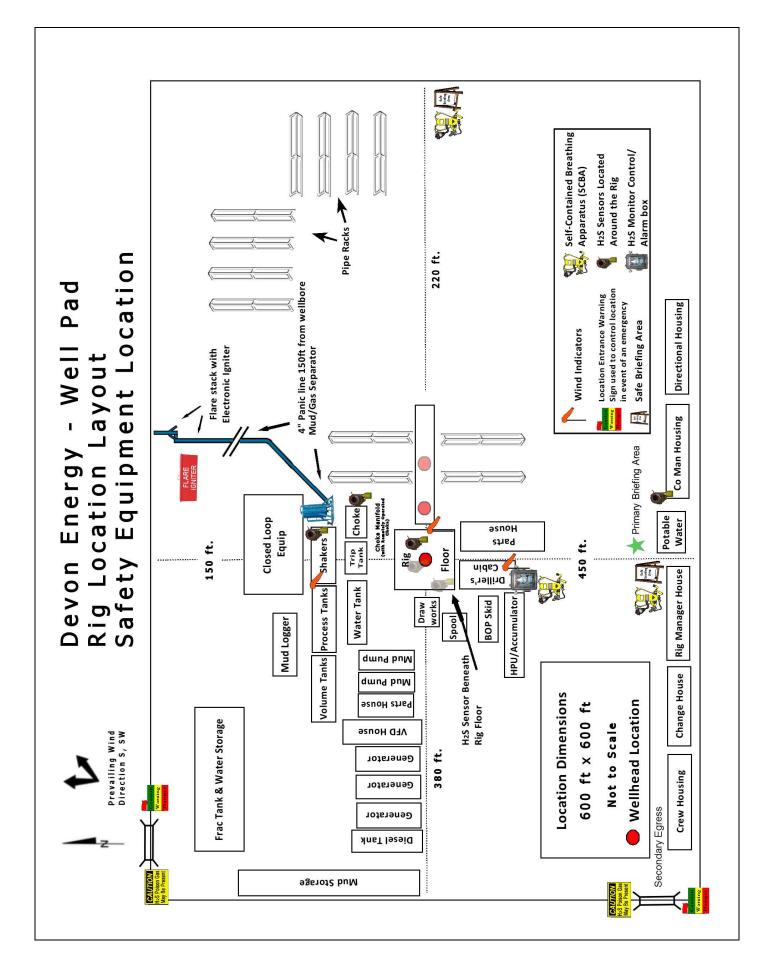

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

## **State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 382155

#### **CONDITIONS**

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	382155
	Action Type:
	[C-101] BLM - Federal/Indian Land Lease (Form 3160-3)

#### CONDITIONS

Created By	Condition	Condition Date
ward.rikala	Notify OCD 24 hours prior to casing & cement	9/23/2024
ward.rikala	Will require a File As Drilled C-102 and a Directional Survey with the C-104	9/23/2024
ward.rikala	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string	9/23/2024
ward.rikala	Cement is required to circulate on both surface and intermediate1 strings of casing	9/23/2024
ward.rikala	If cement does not circulate on any string, a CBL is required for that string of casing	9/23/2024
ward.rikala	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system	9/23/2024