Received by OCD: 10/29/2024 12:23:52 PM

Form 3160-3 (June 2015) UNITED STATES	FORM APPROVED OMB No. 1004-0137 Expires: January 31, 2018					
DEPARTMENT OF THE I BUREAU OF LAND MAN	5. Lease Serial No.					
APPLICATION FOR PERMIT TO D	6. If Indian, Allotee or Tribe Name					
1a. Type of work: DRILL	EENTER			7. If Unit or CA Agreer	ment, Name	and No.
	ther			8. Lease Name and We	II No	
1c. Type of Completion: Hydraulic Fracturing	ingle Zone	Multiple Zone		8. Lease Name and we	no.	
2. Name of Operator				9. API Well No.		
				30-025-53814	4	
3a. Address	3b. Phone N	No. (include area coa	le)	10. Field and Pool, or I	Exploratory	
4. Location of Well (Report location clearly and in accordance w	with any State	e requirements.*)		11. Sec., T. R. M. or Bl	lk. and Surve	y or Area
At surface						
At proposed prod. zone						
14. Distance in miles and direction from nearest town or post off	ice*			12. County or Parish	13. S	tate
 15. Distance from proposed* location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any) 	16. No of a	cres in lease	17. Space	. Spacing Unit dedicated to this well		
 Distance from proposed location* to nearest well, drilling, completed, applied for, on this lease, ft. 	19. Propose	ed Depth	20. BLM	Л/BIA Bond No. in file		
21. Elevations (Show whether DF, KDB, RT, GL, etc.)	22. Approx	Approximate date work will start* 23. Estimated duration				
	24. Atta	chments				
The following, completed in accordance with the requirements of (as applicable)	f Onshore Oi	l and Gas Order No.	1, and the	Hydraulic Fracturing rule	e per 43 CFR	3162.3-3
 Well plat certified by a registered surveyor. A Drilling Plan. 		4. Bond to cover the Item 20 above).	ne operation	ns unless covered by an ex	xisting bond o	on file (see
3. A Surface Use Plan (if the location is on National Forest Syste SUPO must be filed with the appropriate Forest Service Office				rmation and/or plans as ma	ay be requeste	ed by the
25. Signature	Name	e (Printed/Typed)		Date		
Title						
Approved by (Signature)	Name	Name (Printed/Typed)		D	ate	
Title	e					
Application approval does not warrant or certify that the applicar applicant to conduct operations thereon. Conditions of approval, if any, are attached.	nt holds legal	or equitable title to t	hose rights	s in the subject lease whic	ch would enti	tle the
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, n of the United States any false, fictitious or fraudulent statements					department	or agency
				1		



*(Instructions on page 2)

.

(Continued on page 2)

Additional Operator Remarks

Location of Well

0. SHL: LOT 2 / 605 FNL / 1736 FEL / TWSP: 22S / RANGE: 32E / SECTION: 4 / LAT: 32.4262839 / LONG: -103.6767919 (TVD: 0 feet, MD: 0 feet) PPP: LOT 1 / 100 FNL / 330 FEL / TWSP: 22S / RANGE: 32E / SECTION: 4 / LAT: 32.4276887 / LONG: -103.6722356 (TVD: 10671 feet, MD: 11200 feet) PPP: NESE / 2636 FNL / 330 FEL / TWSP: 22S / RANGE: 32E / SECTION: 4 / LAT: 32.420719 / LONG: -103.6722316 (TVD: 10671 feet, MD: 13737 feet) BHL: SESE / 20 FSL / 330 FEL / TWSP: 22S / RANGE: 32E / SECTION: 9 / LAT: 32.3989986 / LONG: -103.6721982 (TVD: 10811 feet, MD: 21639 feet)

BLM Point of Contact

Name: TENILLE C MOLINA Title: Land Law Examiner Phone: (575) 234-2224 Email: TCMOLINA@BLM.GOV

	State of New C-102 State of New Energy, Minerals & Natural						l Resources Department			Revised July 9, 2024		
	it Electronica CD Permitting			OIL	CONSERVAT	TON DIVISI	ON			☑ Initial Su	bmittal	
		>					Submittal Type:			1 Report		
									\Box As Drilled		ed	
			•		WELL LOCAT	ION INFORMA	TION			- 4		
API N	Sumber 30-	025-53814									SPRING	
Prope	rty Code 33	34838	Property N	^{lame} GC	DLD LOG	G 4-9 FE	EDE	RAL C	COM	Well Number	er	
OGRI 1669			Operator N	Name OX	Y USA	INC.				Ground Lev 3796'	el Elevation	
Surfac	ce Owner: 🗆	State □ Fee □] Tribal 🗹 Fe	deral		Mineral Ow	ner: 🗹 S	itate 🗆 Fee 🗆]Tribal 🗹	Federal		
					Surfa	ice Location						
UL	Section	Township	Range	Lot	Ft. from N/S	Ft. from E/W		Latitude		Longitude	County	
В	4	22S	32E		605FNL	_ 1736F	EL	32.4262	8399 -	103.67679195	LEA	
	•		ULL			Hole Location						
UL	Section	Township	Range	Lot	Ft. from N/S	Ft. from E/W		Latitude		Longitude	County	
Ρ	9	22S	32E		20FSL	330FE	-1	32.3989	9863 -	103.67219828	LEA	
-	U	220	ULL		20:02	000	-					
Dedic	ated Acres	Infill or Def	ining Well	Defining	g Well API	Overlapping	Spacing	Unit (Y/N)	Consolida	tion Code		
127	9.16	INFILL	•		-	N						
Order	Numbers. R	-22684				Well setbacks are under Common Ownership: Yes No						
UL	Section	Township	Range	Lot	Ft. from N/S	ff Point (KOP) Ft. from E/W		Latitude		Longitude	County	
Ρ	33	21S ¹	32E		300 FSI	_330FE	-1	32.4287		103.67223716	2	
-			022			ke Point (FTP)						
UL	Section	Township	Range	Lot	Ft. from N/S	Ft. from E/W		Latitude		Longitude	County	
А	4	22S	32E	1	100 FNI	330 F	EL	32.4276		103.67223569	LEÁ	
			1		Last Ta	ke Point (LTP)						
UL	Section	Township	Range	Lot	Ft. from N/S	Ft. from E/W		Latitude		Longitude	County	
Ρ	9	22S	32E		983 FSI	L 330 F	EL	32.4016	4563 -	103.67220174	LEA	
Unitiz	ed Area or A	rea of Uniform	Interest	Spacing	Unit Type 🖬 Horiz	ontal 🗆 Vertical		Ground	d Floor Ele	evation:		
OPER	ATOR CER	TIFICATIONS				SURVEYOR C	ERTIFIC	CATIONS				
I hereb my kno organi includi locatio interes	ny certify that the owledge and be zation either ow ing the propose n pursuant to a	he information con lief, and, if the we wns a working inte d bottom hole loce a contract with an tary pooling agree	ll is a vertical of crest or unleased ation or has a ri owner of a worl	r directional w d mineral inte ght to drill th king interest o	rest in the land	I hereby certify th	at the we	ll location show		the same is true an ¹⁸ SURVEYOR of I hereby certify t shown on this pl notes of actual s under my supery	m field notes of actual d correct to the best of CERTIFICATION hat the well location at was plotted from field urveys made by me or ision, and that the same	
consen in each interva	t of at least one i tract (in the to	arget pool or form d or obtained a co	of a working inte ation) in which	erest or unlea any part of th ng order from	sed mineral interest e well's completed					is true and corre belter Date of Survey Signature and Sea	ct to the best of my Slow y: JULY 3, 2023 Il of Professional Surveyor	
Signatu	ıre		Date			Signature and Seal	of Professi	onal Surveyor		- ().US		
LES	LIE REEVI	ES								(2	(1653) e	
Printed	Name					Certificate Number		Date of Survey			MAL SURVE	
LES	LIE REE	VES@OXY	.COM			21653		7/3/2023	3	083	NAL SUR	
-	Address											
								1				


Note: No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

•

Received by OCD: 10/29/2024 12:23:52 PM ACREAGE DEDICATION PLATS

This grid represents a standard section. You may superimpose a non-standard section, or larger area, over this grid. Operators must outline the dedicated acreage in a red box, clearly show the well surface location and bottom hole location, if it is directionally drilled, with the dimensions from the section lines in the cardinal directions. If this is a horizontal wellbore show on this plat the location of the First Take Point and Last Take Point, and the point within the Completed interval (other than the First Take Point or Last Take Point) that is closest to any outer boundary of the tract.

Surveyors shall use the latest United States government survey or dependent resurvey. Well locations will be in reference to the New Mexico Principal Meridian. If the land is not surveyed, contact the OCD Engineering Bureau. Independent subdivision surveys will not be acceptable.

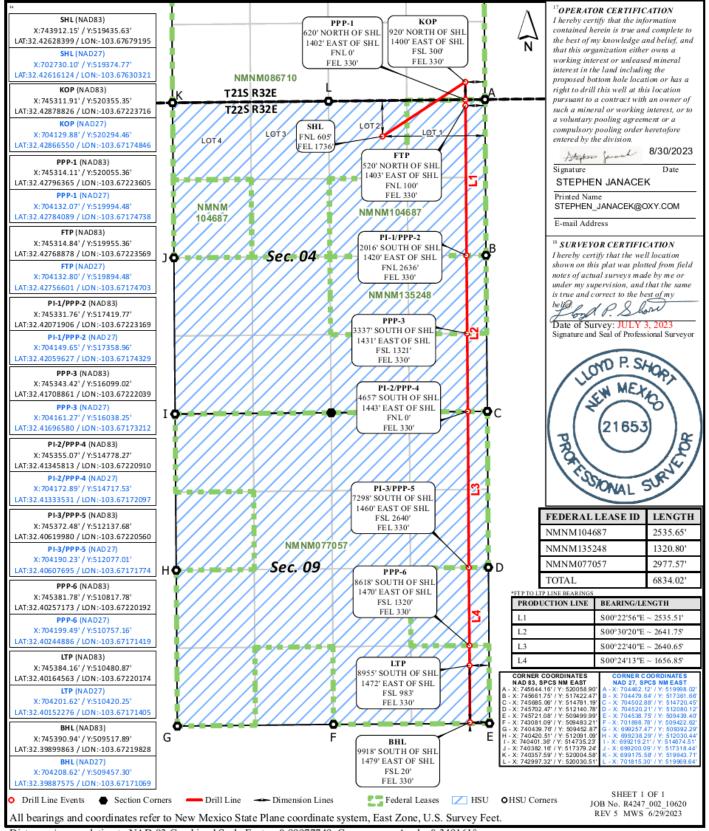

	E		te of New Mex and Natural Res		ent		mit Electronically E-permitting	
Energy, Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505							via E-permitting	
	N	ATURAL G	AS MANA	GEMENT P	LAN			
This Natural Gas Mana	gement Plan n	nust be submitted w	rith each Applicat	tion for Permit to I	Drill (APD) for a	new o	r recompleted well	
			<u>1 – Plan D</u> ffective May 25,					
					D (0.2		
. Operator: OXY US	SA INC.		OGRID: 10	696	Date:	0 2/	2 2/ 2 3	
		t due to □ 19.15.27					2 2 2 3	
II. Type: 🗹 Original [□ Amendmen		.9.D(6)(a) NMA	C 🗆 19.15.27.9.D(22/23	
I. Type: ☑ Original [f Other, please describe II. Well(s): Provide th	□ Amendmen e: e following in	formation for each	1.9.D(6)(a) NMA	C 19.15.27.9.D((6)(b) NMAC 🗆	Other.		
II. Type: D Original [If Other, please describe III. Well(s): Provide th	□ Amendmen e: e following in	formation for each	1.9.D(6)(a) NMA	C 19.15.27.9.D((6)(b) NMAC 🗆	Other.		
 II. Type: ☑ Original I If Other, please describe III. Well(s): Provide the recompleted from a second s	☐ Amendmen e: e following in single well pac	formation for each l or connected to a	1.9.D(6)(a) NMA(new or recomple central delivery p	C 🗆 19.15.27.9.D(ted well or set of voint.	(6)(b) NMAC □ wells proposed t Anticipated	Other.	illed or proposed to Anticipated Produced Water	
II. Type: ☑ Original I If Other, please describe III. Well(s): Provide th be recompleted from a s Well Name SEE ATTACHED	☐ Amendmen e: e following in single well pac API	formation for each l or connected to a ULSTR	1.9.D(6)(a) NMA(new or recomple central delivery p	C 🗆 19.15.27.9.D(ted well or set of voint.	(6)(b) NMAC □ wells proposed t Anticipated Gas MCF/D	Other.	illed or proposed to Anticipated Produced Water	
 I. Type: ☑ Original I f Other, please describe III. Well(s): Provide the recompleted from a second term Well Name SEE ATTACHED IV. Central Delivery P V. Anticipated Schedu 	☐ Amendmen e: e following in single well pac API oint Name: le: Provide the	formation for each l or connected to a o ULSTR	2.9.D(6)(a) NMA new or recomple central delivery p Footages	C 🗆 19.15.27.9.D((6)(b) NMAC wells proposed t Anticipated Gas MCF/D See	Other.	illed or proposed to Anticipated Produced Water BBL/D 27.9(D)(1) NMAC]	
I. Operator: OXY US II. Type: ☑ Original I If Other, please describe III. Well(s): Provide th be recompleted from a s Well Name SEE ATTACHED IV. Central Delivery P V. Anticipated Schedu proposed to be recompl Well Name	☐ Amendmen e: e following in single well pac API oint Name: le: Provide the	formation for each l or connected to a o ULSTR	2.9.D(6)(a) NMA new or recomple central delivery p Footages	C 🗆 19.15.27.9.D((6)(b) NMAC wells proposed t Anticipated Gas MCF/D [See yell or set of wel	Other.	illed or proposed to Anticipated Produced Water BBL/D	

VIII. Best Management Practices: Attach a complete description of Operator's best management practices to minimize venting during active and planned maintenance.

Subsection A through F of 19.15.27.8 NMAC.

Page 6

Section 2 – Enhanced Plan EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF

X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

XI. Map. \Box Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.

XII. Line Capacity. The natural gas gathering system \Box will \Box will not have capacity to gather 100% of the anticipated natural gas production volume from the well prior to the date of first production.

XIII. Line Pressure. Operator \Box does \Box does not anticipate that its existing well(s) connected to the same segment, or portion, of the natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s).

 \Box Attach Operator's plan to manage production in response to the increased line pressure.

XIV. Confidentiality: \Box Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information provided in Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific information for which confidentiality is asserted and the basis for such assertion.

Page 7

Section 3 - Certifications Effective May 25, 2021

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal:

 \square Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or

 \Box Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system. *If Operator checks this box, Operator will select one of the following:*

Well Shut-In. \Box Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or

Venting and Flaring Plan. \Box Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including:

- (a) power generation on lease;
- (b) power generation for grid;
- (c) compression on lease;
- (d) liquids removal on lease;
- (e) reinjection for underground storage;
- (f) reinjection for temporary storage;
- (g) reinjection for enhanced oil recovery;
- (h) fuel cell production; and
- (i) other alternative beneficial uses approved by the division.

Section 4 - Notices

1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:

(a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or

(b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.

2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

Received by OCD: 10/29/2024 12:23:52 PM

Page 8

I certify that, after reasonable inquiry, the statements in and attached to this Natural Gas Management Plan are true and correct to the best of my knowledge and acknowledge that a false statement may be subject to civil and criminal penalties under the Oil and Gas Act.

signature: Roni Mathew
Printed Name: Roni Mathew
Title: Regulatory Advisor
E-mail Address: roni_mathew@oxy.com
Date: 02/22/2023
^{Phone:} 713-215-7827
OIL CONSERVATION DIVISION
OIL CONSERVATION DIVISION (Only applicable when submitted as a standalone form)
(Only applicable when submitted as a standalone form)
(Only applicable when submitted as a standalone form) Approved By:

III. Well(s)

Well Name	API	WELL LOCATION (ULSTR)	Footages	ANTICIPATED OIL BBL/D	ANTICIPATED GAS MCF/D	ANTICIPATED PROD WATER BBL/D
GOLD LOG 4_9 FED COM 11H	Pending	D-4-22S-32E	396 FNL 1076 FWL	1500	3500	4630
GOLD LOG 4_9 FED COM 12H	Pending	D-4-22S-32E	397 FNL 1106 FWL	1500	3500	4630
GOLD LOG 4_9 FED COM 13H	Pending	D-4-22S-32E	397 FNL 1136 FWL	1500	3500	4630
GOLD LOG 4_9 FED COM 14H	Pending	B-4-22S-32E	394 FNL 1825 FEL	1500	3500	4630
GOLD LOG 4_9 FED COM 15H	Pending	B-4-22S-32E	394 FNL 1795 FEL	1500	3500	4630
GOLD LOG 4_9 FED COM 16H	Pending	B-4-22S-32E	394 FNL 1765 FEL	1500	3500	4630
GOLD LOG 4_9 FED COM 1H	Pending	D-4-22S-32E	398 FNL 1196 FWL	1255	2700	4500
GOLD LOG 4_9 FED COM 21H	Pending	D-4-22S-32E	607 FNL 1104 FWL	1460	1667	4667
GOLD LOG 4_9 FED COM 22H	Pending	D-4-22S-32E	607 FNL 1134 FWL	1460	1667	4667
GOLD LOG 4_9 FED COM 23H	Pending	D-4-22S-32E	607 FNL 1164 FWL	1460	1667	4667
GOLD LOG 4_9 FED COM 24H	Pending	B-4-22S-32E	604 FNL 1796 FEL	1460	1667	4667
GOLD LOG 4_9 FED COM 25H	Pending	B-4-22S-32E	604 FNL 1766 FEL	1460	1667	4667
GOLD LOG 4_9 FED COM 26H	Pending	B-4-22S-32E	605 FNL 1736 FEL	1460	1667	4667
GOLD LOG 4_9 FED COM 2H	Pending	D-4-22S-32E	398 FNL 1226 FWL	1255	2700	4500
GOLD LOG 4_9 FED COM 3H	Pending	B-4-22S-32E	395 FNL 1705 FEL	1255	2700	4500
GOLD LOG 4_9 FED COM 4H	Pending	B-4-22S-32E	395 FNL 1675 FEL	1255	2700	4500
GOLD LOG 4_9 FED COM 71H	Pending	D-4-22S-32E	399 FNL 1286 FWL	1800	2750	5000
GOLD LOG 4_9 FED COM 72H	Pending	D-4-22S-32E	399 FNL 1316 FWL	1800	2750	5000
GOLD LOG 4_9 FED COM 73H	Pending	B-4-22S-32E	396 FNL 1615 FEL	1800	2750	5000
GOLD LOG 4_9 FED COM 74H	Pending	B-4-22S-32E	396 FNL 1585 FEL	1800	2750	5000
GOLD LOG 4_9 FED COM 311H	Pending	D-4-22S-32E	608 FNL 1254 FWL	3000	5000	7500
GOLD LOG 4_9 FED COM 31H	Pending	D-4-22S-32E	608 FNL 1224 FWL	3000	5000	7500
GOLD LOG 4_9 FED COM 32H	Pending	D-4-22S-32E	608 FNL 1284 FWL	3000	5000	7500
GOLD LOG 4_9 FED COM 33H	Pending	D-4-22S-32E	609 FNL 1314 FWL	3000	5000	7500
GOLD LOG 4_9 FED COM 312H	Pending	B-4-22S-32E	605 FNL 1676 FEL	3000	5000	7500
GOLD LOG 4_9 FED COM 313H	Pending	B-4-22S-32E	606 FNL 1616 FEL	3000	5000	7500
GOLD LOG 4_9 FED COM 34H	Pending	B-4-22S-32E	606 FNL 1646 FEL	3000	5000	7500
GOLD LOG 4_9 FED COM 35H	Pending	B-4-22S-32E	606 FNL 1586 FEL	3000	5000	7500

.

V. Anticipated Schedule

Well Name	API	Spud Date	TD Reached Date	Completion Commencement Date	Initial Flow Back Date	First Production Date
GOLD LOG 4_9 FED COM 11H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 12H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 13H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 14H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 15H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 16H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 1H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 21H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 22H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 23H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 24H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 25H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 26H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 2H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 3H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 4H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 71H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 72H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 73H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 74H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 311H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 31H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 32H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 33H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 312H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 313H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 34H	Pending	TBD	TBD	TBD	TBD	TBD
GOLD LOG 4_9 FED COM 35H	Pending	TBD	TBD	TBD	TBD	TBD

.

Central Delivery Point Name: (Lost Tank 6)

Part VI. Separation Equipment

Operator will size the flowback separator to handle 11,000 Bbls of fluid and 6-10MMscfd which is more than the expected peak rates for these wells. Each separator is rated to 1440psig, and pressure control valves and automated communication will cause the wells to shut in in the event of an upset at the facility, therefore no gas will be flared on pad during an upset. Current Oxy practices avoid use of flare or venting on pad, therefore if there is an upset or emergency condition at the facility, the wells will immediately shut down, and reassume production once the condition has cleared.

VII. Operational Practices

Gathering System and Pipeline Notification

Well(s) will be connected to a production facility and fluids will be sent to the facility after initial flowback operations are complete, where a gas transporter system is in place. The gas produced from production facility will be dedicated to MarkWest Energy West Texas Gas Company LLC ("MarkWest") and will be connected to MarkWest's high pressure gathering system located in Lea and Eddy Counties, New Mexico and Loving and Culberson Counties, TX. OXY USA INC. ("OXY") will provide (periodically) to MarkWest a production forecast for wells being sent to their system. In addition, OXY and MarkWest will have periodic conference calls to discuss changes to production forecasts arising out of changes to drilling and completion schedules. Gas from these wells will be processed at MarWest's Preakness and Tornado Processing Plants located in Culberson County, TX and Loving County, Texas respectively. The actual flow of the gas will be based on compression operating parameters and gathering system pressures.

Flowback Strategy

After the fracture treatment/completion operations, well(s) will be produced to temporary production tanks and gas will be flared or vented. During flowback, the fluids and sand content will be monitored. When the produced fluids contain minimal sand, the wells will be turned to production facilities. Gas sales should start as soon as the wells start flowing through the production facilities, unless there are operational issues on MarkWest's system at that time. Based on current information, it is OXY's belief the system can take this gas upon completion of the well(s).

Safety requirements during cleanout operations from the use of underbalanced air cleanout systems may necessitate that sand and non-pipeline quality gas be vented and/or flared rather than sold on a temporary basis.

VIII. Best Management Practices

Alternatives to Reduce Flaring

Below are alternatives considered from a conceptual standpoint to reduce the amount of gas flared.

Power Generation – On lease

Only a portion of gas is consumed operating the generator, remainder of gas will be flared

Compressed Natural Gas – On lease

Gas flared would be minimal, but might be uneconomical to operate when gas volume declines

NGL Removal – On lease

Plants are expensive, residue gas is still flared, and uneconomical to operate when gas volume declines

Oxy USA Inc. - GOLD LOG 4_9 FED COM 26H Drill Plan

1. Geologic Formations

Delaware Basin

Formation	MD-RKB (ft)	TVD-RKB (ft)	Expected Fluids
Rustler	982	982	
Salado	1153	1153	Salt
Castile	2630	2630	Salt
Delaware	4838	4838	Oil/Gas/Brine
Bell Canyon	4945	4945	Oil/Gas/Brine
Cherry Canyon	5780	5776	Oil/Gas/Brine
Brushy Canyon	7031	6984	Losses
Bone Spring	8984	8839	Oil/Gas
Bone Spring 1st	10065	9865	Oil/Gas
Bone Spring 2nd	10721	10480	Oil/Gas
Bone Spring 3rd			Oil/Gas
Wolfcamp			Oil/Gas
Penn			Oil/Gas
Strawn			Oil/Gas

*H2S, water flows, loss of circulation, abnormal pressures, etc.

2. Casing Program

		N	ID	TVD					
	Hole	From	То	From	То	Csg.	Csg Wt.		
Section	Size (in)	(ft)	(ft)	(ft)	(ft)	OD (in)	(ppf)	Grade	Conn.
Surface	14.75	0	1042	0	1042	10.75	45.5	J-55	BTC
Intermediate	9.875	0	10119	0	9921	7.625	26.4	L-80 HC	BTC
Production	6.75	0	21640	0	10811	5.5	20	P-110	Sprint-SF

All casing strings will be tested in accordance with 43 CFR part 3170 Subpart 3172

Occidental - Per	mian New Mexico
------------------	-----------------

All Casing SF Values will meet or exceed							
those below							
SF	SF Body SF Joint SF						
Collapse	Burst	Tension	Tension				
1.00	1.100	1.4	1.4				

	Y or N
Is casing new? If used, attach certification as required in 43 CFR 3160	Y
Does casing meet API specifications? If no, attach casing specification sheet.	Y
Is premium or uncommon casing planned? If yes attach casing specification sheet.	Y
Does the above casing design meet or exceed BLM's minimum standards?	Y
If not provide justification (loading assumptions, casing design criteria).	1
Will the intermediate pipe be kept at a minimum 1/3 fluid filled to avoid approaching	V
the collapse pressure rating of the casing?	Y
Is well located within Capitan Reef?	N
If yes, does production casing cement tie back a minimum of 50' above the Reef?	
Is well within the designated 4 string boundary.	
Is well located in SOPA but not in R-111-P?	Y
If yes, are the first 2 strings cemented to surface and 3 rd string cement tied back	Y
500' into previous casing?	1
Is well located in R-111-P and SOPA?	Ν
If yes, are the first three strings cemented to surface?	
Is 2 nd string set 100' to 600' below the base of salt?	
Is well located in high Cave/Karst?	N
If yes, are there two strings cemented to surface?	
(For 2 string wells) If yes, is there a contingency casing if lost circulation occurs?	
Is well located in critical Cave/Karst?	N
If yes, are there three strings cemented to surface?	

•

3. Cementing Program

Section	Stage	Slurry:	Sacks	Yield (ft^3/ft)	Density (Ib/gal)	Excess:	тос	Placement	Description
Surface	1	Surface - Tail	872	1.33	14.8	100%	-	Circulate	Class C+Accel.
Int.	1	Intermediate 1S - Tail	381	1.68	13.2	5%	7,281	Circulate	Class C+Ret., Disper.
Int.	2	Intermediate 2S - Tail BH	1122	1.71	13.3	25%	-	Bradenhead	Class C+Accel.
Prod.	1	Production - Tail	681	1.84	13.3	25%	9,619	Circulate	Class C+Ret.

Offline Cementing Request

Oxy requests a variance to cement the 9.625" and/or 7.625" intermediate casing strings offline in accordance to the approved variance, EC Tran 461365. Please see Offline Cementing Variance attachment for further details.

Bradenhead CBL Request

Oxy requests permission to adjust the CBL requirement after bradenhead cement jobs, on 7-5/8" intermediate casings, as per the agreement reached in the OXY/BLM meeting on September 5, 2019. Please see Bradenhead CBL Variance attachment for further details.

.

4. Pressure Control Equipment

BOP installed and tested before drilling which hole?	Size?	Min. Required WP		Туре	~	Tested to:	Deepest TVD Depth (ft) per Section:						
		5M		Annular	\checkmark	70% of working pressure							
				Blind Ram	\checkmark								
9.875" Hole	13-5/8"	5M		Pipe Ram		250 psi / 5000 psi	9921						
				Double Ram	\checkmark	200 psi / 0000 psi							
				Other*									
	13-5/8"							5M		Annular	\checkmark	70% of working pressure	
		5M		Blind Ram	\checkmark								
6.75" Hole			Pipe Ram			250 psi / 5000 psi	10811						
				Double Ram	\checkmark	200 psi / 0000 psi							
			Other*										

*Specify if additional ram is utilized

BOP/BOPE will be tested by an independent service company to 250 psi low and the high pressure indicated above per 43 CFR part 3170 Subpart 3172 requirements. The System may be upgraded to a higher pressure but still tested to the working pressure listed in the table above. If the system is upgraded all the components installed will be functional and tested.

Pipe rams will be operationally checked each 24 hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets. Other accessories to the BOP equipment will include a Kelly cock and floor safety valve (inside BOP) and choke lines and choke

.

Occidental - Permian New Mexico

Formation integrity test will be performed per 43 CFR part 3170 Subpart 3172. On Exploratory wells or on that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Will be tested in accordance with 43 CFR part 3170 Subpart 3172.

A variance is requested for the use of a flexible choke line from the BOP to Choke Manifold. See attached for specs and hydrostatic test chart.

Y Are anchors required by manufacturer?

A multibowl or a unionized multibowl wellhead system will be employed. The wellhead and connection to the BOPE will meet all API 6A requirements. The BOP will be tested per 43 CFR part 3170 Subpart 3172 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested. We will test the flange connection of the wellhead with a test port that is directly in the flange. We are proposing that we will run the wellhead through the rotary prior to cementing surface casing as discussed with the BLM on October 8, 2015.

See attached schematics.

BOP Break Testing Request

Oxy requests permission to adjust the BOP break testing requirements as per the agreement reached in the OXY/BLM meeting on September 5, 2019. Please see BOP Break Testing Variance attachment for further details.

Oxy will use Cameron ADAPT wellhead system that uses an OEC top flange connection. This connection has been fully vetted and verified by API to Spec 6A and carries an API monogram.

5. Mud Program

Section	Depth - MD		Depth - TVD		Trino	Weight		Water
Section	From (ft)	To (ft)	From (ft)	To (ft)	Туре	(ppg)	Viscosity	Loss
Surface	0	1042	0	1042	Water-Based Mud	8.6 - 8.8	40-60	N/C
Intermediate	1042	10119	1042	9921	Saturated Brine-Based or Oil-Based Mud	8.0 - 10.0	35-45	N/C
Production	10119	21640	9921	10811	Water-Based or Oil- Based Mud	8.0 - 9.6	38-50	N/C

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times. The following is a general list of products: Barite, Bentonite, Gypsum, Lime, Soda Ash, Caustic Soda, Nut Plug, Cedar Fiber, Cotton Seed Hulls,

What will be used to monitor the	PVT/MD Totco/Visual Monitoring
loss or gain of fluid?	PVI/IVID TOLCO/VISUAI WORILOTINg

6. Logging and Testing Procedures

<u>U</u>	0			
Logg	Logging, Coring and Testing.			
Yes	Will run GR from TD to surface (horizontal well – vertical portion of hole).			
res	Stated logs run will be in the Completion Report and submitted to the BLM.			
No	Logs are planned based on well control or offset log information.			
No	No Drill stem test? If yes, explain			
No	Coring? If yes explain			

No Coring? If yes, explain

Addi	tional logs planned	Interval
No	Resistivity	
No	Density	
Yes	CBL	Production string
Yes	Mud log	Bone Spring – TD
No	PEX	

.

GOLD LOG 4_9 FED COM 26H

7. Drilling Conditions

Condition	Specify what type and where?
BH Pressure at deepest TVD	5397 psi
Abnormal Temperature	No
BH Temperature at deepest TVD	167°F

Pump high viscosity sweeps as needed for hole cleaning. The mud system will be monitored visually/manually as well as with an electronic PVT. The necessary mud products for additional weight and fluid loss control will be on location at all times. Appropriately weighted mud will be used to isolate potential gas, oil, and water zones until such time as casing can be cemented into place for

Hydrogen Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. If H2S is
detected in concentrations greater than 100 ppm, the operator will comply with the provisions of 43
CFR part 3170 Subpart 3172. If Hydrogen Sulfide is encountered, measured values and formations will
be provided to the BLM.

Ν	H2S is present	
Υ	H2S Plan attached	

8. Other facets of operation

	Yes/No
Will the well be drilled with a walking/skidding operation? If yes, describe.	
We plan to drill the 2 well pad in batch by section: all surface sections, intermediate	Yes
sections and production sections. The wellhead will be secured with a night cap whenever	Ies
the rig is not over the well.	
Will more than one drilling rig be used for drilling operations? If yes, describe.	
Oxy requests the option to contract a Surface Rig to drill, set surface casing, and cement for	
this well. If the timing between rigs is such that Oxy would not be able to preset surface,	Yes
the Primary Rig will MIRU and drill the well in its entirety per the APD. Please see the	
attached document for information on the spudder rig.	
Total Estimated Cuttings Volume: 1591 bbls	

.

OXY USA Inc APD ATTACHMENT: SPUDDER RIG DATA

OPERATOR NAME / NUMBER: OXY USA Inc


1. SUMMARY OF REQUEST:

Oxy USA respectfully requests approval for the following operations for the surface hole in the drill plan:

1. Utilize a spudder rig to pre-set surface casing for time and cost savings.

2. Description of Operations

- 1. Spudder rig will move in to drill the surface hole and pre-set surface casing on the well.
 - a. After drilling the surface hole section, the spudder rig will run casing and cement following all of the applicable rules and regulations (43 CFR part 3170 Subpart 3172, all COAs and NMOCD regulations).
 - b. The spudder rig will utilize fresh water-based mud to drill the surface hole to TD. Solids control will be handled entirely on a closed loop basis. No earth pits will be used.
- 2. The wellhead will be installed and tested as soon as the surface casing is cut off and the WOC time has been reached.
- **3.** A blind flange at the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with needle valves installed on two wingvalves.
 - **a.** A means for intervention will be maintained while the drilling rig is not over the well.
- 4. Spudder rig operations are expected to take 2-3 days per well on the pad.
- 5. The BLM will be contacted and notified 24 hours prior to commencing spudder rig operations.
- 6. Drilling operations will begin with a larger rig and a BOP stack equal to or greater than the pressure rating that was permitted will be nippled up and tested on the wellhead before drilling operations resume on each well.
 - a. The larger rig will move back onto the location within 90 days from the point at which the wells are secured and the spudder rig is moved off location.
 - b. The BLM will be contacted / notified 24 hours before the larger rig moves back on the pre-set locations.
- 7. Oxy will have supervision on the rig to ensure compliance with all BLM and NMOCD regulations and to oversee operations.
- 8. Once the rig is removed, Oxy will secure the wellhead area by placing a guard rail around the cellar area.

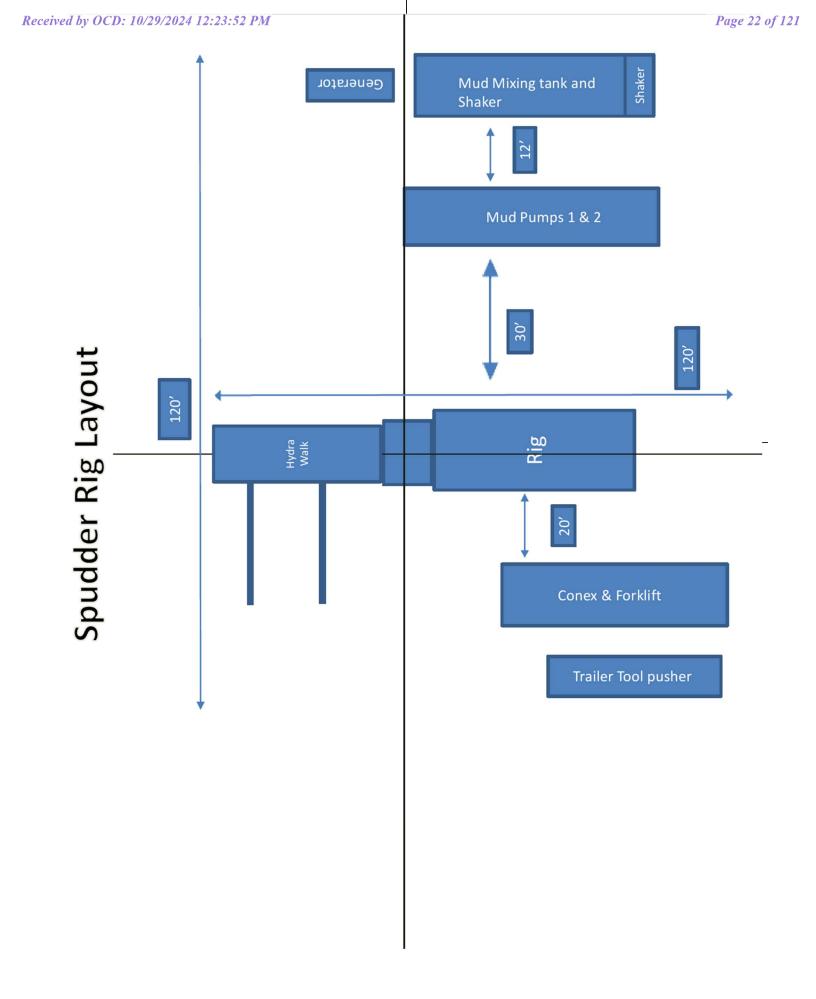

BOP Break Testing Request

Oxy requests permission to adjust the BOP break testing requirements as per the agreement reached in the OXY/BLM meeting on September 5, 2019.

BOP break test under the following conditions:

- After a full BOP test is conducted
- When skidding to drill an intermediate section where ICP is set into the third Bone Spring or shallower.
- When skidding to drill a production section that does not penetrate into the third Bone Spring or deeper.

If the kill line is broken prior to skid, two tests will be performed.

- 1) Wellhead flange, co-flex hose, kill line connections and upper pipe rams
- 2) Wellhead flange, HCR valve, check valve, upper pipe rams

If the kill line is not broken prior to skid, only one test will be performed.

1)Wellhead flange, co-flex hose, check valve, upper pipe rams

See supporting information below:

Subject: Request for a Variance Allowing Break Testing of a Blowout Preventer Stack

OXY USA Inc. (OXY) requests a variance to allow break testing of the Blowout Preventer (BOP) stack when skidding a drilling rig between wells on multi-well pads. This practice entails retesting only the connections of the **BOP** stack that have been disconnected during this operation and not a complete **BOP** test.

Background

43 CFR part 3170 Subpart 3172 states that a **BOP** test must be performed whenever any seal subject to test pressure is broken. The current interpretation of the Bureau of Land Management (BLM) is this requires a complete **BOP** test and not just a test of the affected component. 43 CFR part 3170 Subpart 3172, Section I.D.2. states, "Some situations may exist either on a well-by-well basis or field-wide basis whereby it is commonly accepted practice to vary a particular minimum standard(s) established in this Order. This situation can be resolved by requesting a variance...". OXY feels the practice of break testing the **BOP** stack is such a situation. Therefore, as per 43 CFR part 3170 Subpart 3172, Section IV., OXY submits this request for the variance.

Supporting Rationale

43 CFR part 3170 Subpart 3172 became effective on December 19, 1988, and has remained the standard for regulating BLM onshore drilling operations for almost 30 years. During this time there have been significant changes in drilling technology. **BLM** continues to use the variance request process to allow for the use of modern technology and acceptable engineering practices that have arisen since 43 CFR part 3170 Subpart 3172 was originally released. The drilling rig fleet OXY utilizes in New Mexico was built with many modern upgrades. One of which allows the rigs to skid between wells on multi-well pads. A part of this rig package is a hydraulic winch system which safely installs and removes the BOP from the wellhead and carries it during skidding operations. This technology has made break testing a safe and reliable procldure.

American Petroleum Institute (API) standards, specifications and recommended practices are considered industry standards and are consistently utilized and referenced by the industry. 43 CFR part 3170 Subpart 3172 recognized API Recommended Practices (RP) 53 in its original development. API Standard 53,

Blowout Prevention Equipment Systems for Drilling Wells (Fourth Edition, November 2012, Addendum 1, July 2016) recognizes break testing as an acceptable practice. Specifically, API Standard 53, Section 6.5.3.4.1.b states "Pressure tests on the well control equipment shall be conducted after the disconnection or repair of any pressure containment seal in the **BOP** stack, choke line, kill line, choke manifold, or wellhead assembly but limited to the affected component."

The Bureau of Safety and Environmental Enforcement (BSEE), Department of Interior, has also utilized the API standards, specifications and best practices in the development of its offshore oil and gas regulations and incorporates them by reference within its regulations. BSEE issued new offshore regulations under 30 CFR Part 250, *Oil and Gas and Sulphur Operations in the Outer Continental Shelf - Blowout Preventer Systems and Well Control*, which became effective on July 28, 2016. Section 250.737(d.1) states "Follow the testing requirements of API Standard 53". In addition, Section 250.737(d.8) has adopted language from **API** Standard 53 as it states "Pressure test affected **BOP** components following the disconnection or repair of any well-pressure containment seal in the wellhead or **BOP** stack assembly".

Break testing has been approved by the BLM in the past. See the Appendix for a Sundry Notice that was approved in 2015 by the Farmington Field Office. This approval granted permission for the operator to break test when skidding its Aztec 1000 rig on multi-well pads.

Oxy feels break testing and our current procedures meet the intent of 43 CFR part 3170 Subpart 3172 and often exceed it. We have not seen any evidence that break testing results in more components failing tests than seen on full BOP tests. As skidding operations take place within the 30-day full BOPE test window, the BOP shell and components such as the pipe rams and check valve get tested to the full rated working pressure more often. Therefore, there are more opportunities to ensure components are in good working order. Also, Oxy's standard requires complete BOP tests more often than that of 43 CFR part 3170 Subpart 3172. In addition to function testing the annular at least weekly and the pipe and blind rams on each trip, Oxy also performs a choke drill prior to drilling out every casing shoe. As a crew's training is a vital part of well control, this procedure to simulate step one of the Driller's Method exceeds the requirements of 43 CFR part 3170 Subpart 3172.

Procedures

- 1) OXY to submit the break testing plan in the APD or Sundry Notice (SN) and receive approval prior to implementing (See Appendix for examples)
- 2) OXY would perform BOP break testing on multi-well pads where multiple intermediate sections can be drilled and cased within the 30-day BOP test window
- 3) After performing a complete BOP test on the first well and drilling and casing the hole section, three breaks would be made on the BOP.
 - Between the check valve and the kill line
 - > Between the HCR valve and the co-flex hose or the co-flex hose and the manifold
 - Between the BOP flange and the wellhead
- 4) The BOP is then lifted and removed from the wellhead by the hydraulic winch system
- 5) After skidding to the next well, the BOP is moved to the wellhead by the hydraulic winch system and installed
- 6) The choke line and kill line are reconnected
- 7) A test plug is installed in the wellhead with a joint of drill pipe and the internal parts of the check valve are removed
- 8) A shell teit is performed against the upper pipe rams testing all thl-ee breaks
- 9) The internal parts of the check valve are reinstalled and the HCR valve is closed. A second test is performed on them
- 10) These tests consist of a 250 psi low test and a high test to the value submitted in the APD or SN (e.g., 5000 psi)
- 11) Perform a function test of components not pressure tested to include the lower pipe rams, the blind rams and the annular
- 12) If this were a three well pad, the same three breaks on the BOP would be made and steps 4 through 11 would be repeated
- 13) A second break test would only be done if the third hole section could be completed within the 30-day BOP test window
- 14) If a second break test is performed, additional components that were not tested on the initial break test will be tested on this break test

Notes:


- a. If any parts of the BOP are changed out or any additional breaks are made during the skidding operation, these affected components would also be tested as in step 10.
- b. As the choke manifold remains stationary during the skidding operation and the only break to the manifold is tested in step 8 above, no further testing of the manifold is done until the next full BOP test.

Summary

OXY requests a variance to allow break testing of the BOP stack when skidding drilling rigs between wells on multi-well pads. API standards, specifications and recommended practices are considered industry standards and are consistently utilized and referenced by the industry and the BLM. API Standard 53 recognizes break testing as an acceptable practice and BSEE adopted language from this standard into its newly created 30 CFR Part 250 which also supports break testing. Due to this, OXY feels this request meets the intent of 43 CFR part 3170

REQUEST FOR A VARIANCE TO BREAK TEST THE BOP

Permian Resources New Mexico

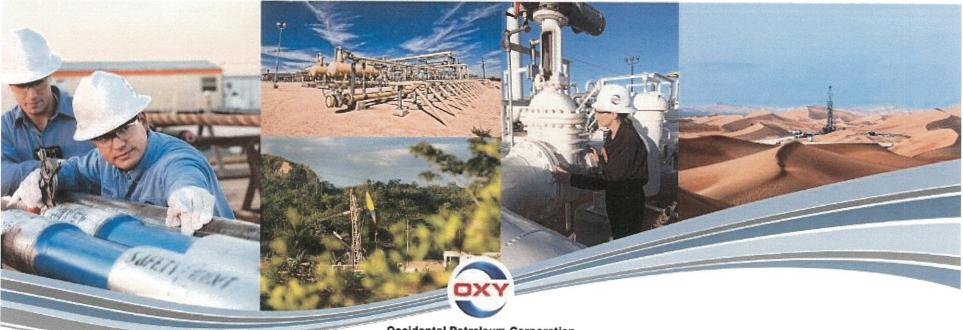

Occidental Petroleum Corporation

Request for Variance

Released to Imaging: 11/3/2024 2:23:00 PM

OXY USA Inc. (OXY) requests a variance to allow break testing of the Blowout Preventer (BOP) stack when skidding a drilling rig between wells on multi-well pads

- This practice entails retesting only the connections of the BOP stack that have been disconnected during this operation and not a complete BOP test.
- As the choke manifold remains stationary during the skidding operation and the only break to the manifold is tested, no further testing of the manifold is done until the next full BOP test.
- This request is being made as per Section IV of the Onshore Oil and Gas Order (OOGO) No. 2



American Petroleum Institute (API) standards, specifications and recommended practices are considered industry standards and are consistently utilized and referenced by the industry

- (Fourth Edition, November 2012, Addendum 1, July 2016) recognizes break API Standard 53, Blowout Prevention Equipment Systems for Drilling Wells testing as an acceptable practice. Ī
- Specifically, API Standard 53, Section 6.5.3.4.1.b states "Pressure tests on the well control equipment shall be conducted after the disconnection or repair of any pressure containment seal in the BOP stack, choke line, kill line, choke manifold, or wellhead assembly but limited to the affected component." I



Interior, has also utilized the API standards, specifications and best practices in the The Bureau of Safety and Environmental Enforcement (BSEE), Department of development of its offshore oil and gas regulations and incorporates them by reterence within its regulations.

- BSEE issued new offshore regulations in July 2016 under 30 CFR Part 250, Oil Preventer Systems and Well Control. Within these regulations is language and Gas and Sulphur Operations in the Outer Continental Shelf - Blowout adopted from API Standard 53 which also supports break testing. 1
- components following the disconnection or repair of any well-pressure Specifically, Section 250.737(d.8) states "Pressure test affected BOP containment seal in the wellhead or BOP stack assembly." Т

X

Break testing has been approved by the BLM in the past

- The Farmington Field Office approved a Sundry Notice (SN) to allow break testing in 2015 T
- This SN granted permission for the operator to break test when skidding its Aztec 1000 rig on multi-well pads I

Oxy feels break testing and our current procedures meet or exceed the intent of OOGO No. 2

- BOP shell and components such as the pipe rams and check valve get tested to As skidding operations take place within the 30-day full BOPE test window, the the full rated working pressure more often I
- Oxy's standard requires complete BOP tests more often than that of OOGO No. 2
- training is a vital part of well control, this procedure to simulate step one of the - Oxy performs a choke drill prior to drilling out every casing shoe. As a crew's Driller's Method exceeds the requirements of OOGO No. 2





X


•


- 8) A shell test is performed against the upper pipe rams testing all three breaks
- The internal parts of the check valve are reinstalled and the HCR valve is closed. A second test is performed on them
- 10)These tests consist of a 250 psi low test and a high test to the value submitted in the APD or SN (e.g., 5000 psi)
- 11) Perform a function test of components not pressure tested to include the lower pipe rams, the blind rams and the annular
- 12) If this were a three well pad, the same three breaks on the BOP would be made and steps 4 through 11 would be repeated
- 13) A second break test would only be done if the third hole section could be completed within the 30-day BOP test window
- 14) If a second break test is performed, additional components that were not tested on the first break test will be tested


K

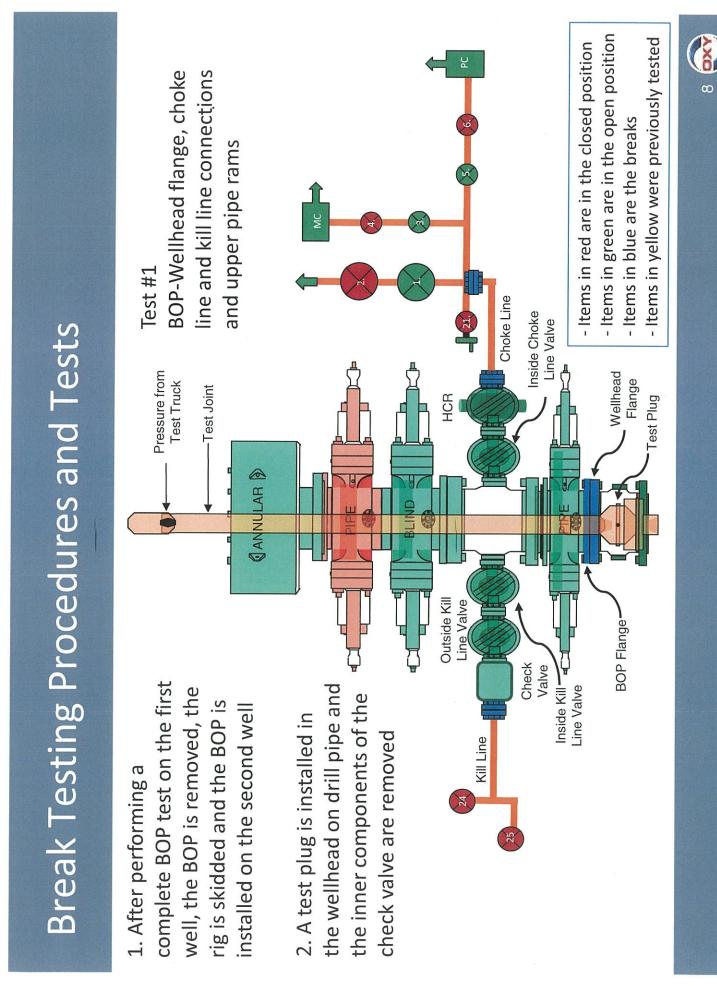

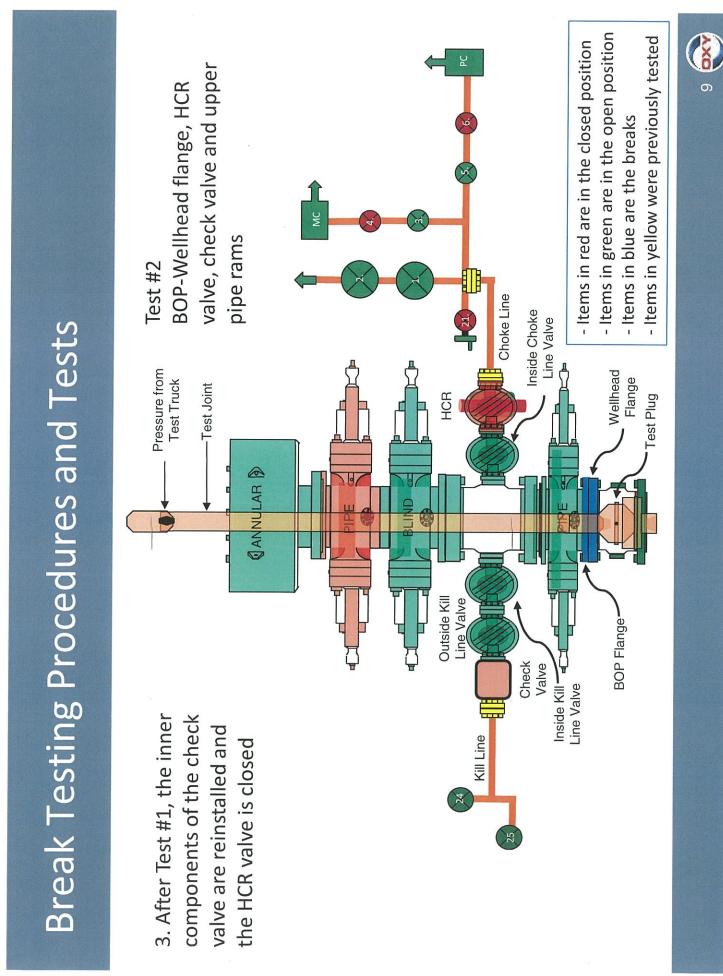

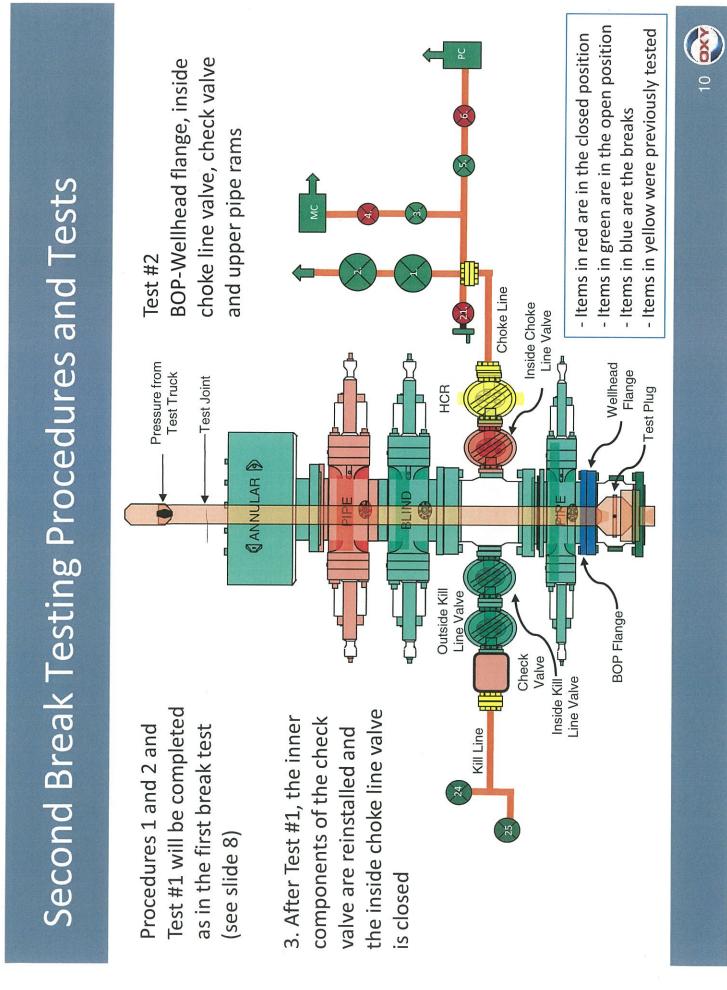

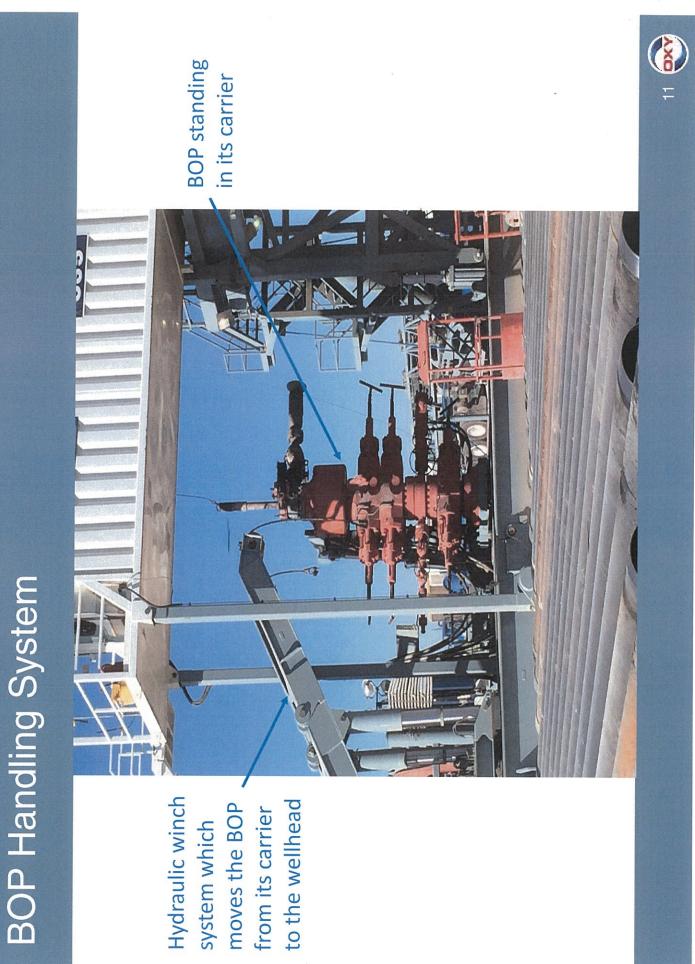

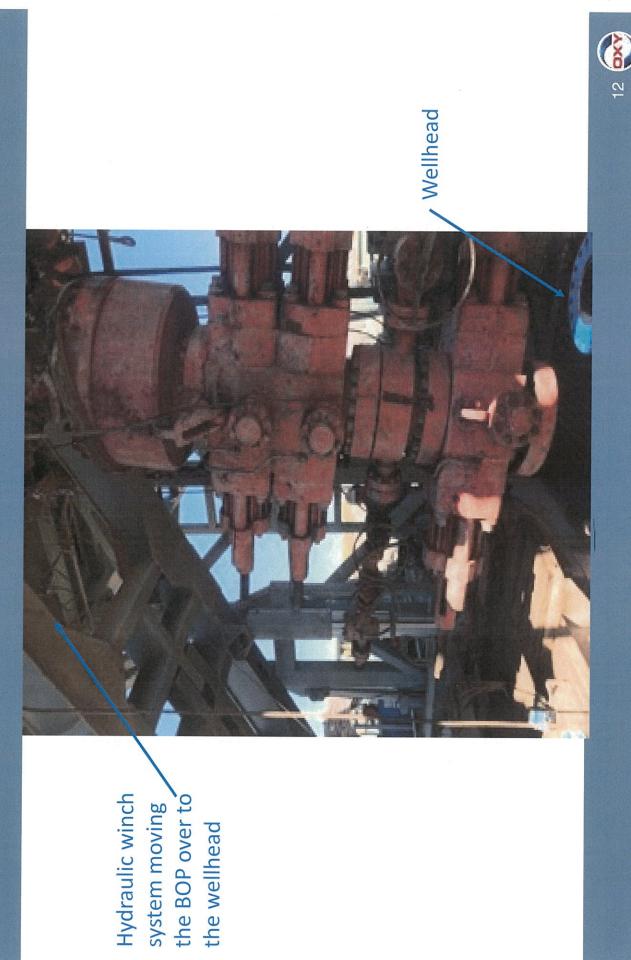

BOP Handling System

Released to Imaging: 11/3/2024 2:23:00 PM

XO

Bradenhead Cement CBL Variance Request

Oxy requests permission to adjust the CBL requirement after bradenhead cement jobs, on 7-5/8" intermediate casings, as per the agreement reached in the OXY/BLM meeting on September 5, 2019.

Three string wells:

- CBL will be required on one well per pad
- If the pumped volume of cement is less than permitted in the APD, BLM will be notified and a CBL may be run
- Echometer will be used after bradenhead cement job to determine TOC before pumping top-out cement

Four string wells:

- CBL is not required
- If the pumped volume of cement is less than permitted in the APD, BLM will be notified and a CBL may be run
- Echometer will be used after bradenhead cement job to determine TOC before pumping top-out cement

Offline Cementing Variance Request

Oxy requests a variance to cement the 9.625" and/or 7.625" intermediate casing strings offline in accordance to the approved variance, EC Tran 461365.

1. Cement Program

No changes to the cement program will take place for offline cementing.

2. Offline Cementing Procedure


The operational sequence will be as follows:

- 1. Run casing as per normal operations. While running casing, conduct negative pressure test and confirm integrity of the float equipment (float collar and shoe)
- 2. Land casing with mandrel
- 3. Fill pipe with kill weight fluid, do not circulate through floats and confirm well is static
- 4. Set annular packoff shown below and pressure test to confirm integrity of the seal. Pressure ratings of wellhead components and valves is 5,000 psi

Annular packoff with both external and internal seals



•

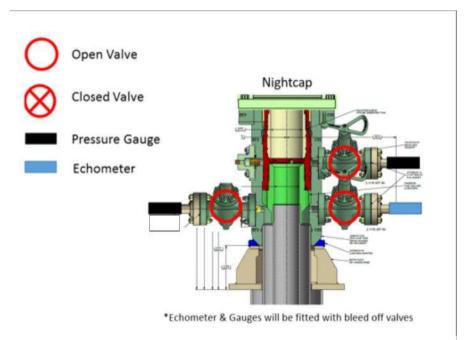


Wellhead diagram during skidding operations

5. After confirmation of both annular barriers and internal barriers, nipple down BOP and install cap flange.

a. If any barrier fails to test, the BOP stack will not be nippled down until after the cement job is completed with cement 500ft above the highest formation capable of flow with kill weight mud above or after it has achieved 50 psi compressive strength if cannot be verified.

- 6. Skid rig to next well on pad.
- 7. Confirm well is static before removing cap flange, flange will not be removed and offline cementing operations will not commence until well is under control. If well is not static, casing outlet valves will provide access to both the casing ID and annulus. Rig or third party pump truck will kill well prior to cementing or nippling up for further remediation.
 - a. Well Control Plan
 - i. The Drillers Method will be the primary well control method to regain control of the wellbore prior to cementing, if wellbore conditions do not permit the drillers method other methods of well control may be used
 - ii. Rig pumps or a 3^{rd} party pump will be tied into the upper casing valve to pump down the casing ID
 - iii. A high pressure return line will be rigged up to lower casing valve and run to choke manifold to control annular pressure
 - iv. Once influx is circulated out of the hole, kill weight mud will be circulated
 - v. Well will be confirmed static
 - vi. Once confirmed static, cap flange will be removed to allow for offline cementing operations to commence
- 8. Install offline cement tool
- 9. Rig up cement equipment

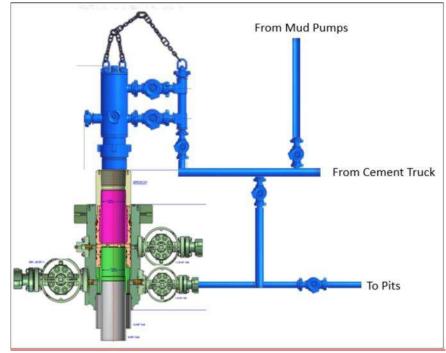

Wellhead diagram during offline cementing operations

- 10. Circulate bottoms up with cement truck
 - a. If gas is present on bottoms up, well will be shut in and returns rerouted through gas buster to handle entrained gas
 - b. Max anticipated time before circulating with cement truck is 6 hrs
- 11. Perform cement job taking returns from the annulus wellhead valve
- 12. Confirm well is static and floats are holding after cement job
- 13. Remove cement equipment, offline cement tools and install night cap with pressure gauge for monitoring.

OXY

PRD NM DIRECTIONAL PLANS (NAD 1983) Gold Log 4_9 Fed Com Gold Log 4_9 Fed Com 26H

Wellbore #1

Plan: Permitting Plan

Standard Planning Report

18 April, 2023

OXY Planning Report

Database: Company: Project: Site: Well: Wellbore: Design:	PRD N Gold I Gold I Wellbo	NEERING DE NM DIRECTIC .og 4_9 Fed C .og 4_9 Fed C	ONAL PLANS (Com	NAD 1983)	TVD Reference:HMD Reference:HNorth Reference:H			Well Gold Log 4_9 Fed Com 26H RKB=25' @ 3821.00ft RKB=25' @ 3821.00ft Grid Minimum Curvature		
Project	PRD N	M DIRECTION	NAL PLANS (N	NAD 1983)						
Map System: Geo Datum: Map Zone:	North Ar	e Plane 1983 nerican Datum kico Eastern Z			System Datum: Mean Sea Level Using geodetic scale factor					
Site	Gold L	og 4_9 Fed Co	om							
Site Position: From: Position Uncerta	Map ainty:	0.00 1	North Eastir t Slot F	•	741,6	08.71 usft 16.89 usft 3.200 in	Latitude: Longitude:			32.426249 -103.68423
Well	Gold Lo	g 4_9 Fed Co	om 26H							
Well Position Position Uncerta Grid Convergen	•	0.0	00 ft Ea	orthing: sting: ellhead Eleva	ation:	519,435.63 743,912.15	usf Lor	itude: ngitude: ound Level:		32.42628 -103.67679 3,796.00 ft
Wellbore	Wellbo	ore #1								
Magnetics	Мо	del Name	Sample	e Date	Declina (°)	tion	Dip A (°		Field Strer (nT)	igth
		HDGM_FILE	1	2/20/2022		6.38		60.10	47,747.4	000000
Design	Permitt	ing Plan								
Audit Notes:										
Version:			Phas	e: F	PROTOTYPE	Tie	e On Depth:		0.00	
Vertical Section	:	D	epth From (T (ft)	VD)	+N/-S (ft)	+E/-W (ft)		Direction (°) 171.52		
			0.00		0.00	0.	.00	17	1.52	
Plan Survey Too Depth From (ft)	n Depti (ft	n To) Survey	4/17/2023 7 (Wellbore) ing Plan (Well	bore #1)	Tool Name B001Mb_MWI		Remarks			
1 0.0	21,03				OWSG MWD	+ HRGM				
	0 21,03									
1 0.0	0 21,03									
1 0.0 Plan Sections Measured	iclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)	TFO (°)	Target
1 0.0 Plan Sections Measured Depth Ir (ft) 0.00	nclination (°) 0.00	(°) 0.00	Depth (ft) 0.00	(ft) 0.00	+ E/-W (ft) 0.00	Dogleg Rate (°/100ft) 0.00	Rate (°/100ft) 0.00	Rate (°/100ft) 0.00	(°) 0.00	Target
1 0.0 Plan Sections Measured Depth Ir (ft)	nclination (°)	(°)	Depth (ft)	(ft)	+E/-W (ft)	Dogleg Rate (°/100ft)	Rate (°/100ft)	Rate (°/100ft)	(°)	Target
1 0.0 Plan Sections Measured Depth (ft) Ir 0.00 2,620.00	iclination (°) 0.00 0.00	(°) 0.00 0.00	Depth (ft) 0.00 2,620.00	(ft) 0.00 0.00	+E/-W (ft) 0.00 0.00	Dogleg Rate (°/100ft) 0.00 0.00	Rate (°/100ft) 0.00 0.00	Rate (°/100ft) 0.00 0.00	(°) 0.00 0.00 49.82 0.00	Target

.

Database:	HOPSPP	Local Co-ordinate Reference:	Well Gold Log 4_9 Fed Com 26H
Company:	ENGINEERING DESIGNS	TVD Reference:	RKB=25' @ 3821.00ft
Project:	PRD NM DIRECTIONAL PLANS (NAD 1983)	MD Reference:	RKB=25' @ 3821.00ft
Site:	Gold Log 4_9 Fed Com	North Reference:	Grid
Well:	Gold Log 4_9 Fed Com 26H	Survey Calculation Method:	Minimum Curvature
Wellbore:	Wellbore #1		
Design:	Permitting Plan		

Measu Dep (ft)	oth	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
1	00.00	0.00	0.00	100.00	0.00	0.00	0.00	0.00	0.00	0.00
2	00.00	0.00	0.00	200.00	0.00	0.00	0.00	0.00	0.00	0.00
3	00.00	0.00	0.00	300.00	0.00	0.00	0.00	0.00	0.00	0.00
	00.00	0.00	0.00	400.00	0.00	0.00	0.00	0.00	0.00	0.00
	00.00	0.00	0.00	500.00	0.00		0.00	0.00	0.00	0.00
	00.00	0.00	0.00	600.00	0.00	0.00 0.00	0.00	0.00	0.00	0.00
	00.00	0.00	0.00	700.00	0.00	0.00	0.00	0.00	0.00	0.00
	00.00	0.00	0.00	800.00	0.00	0.00	0.00	0.00	0.00	0.00
	00.00	0.00	0.00	900.00	0.00	0.00	0.00	0.00	0.00	0.00
	00.00	0.00	0.00	1,000.00	0.00	0.00	0.00	0.00	0.00	0.00
	00.00	0.00	0.00	1,100.00	0.00	0.00	0.00	0.00	0.00	0.00
	00.00	0.00	0.00	1,200.00	0.00	0.00	0.00	0.00	0.00	0.00
	00.00	0.00	0.00	1,300.00	0.00	0.00	0.00	0.00	0.00	0.00
1,4	00.00	0.00	0.00	1,400.00	0.00	0.00	0.00	0.00	0.00	0.00
	00.00	0.00	0.00	1,500.00	0.00	0.00	0.00	0.00	0.00	0.00
1,6	00.00	0.00	0.00	1,600.00	0.00	0.00	0.00	0.00	0.00	0.00
1,7	00.00	0.00	0.00	1,700.00	0.00	0.00	0.00	0.00	0.00	0.00
1,8	00.00	0.00	0.00	1,800.00	0.00	0.00	0.00	0.00	0.00	0.00
1,9	00.00	0.00	0.00	1,900.00	0.00	0.00	0.00	0.00	0.00	0.00
2,0	00.00	0.00	0.00	2,000.00	0.00	0.00	0.00	0.00	0.00	0.00
2,1	00.00	0.00	0.00	2,100.00	0.00	0.00	0.00	0.00	0.00	0.00
2,2	00.00	0.00	0.00	2,200.00	0.00	0.00	0.00	0.00	0.00	0.00
2,3	00.00	0.00	0.00	2,300.00	0.00	0.00	0.00	0.00	0.00	0.00
2,4	00.00	0.00	0.00	2,400.00	0.00	0.00	0.00	0.00	0.00	0.00
2,5	00.00	0.00	0.00	2,500.00	0.00	0.00	0.00	0.00	0.00	0.00
2,6	00.00	0.00	0.00	2,600.00	0.00	0.00	0.00	0.00	0.00	0.00
	20.00	0.00	0.00	2,620.00	0.00	0.00	0.00	0.00	0.00	0.00
	00.00	0.80	49.82	2,700.00	0.36	0.43	-0.29	1.00	1.00	0.00
	00.00	1.80	49.82	2,799.97	1.82	2.16	-1.49	1.00	1.00	0.00
2.9	00.00	2.80	49.82	2,899.89	4.41	5.23	-3.59	1.00	1.00	0.00
	00.00	3.80	49.82	2,999.72	8.13	9.62	-6.62	1.00	1.00	0.00
· · · ·	00.00	4.80	49.82	3,099.44	12.96	15.35	-10.56	1.00	1.00	0.00
	00.00	5.80	49.82	3,199.01	18.92	22.41	-15.41	1.00	1.00	0.00
	00.00	6.80	49.82	3,298.40	26.00	30.79	-21.18	1.00	1.00	0.00
3 4	00.00	7.80	49.82	3,397.59	34.20	40.50	-27.85	1.00	1.00	0.00
	00.00	8.80	49.82	3,496.54	43.52	51.53	-35.44	1.00	1.00	0.00
	00.00	9.80	49.82	3,595.23	53.94	63.88	-43.93	1.00	1.00	0.00
	00.00	10.80	49.82	3,693.62	65.48	77.54	-53.33	1.00	1.00	0.00
	00.00	11.80	49.82	3,791.68	78.12	92.51	-63.62	1.00	1.00	0.00
3.9	00.00	12.80	49.82	3,889.38	91.86	108.78	-74.82	1.00	1.00	0.00
· · · · ·	00.00	13.80	49.82	3,986.70	106.71	126.36	-86.90	1.00	1.00	0.00
	19.98	14.00	49.82	4,006.09	109.80	130.03	-89.43	1.00	1.00	0.00
	00.00	14.00	49.82	4,083.73	122.29	144.82	-99.60	0.00	0.00	0.00
	00.00	14.00	49.82	4,180.76	137.90	163.30	-112.31	0.00	0.00	0.00
4.3	00.00	14.00	49.82	4,277.79	153.51	181.78	-125.02	0.00	0.00	0.00
, -	00.00	14.00	49.82	4,374.82	169.12	200.27	-137.73	0.00	0.00	0.00
	00.00	14.00	49.82	4.471.85	184.73	218.75	-150.44	0.00	0.00	0.00
	00.00	14.00	49.82	4,568.88	200.33	237.23	-163.16	0.00	0.00	0.00
	00.00	14.00	49.82	4,665.91	215.94	255.72	-175.87	0.00	0.00	0.00
4.8	00.00	14.00	49.82	4,762.94	231.55	274.20	-188.58	0.00	0.00	0.00
	00.00	14.00	49.82	4,859.97	247.16	292.68	-201.29	0.00	0.00	0.00
	00.00	14.00	49.82	4,957.00	262.77	311.17	-214.00	0.00	0.00	0.00
	00.00	14.00	49.82	5,054.03	278.37	329.65	-226.72	0.00	0.00	0.00
	00.00	14.00	49.82	5,151.06	293.98	348.13	-239.43	0.00	0.00	0.00
				.,						

Database:	HOPSPP	Local Co-ordinate Reference:	Well Gold Log 4_9 Fed Com 26H
Company:	ENGINEERING DESIGNS	TVD Reference:	RKB=25' @ 3821.00ft
Project:	PRD NM DIRECTIONAL PLANS (NAD 1983)	MD Reference:	RKB=25' @ 3821.00ft
Site:	Gold Log 4_9 Fed Com	North Reference:	Grid
Well:	Gold Log 4_9 Fed Com 26H	Survey Calculation Method:	Minimum Curvature
Wellbore:	Wellbore #1		
Design:	Permitting Plan		

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
5,300.00	14.00	49.82	5,248.09	309.59	366.62	-252.14	0.00	0.00	0.00
5,400.00	14.00	49.82	5,345.12	325.20	385.10	-264.85	0.00	0.00	0.00
5,500.00	14.00	49.82	5,442.15	340.81	403.58	-277.56	0.00	0.00	0.00
5,600.00	14.00	49.82	5,539.18	356.42	422.07	-290.27	0.00	0.00	0.00
5,700.00	14.00	49.82	5,636.21	372.02	440.55	-302.99	0.00	0.00	0.00
5,800.00 5,900.00	14.00 14.00	49.82 49.82	5,733.24 5,830.27	387.63 403.24	459.03 477.52	-315.70 -328.41	0.00 0.00	0.00 0.00	0.00 0.00
6,000.00	14.00	49.82	5,927.30	418.85	496.00	-341.12	0.00	0.00	0.00
6,100.00	14.00	49.82	6,024.33	434.46	514.48	-353.83	0.00	0.00	0.00
6,200.00	14.00	49.82	6,121.36	450.06	532.96	-366.54	0.00	0.00	0.00
6,300.00	14.00	49.82	6,218.39	465.67	551.45	-379.26	0.00	0.00	0.00
6,400.00	14.00	49.82	6,315.42	481.28	569.93	-391.97	0.00	0.00	0.00
6,500.00	14.00	49.82	6,412.45	496.89	588.41	-404.68	0.00	0.00	0.00
6,600.00	14.00	49.82	6,509.48	512.50	606.90	-417.39	0.00	0.00	0.00
6,700.00	14.00	49.82	6,606.51	528.10	625.38	-430.10	0.00	0.00	0.00
6,800.00	14.00	49.82	6,703.54	543.71	643.86	-442.81	0.00	0.00	0.00
6,900.00	14.00	49.82	6,800.57	559.32	662.35	-455.53	0.00	0.00	0.00
7,000.00	14.00	49.82	6,897.59	574.93	680.83	-468.24	0.00	0.00	0.00
7,100.00	14.00	49.82	6,994.62	590.54	699.31	-480.95	0.00	0.00	0.00
7,200.00	14.00	49.82	7,091.65	606.15	717.80	-493.66	0.00	0.00	0.00
7,300.00	14.00	49.82	7,188.68	621.75	736.28	-506.37	0.00	0.00	0.00
7,400.00	14.00	49.82	7,285.71	637.36	754.76	-519.08	0.00	0.00	0.00
7,500.00	14.00	49.82	7,382.74	652.97	773.25	-531.80	0.00	0.00	0.00
7,600.00	14.00	49.82	7,479.77	668.58	791.73	-544.51	0.00	0.00	0.00
7,700.00	14.00	49.82	7,576.80	684.19	810.21	-557.22	0.00	0.00	0.00
7,800.00	14.00	49.82	7,673.83	699.79	828.70	-569.93	0.00	0.00	0.00
7,900.00	14.00	49.82	7,770.86	715.40	847.18	-582.64	0.00	0.00	0.00
8,000.00	14.00	49.82	7,867.89	731.01	865.66	-595.35	0.00	0.00	0.00
8,100.00	14.00	49.82	7,964.92	746.62	884.14	-608.07	0.00	0.00	0.00
8,200.00	14.00	49.82	8,061.95	762.23	902.63	-620.78	0.00	0.00	0.00
8,300.00	14.00	49.82	8,158.98	777.84	921.11	-633.49	0.00	0.00	0.00
8,400.00	14.00	49.82	8,256.01	793.44	939.59	-646.20	0.00	0.00	0.00
8,500.00	14.00	49.82	8,353.04	809.05	958.08	-658.91	0.00	0.00	0.00
8,600.00	14.00	49.82	8,450.07	824.66	976.56	-671.62	0.00	0.00	0.00
8,700.00	14.00	49.82	8,547.10	840.27	995.04	-684.34	0.00	0.00	0.00
8,800.00	14.00	49.82	8,644.13	855.88	1,013.53	-697.05	0.00	0.00	0.00
8,900.00	14.00	49.82	8,741.16	871.48	1,032.01	-709.76	0.00	0.00	0.00
9,000.00	14.00	49.82	8,838.19	887.09	1,050.49	-722.47	0.00	0.00	0.00
9,100.00	14.00	49.82	8,935.22	902.70	1,068.98	-735.18	0.00	0.00	0.00
9,200.00	14.00	49.82	9,032.25	918.31	1,087.46	-747.89	0.00	0.00	0.00
9.300.00	14.00	49.82	9,129.28	933.92	1,105.94	-760.61	0.00	0.00	0.00
9,400.00	14.00	49.82	9,226.31	949.53	1,124.43	-773.32	0.00	0.00	0.00
9,500.00	14.00	49.82	9,323.34	965.13	1,142.91	-786.03	0.00	0.00	0.00
9,600.00	14.00	49.82	9,420.37	980.74	1,161.39	-798.74	0.00	0.00	0.00
9,700.00	14.00	49.82	9,517.40	996.35	1,179.88	-811.45	0.00	0.00	0.00
9,800.00	14.00	49.82	9,614.43	1,011.96	1,198.36	-824.17	0.00	0.00	0.00
9,900.00	14.00	49.82	9,711.46	1,027.57	1,216.84	-836.88	0.00	0.00	0.00
10,000.00	14.00	49.82	9,808.49	1,043.17	1,235.32	-849.59	0.00	0.00	0.00
10,100.00	14.00	49.82	9,905.51	1,058.78	1,253.81	-862.30	0.00	0.00	0.00
10,200.00	14.00	49.82	10,002.54	1,074.39	1,272.29	-875.01	0.00	0.00	0.00
10,218.97	14.00	49.82	10,020.95	1,077.35	1,275.80	-877.42	0.00	0.00	0.00
10,250.00	12.28	61.22	10,051.17	1,081.36	1,281.56	-880.54	10.00	-5.55	36.74
10,300.00	10.86	85.34	10,100.18	1,084.31	1,290.92	-882.07	10.00	-2.84	48.24
10,350.00	11.59	110.96	10,149.26	1,082.89	1,300.31	-879.29	10.00	1.47	51.24
10,400.00	14.16	130.42	10,198.02	1,077.13	1,309.66	-872.21	10.00	5.12	38.91

Database:	HOPSPP	Local Co-ordinate Reference:	Well Gold Log 4_9 Fed Com 26H
Company:	ENGINEERING DESIGNS	TVD Reference:	RKB=25' @ 3821.00ft
Project:	PRD NM DIRECTIONAL PLANS (NAD 1983)	MD Reference:	RKB=25' @ 3821.00ft
Site:	Gold Log 4_9 Fed Com	North Reference:	Grid
Well:	Gold Log 4_9 Fed Com 26H	Survey Calculation Method:	Minimum Curvature
Wellbore:	Wellbore #1		
Design:	Permitting Plan		

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
10,450.00	17.77	143.09	10,246.10	1,067.05	1,318.91	-860.88	10.00	7.23	25.34
10,500.00	21.92	151.35	10,293.13	1,052.76	1,327.97	-845.40	10.00	8.30	16.53
10,550.00	26.35	157.02	10,338.75	1,034.34	1,336.78	-825.88	10.00	8.87	11.34
10,600.00	30.95	161.13	10,382.62	1,011.94	1,345.28	-802.48	10.00	9.19	8.22
10,650.00	35.65	164.26	10,424.40	985.73	1,353.39	-775.36	10.00	9.39	6.26
10,700.00	40.41 45.21	166.75 168.79	10,463.78 10,500.45	955.91 922.71	1,361.06 1,368.23	-744.74 -710.84	10.00 10.00	9.52 9.61	4.97 4.08
10,750.00									
10,800.00	50.05	170.51	10,534.13	886.38	1,374.85	-673.93	10.00	9.67	3.45
10,850.00	54.91	172.01	10,564.58	847.20	1,380.85	-634.29	10.00	9.71	2.99
10,900.00	59.78	173.33	10,591.55	805.46	1,386.21	-592.22	10.00	9.75	2.65
10,950.00	64.67	174.53	10,614.85	761.48	1,390.87	-548.03	10.00	9.77	2.40
11,000.00	69.56	175.64	10,634.29	715.60	1,394.81	-502.07	10.00	9.79	2.22
11,050.00	74.46	176.68	10,649.72	668.16	1,397.98	-454.69	10.00	9.80	2.08
11,100.00	79.37	177.67	10,661.04	619.53	1,400.38	-406.24	10.00	9.81	1.98
11,150.00	84.28	178.63	10,668.15	570.08	1,401.97	-357.09	10.00	9.82	1.92
11,200.43	89.23	179.58	10,671.00	519.75	1,402.75	-307.20	10.00	9.82	1.89
11,300.00	89.23	179.58	10,672.34	420.20	1,403.48	-208.63	0.00	0.00	0.00
11,400.00	89.23	179.58	10,673.68	320.21	1,404.21	-109.62	0.00	0.00	0.00
11,500.00	89.23	179.58	10,675.02	220.22	1,404.94	-10.62	0.00	0.00	0.00
11,600.00	89.23	179.58	10,676.36	120.23	1,405.67	88.38	0.00	0.00	0.00
11,700.00	89.23	179.58	10,677.70	20.25	1,406.40	187.38	0.00	0.00	0.00
11,800.00	89.23	179.58	10,679.04	-79.74	1,407.13	286.39	0.00	0.00	0.00
11,900.00	89.23	179.58	10,680.38	-179.73	1,407.85	385.39	0.00	0.00	0.00
12,000.00	89.23	179.58	10,681.72	-279.72	1,408.58	484.39	0.00	0.00	0.00
12,100.00	89.23	179.58	10,683.06	-379.71	1,409.31	583.39	0.00	0.00	0.00
,			10,684.41	-479.70					
12,200.00	89.23	179.58			1,410.04	682.40 781.40	0.00	0.00 0.00	0.00
12,300.00	89.23	179.58	10,685.75	-579.68	1,410.77		0.00		0.00
12,400.00	89.23	179.58	10,687.09	-679.67	1,411.50	880.40	0.00	0.00	0.00
12,500.00 12,600.00	89.23 89.23	179.58 179.58	10,688.43 10,689.77	-779.66 -879.65	1,412.23 1,412.96	979.40 1,078.41	0.00 0.00	0.00 0.00	0.00 0.00
12,700.00	89.23	179.58	10,691.11	-979.64	1,413.69	1,177.41	0.00	0.00	0.00
12,800.00	89.23	179.58	10,692.45	-1,079.63	1,414.42	1,276.41	0.00	0.00	0.00
12,900.00	89.23	179.58	10,693.79	-1,179.61	1,415.14	1,375.42	0.00	0.00	0.00
13,000.00	89.23	179.58	10,695.13	-1,279.60	1,415.87	1,474.42	0.00	0.00	0.00
13,100.00	89.23	179.58	10,696.48	-1,379.59	1,416.60	1,573.42	0.00	0.00	0.00
13,200.00	89.23	179.58	10,697.82	-1,479.58	1,417.33	1,672.42	0.00	0.00	0.00
13,300.00	89.23	179.58	10,699.16	-1,579.57	1,418.06	1,771.43	0.00	0.00	0.00
13,400.00	89.23	179.58	10,700.50	-1,679.56	1,418.79	1,870.43	0.00	0.00	0.00
13,500.00	89.23	179.58	10,701.84	-1,779.54	1,419.52	1,969.43	0.00	0.00	0.00
13,600.00	89.23	179.58	10,703.18	-1,879.53	1,420.25	2,068.43	0.00	0.00	0.00
13,700.00	89.23	179.58	10,704.52	-1,979.52	1,420.98	2,167.44	0.00	0.00	0.00
13,800.00	89.23	179.58	10,705.86	-2,079.51	1,421.71	2,266.44	0.00	0.00	0.00
13,900.00	89.23	179.58	10,707.20	-2,179.50	1,422.43	2,365.44	0.00	0.00	0.00
14,000.00	89.23	179.58	10,708.55	-2,279.49	1,423.16	2,464.44	0.00	0.00	0.00
14,100.00	89.23	179.58	10,709.89	-2,379.47	1,423.89	2,563.45	0.00	0.00	0.00
14,200.00	89.23	179.58	10,711.23	-2,479.46	1,424.62	2,662.45	0.00	0.00	0.00
14,300.00	89.23	179.58	10,712.57	-2,579.45	1,425.35	2,761.45	0.00	0.00	0.00
14,400.00	89.23	179.58	10,713.91	-2,679.44	1,426.08	2,860.45	0.00	0.00	0.00
14,500.00	89.23	179.58	10,715.25	-2,779.43	1,426.81	2,959.46	0.00	0.00	0.00
14,600.00	89.23	179.58	10,716.59	-2,879.42	1,427.54	3,058.46	0.00	0.00	0.00
14,700.00	89.23	179.58	10,717.93	-2,979.40	1,428.27	3,157.46	0.00	0.00	0.00
14,800.00	89.23	179.58	10,719.27	-3,079.39	1,429.00	3,256.46	0.00	0.00	0.00
14,900.00	89.23	179.58	10,720.62	-3,179.38	1,429.72	3,355.47	0.00	0.00	0.00
15,000.00	89.23	179.58	10,721.96	-3,279.37	1,430.45	3,454.47	0.00	0.00	0.00
15,100.00	89.23	179.58	10,723.30	-3,379.36	1,431.18	3,553.47	0.00	0.00	0.00
	0		.,	-,	, =	-,			

Database:	HOPSPP	Local Co-ordinate Reference:	Well Gold Log 4_9 Fed Com 26H
Company:	ENGINEERING DESIGNS	TVD Reference:	RKB=25' @ 3821.00ft
Project:	PRD NM DIRECTIONAL PLANS (NAD 1983)	MD Reference:	RKB=25' @ 3821.00ft
Site:	Gold Log 4_9 Fed Com	North Reference:	Grid
Well:	Gold Log 4_9 Fed Com 26H	Survey Calculation Method:	Minimum Curvature
Wellbore:	Wellbore #1		
Design:	Permitting Plan		

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
15,200.00 15,300.00 15,400.00 15,500.00	89.23 89.23 89.23 89.23	179.58 179.58 179.58 179.58 179.58	10,724.64 10,725.98 10,727.32 10,728.66	-3,479.35 -3,579.34 -3,679.32 -3,779.31	1,431.91 1,432.64 1,433.37 1,434.10	3,652.47 3,751.48 3,850.48 3.949.48	0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00
15,600.00	89.23 89.23	179.58 179.58	10,730.00 10,731.34	-3,879.30 -3,979.29	1,434.83 1,435.56	4,048.48 4,147.49	0.00	0.00	0.00 0.00
15,800.00 15,900.00 16,000.00 16,100.00	89.23 89.23 89.23 89.23	179.58 179.58 179.58 179.58	10,732.69 10,734.03 10,735.37 10,736.71	-4,079.28 -4,179.27 -4,279.25 -4,379.24	1,436.29 1,437.02 1,437.74 1,438.47	4,246.49 4,345.49 4,444.49 4,543.50	0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00
16,200.00 16,300.00	89.23 89.23	179.58 179.58	10,738.05 10,739.39	-4,479.23 -4,579.22	1,439.20 1,439.93	4,642.50 4,741.50	0.00 0.00	0.00 0.00	0.00 0.00
16,400.00 16,500.00 16,600.00	89.23 89.23 89.23	179.58 179.58 179.58	10,740.73 10,742.07 10,743.41	-4,679.21 -4,779.20 -4,879.18	1,440.66 1,441.39 1,442.12	4,840.50 4,939.51 5,038.51	0.00 0.00 0.00	0.00 0.00 0.00	0.00 0.00 0.00
16,700.00 16,800.00 16,900.00	89.23 89.23 89.23	179.58 179.58 179.58	10,744.76 10,746.10 10,747.44	-4,979.17 -5,079.16 -5,179.15	1,442.85 1,443.58 1,444.31	5,137.51 5,236.52 5,335.52	0.00 0.00 0.00	0.00 0.00 0.00	0.00 0.00 0.00
17,000.00 17,100.00 17,200.00	89.23 89.23 89.23	179.58 179.58 179.58	10,748.78 10,750.12 10,751.46	-5,279.14 -5,379.13 -5,479.11	1,445.03 1,445.76 1,446.49	5,434.52 5,533.52 5,632.53	0.00 0.00 0.00	0.00 0.00 0.00	0.00 0.00 0.00
17,300.00 17,400.00 17,500.00 17,600.00	89.23 89.23 89.23 89.23 89.23	179.58 179.58 179.58 179.58 179.58	10,752.80 10,754.14 10,755.48 10,756.83	-5,579.10 -5,679.09 -5,779.08 -5,879.07	1,447.22 1,447.95 1,448.68 1,449.41	5,731.53 5,830.53 5,929.53 6,028.54	0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00
17,700.00 17,800.00 17,900.00	89.23 89.23 89.23	179.58 179.58 179.58 179.58	10,758.17 10,759.51 10,760.85	-5,979.06 -6,079.04 -6,179.03	1,450.14 1,450.87 1,451.60	6,127.54 6,226.54 6,325.54	0.00 0.00 0.00	0.00 0.00 0.00	0.00 0.00 0.00 0.00
18,000.00 18,100.00	89.23 89.23	179.58 179.58	10,762.19 10,763.53	-6,279.02 -6,379.01	1,452.32 1,453.05	6,424.55 6,523.55	0.00 0.00	0.00 0.00	0.00 0.00
18,200.00 18,300.00 18,400.00 18,500.00 18,600.00	89.23 89.23 89.23 89.23 89.23	179.58 179.58 179.58 179.58 179.58	10,764.87 10,766.21 10,767.55 10,768.89 10,770.24	-6,479.00 -6,578.99 -6,678.97 -6,778.96 -6,878.95	1,453.78 1,454.51 1,455.24 1,455.97 1,456.70	6,622.55 6,721.55 6,820.56 6,919.56 7,018.56	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00
18,700.00 18,800.00 18,900.00 19,000.00 19,100.00	89.23 89.23 89.23 89.23 89.23 89.23	179.58 179.58 179.58 179.58 179.58 179.58	10,771.58 10,772.92 10,774.26 10,775.60 10,776.94	-6,978.94 -7,078.93 -7,178.92 -7,278.90 -7,378.89	1,457.43 1,458.16 1,458.89 1,459.61 1,460.34	7,117.56 7,216.57 7,315.57 7,414.57 7,513.57	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00
19,200.00 19,300.00 19,400.00 19,500.00 19,600.00	89.23 89.23 89.23 89.23 89.23	179.58 179.58 179.58 179.58 179.58 179.58	10,778.28 10,779.62 10,780.96 10,782.31 10,783.65	-7,478.88 -7,578.87 -7,678.86 -7,778.85 -7,878.83	1,461.07 1,461.80 1,462.53 1,463.26 1,463.99	7,612.58 7,711.58 7,810.58 7,909.58 8,008.59	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00
19,700.00 19,800.00 19,900.00 20,000.00 20,100.00	89.23 89.23 89.23 89.23 89.23 89.23	179.58 179.58 179.58 179.58 179.58 179.58	10,784.99 10,786.33 10,787.67 10,789.01 10,790.35	-7,978.82 -8,078.81 -8,178.80 -8,278.79 -8,378.78	1,464.72 1,465.45 1,466.18 1,466.90 1,467.63	8,107.59 8,206.59 8,305.59 8,404.60 8,503.60	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00
20,200.00 20,300.00 20,400.00 20,500.00 20,600.00	89.23 89.23 89.23 89.23 89.23 89.23	179.58 179.58 179.58 179.58 179.58 179.58	10,791.69 10,793.03 10,794.38 10,795.72 10,797.06	-8,478.76 -8,578.75 -8,678.74 -8,778.73 -8,878.72	1,468.36 1,469.09 1,469.82 1,470.55 1,471.28	8,602.60 8,701.61 8,800.61 8,899.61 8,998.61	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00

Database:	HOPSPP	Local Co-ordinate Reference:	Well Gold Log 4_9 Fed Com 26H
Company:	ENGINEERING DESIGNS	TVD Reference:	RKB=25' @ 3821.00ft
Project:	PRD NM DIRECTIONAL PLANS (NAD 1983)	MD Reference:	RKB=25' @ 3821.00ft
Site:	Gold Log 4_9 Fed Com	North Reference:	Grid
Well:	Gold Log 4_9 Fed Com 26H	Survey Calculation Method:	Minimum Curvature
Wellbore:	Wellbore #1		
Design:	Permitting Plan		

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
20,700.00	89.23	179.58	10,798.40	-8,978.71	1,472.01	9,097.62	0.00	0.00	0.00
20,800.00	89.23	179.58	10,799.74	-9,078.69	1,472.74	9,196.62	0.00	0.00	0.00
20,900.00	89.23	179.58	10,801.08	-9,178.68	1,473.47	9,295.62	0.00	0.00	0.00
21,000.00	89.23	179.58	10,802.42	-9,278.67	1,474.20	9,394.62	0.00	0.00	0.00
21,100.00	89.23	179.58	10,803.76	-9,378.66	1,474.92	9,493.63	0.00	0.00	0.00
21,200.00	89.23	179.58	10,805.10	-9,478.65	1,475.65	9,592.63	0.00	0.00	0.00
21,300.00	89.23	179.58	10,806.45	-9,578.64	1,476.38	9,691.63	0.00	0.00	0.00
21,400.00	89.23	179.58	10,807.79	-9,678.62	1,477.11	9,790.63	0.00	0.00	0.00
21,500.00	89.23	179.58	10,809.13	-9,778.61	1,477.84	9,889.64	0.00	0.00	0.00
21,600.00	89.23	179.58	10,810.47	-9,878.60	1,478.57	9,988.64	0.00	0.00	0.00
21,639.60	89.23	179.58	10,811.00	-9,918.20	1,478.86	10,027.84	0.00	0.00	0.00

Design Targets


Target Name - hit/miss target - Shape	Dip Angle (°)	Dip Dir. (°)	TVD (ft)	+N/-S (ft)	+E/-W (ft)	Northing (usft)	Easting (usft)	Latitude	Longitude
FTP (Gold Log 4_9 - plan hits target cer - Point	0.00 nter	0.00	10,671.00	519.75	1,402.75	519,955.36	745,314.84	32.427689	-103.672236
BHL (Gold Log 4_9 - plan hits target cer - Point	0.00 nter	0.01	10,811.00	-9,918.20	1,478.86	509,517.89	745,390.94	32.398999	-103.672199

Formations

Measured Depth (ft)	Vertical Depth (ft)	Name	Lithology	Dip (°)	Dip Direction (°)
983.00	983.00	RUSTLER			
1,153.00	1,153.00	SALADO			
2,632.00	2,632.00	CASTILE			
4,878.39	4,839.00	DELAWARE			
4,987.63	4,945.00	BELL CANYON			
5,845.10	5,777.00	CHERRY CANYON			
7,089.05	6,984.00	BRUSHY CANYON			
9,001.87	8,840.00	BONE SPRING			
10,060.31	9,867.00	BONE SPRING 1ST			
10,723.00	10,481.00	BONE SPRING 2ND			
	Depth (ft) 983.00 1,153.00 2,632.00 4,878.39 4,987.63 5,845.10 7,089.05 9,001.87 10,060.31	Depth (ft)Depth (ft)983.00983.001,153.001,153.002,632.002,632.004,878.394,839.004,987.634,945.005,845.105,777.007,089.056,984.009,001.878,840.0010,060.319,867.00	Depth (ft)Depth (ft)Name983.00983.00RUSTLER1,153.001,153.00SALADO2,632.002,632.00CASTILE4,878.394,839.00DELAWARE4,987.634,945.00BELL CANYON5,845.105,777.00CHERRY CANYON7,089.056,984.00BRUSHY CANYON9,001.878,840.00BONE SPRING10,060.319,867.00BONE SPRING 1ST	Depth (ft) Depth (ft) Depth (ft) Lithology 983.00 983.00 RUSTLER Lithology 1,153.00 1,153.00 SALADO SALADO 2,632.00 2,632.00 CASTILE SALADO 4,878.39 4,839.00 DELAWARE SALADO 4,987.63 4,945.00 BELL CANYON SALADO 5,845.10 5,777.00 CHERRY CANYON SALADO 9,001.87 8,840.00 BONE SPRING Interval of the second sec	Depth (ft) Depth (ft) Depth (ft) Depth Name Dip Lithology Dip (°) 983.00 983.00 RUSTLER Lithology '' '' 983.00 1,153.00 SALADO ' '' '' '' 2,632.00 2,632.00 CASTILE ' '' '' '' 4,878.39 4,839.00 DELAWARE ' '' '' '' 4,987.63 4,945.00 BELL CANYON ' '' '' '' 5,845.10 5,777.00 CHERRY CANYON ' '' '' '' 9,001.87 8,840.00 BONE SPRING ' '' '' 10,060.31 9,867.00 BONE SPRING 1ST '' '' ''

Plan Annotations

Measured	Vertical	Local Coordinates		
Depth (ft)	Depth (ft)	+N/-S (ft)	+E/-W (ft)	Comment
2,620.00	2,620.00	0.00	0.00	Build 1°/100'
4,019.98	4,006.09	109.80	130.03	Hold 14°
10,218.97	10,020.95	1,077.35	1,275.80	KOP, Build & Turn 10°/100'
11,200.43	10,671.00	519.76	1,402.75	Landing Point
21,639.60	10,811.00	-9,918.20	1,478.86	TD at 21639.60' MD

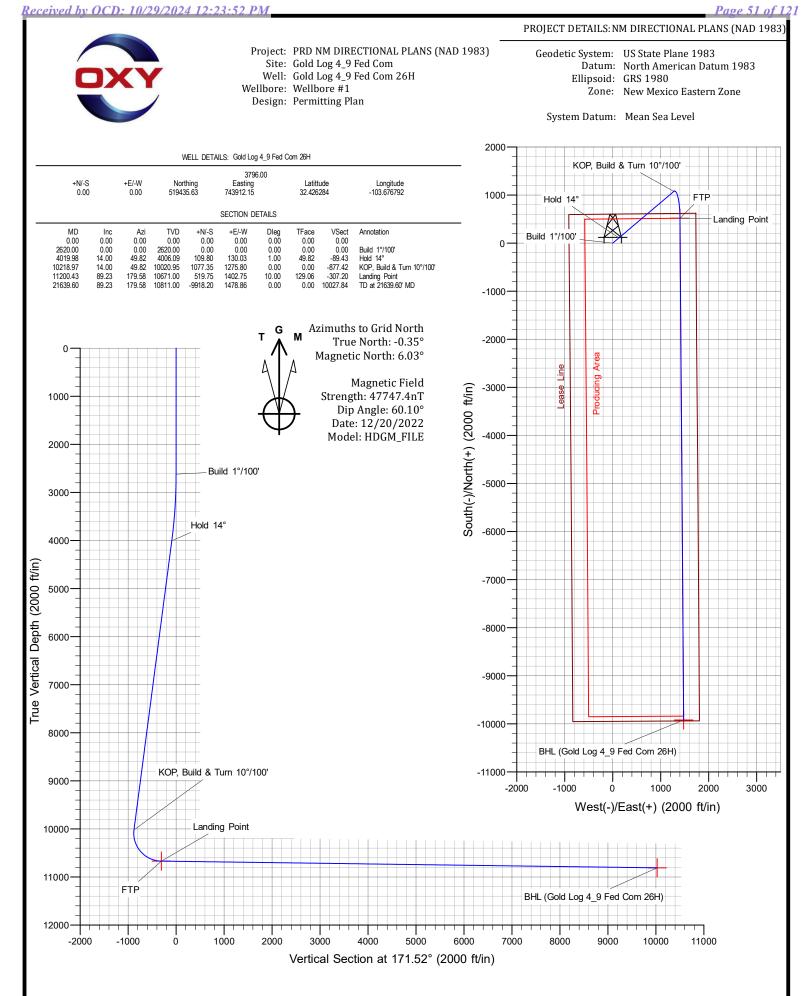

PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

OPERATOR'S NAME:	OXY USA INCORPORATED
WELL NAME & NO.:	GOLD LOG 4 9 FED COM 26H
LOCATION:	Section 4, T.22 S., R.32 E.
COUNTY:	Lea County, New Mexico

COA

H2S	• Yes	O No	
Potash	O None	Secretary	© R-111-P
Cave/Karst Potential	• Low	O Medium	O High
Cave/Karst Potential	Critical		
Variance	O None	• Flex Hose	O Other
Wellhead	Conventional	Multibowl	O Both
Wellhead Variance	O Diverter		
Other	\Box 4 String	Capitan Reef	□ WIPP
Other	□ Fluid Filled	🗆 Pilot Hole	□ Open Annulus
Cementing	□ Contingency	EchoMeter	Primary Cement
	Cement Squeeze		Squeeze
Special Requirements	🗆 Water Disposal	COM	🗆 Unit
Special Requirements	□ Batch Sundry		
Special Requirements	Break Testing	☑ Offline	\Box Casing
Variance		Cementing	Clearance

A. HYDROGEN SULFIDE

A Hydrogen Sulfide (H2S) Drilling Plan shall be activated AT SPUD. As a result, the Hydrogen Sulfide area must meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, please provide measured values and formations to the BLM.

B. CASING

Primary Casing Design:

- 1. The **10-3/4** inch surface casing shall be set at approximately **1042** feet (a minimum of 25 feet (Lea County) into the Rustler Anhydrite, above the salt, and below usable fresh water) and cemented to the surface.
 - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature

Page 1 of 8

survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.

- b. Wait on cement (WOC) time for a primary cement job will be a minimum of <u>24 hours in the Potash Area</u> or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
- c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
- d. If cement falls back, remedial cementing will be done prior to drilling out that string.
- The 7-5/8 inch intermediate casing shall be set at approximately 10,119 feet. KEEP CASING 1/2 FULL FOR COLLAPSE SF. PRESSURE TEST NEEDS EXTERNAL PRESSURE REVIEW AS WELL. The minimum required fill of cement behind the 7-5/8 inch intermediate casing is:

Option 1 (Single Stage):

• Cement to surface. If cement does not circulate see B.1.a, c-d above.

Operator has proposed to cement in two stages by conventionally cementing the first stage and performing a bradenhead squeeze on the second stage, contingent upon no returns to surface.

- a. First stage: Operator will cement with intent to reach the top of the **Brushy** Canyon
- b. Second stage:
 - Operator will perform bradenhead squeeze and top-out. Cement to surface. If cement does not reach surface, the appropriate BLM office shall be notified
- In <u>Secretary Potash Areas</u> if cement does not circulate to surface on the first two casing strings, the cement on the 3rd casing string must come to surface.

Operator has proposed to pump down 10-3/4" X 7-5/8" annulus. <u>Operator must top</u> <u>out cement after the bradenhead squeeze and verify cement to surface. Operator</u> <u>can also check TOC with Echo-meter. CBL must be run from TD of the 7-5/8"</u> <u>casing to surface if confidence is lacking on the quality of the bradenhead squeeze</u> <u>cement job. Submit results to BLM.</u> <u>If cement does not tie-back into the previous casing shoe, a third stage remediation</u> <u>BH may be performed. The appropriate BLM office shall be notified.</u>

Bradenhead squeeze in the production interval is only as an edge case remediation measure and is NOT approved in this COA. If production cement job experiences losses and a bradenhead squeeze is needed for tie-back, BLM Engineering should be notified prior to job with volumes and planned wellbore schematic. CBL will be needed when this occurs.

3. The **5-1**/2 inch production casing shall be set at approximately **21,640** feet. The minimum required fill of cement behind the **5-1**/2 inch production casing is:

Option 1 (Single Stage):

• Cement should tie-back at least **500 feet** into previous casing string. Operator shall provide method of verification.

C. PRESSURE CONTROL

- 1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'
- Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi. Variance is approved to use a 5000 (5M) Annular which shall be tested to 3500 (70% Working Pressure) psi.
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
 - e. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.

D. SPECIAL REQUIREMENT (S)

Communitization Agreement

• The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated

Page 3 of 8

date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.

- The operator will submit an as-drilled survey well plat of the well completion, but are not limited to, those specified in Onshore Order 1 and 2.
- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. <u>When the Communitization Agreement number is known, it shall also be on the sign.</u>

(Note: For a minimum 5M BOPE or less (Utilizing a 10M BOPE system) BOPE Break Testing Variance

- BOPE Break Testing is ONLY permitted for 5M BOPE or less. (Annular preventer must be tested to a minimum of 70% of BOPE working pressure and shall be higher than the MASP)
- BOPE Break Testing is NOT permitted to drilling the production hole section.
- Variance only pertains to the intermediate hole-sections and no deeper than the Bone Springs formation.
- While in transfer between wells, the BOPE shall be secured by the hydraulic carrier or cradle.
- Any well control event while drilling require notification to the BLM Petroleum Engineer (**575-706-2779**) prior to the commencement of any BOPE Break Testing operations.
- A full BOPE test is required prior to drilling the first deep intermediate hole section. If any subsequent hole interval is deeper than the first, a full BOPE test will be required. (200' TVD tolerance between intermediate shoes is allowable).
- The BLM is to be contacted (575-361-2822 Eddy County) 4 hours prior to BOPE tests.
- As a minimum, a full BOPE test shall be performed at 21-day intervals.
- In the event any repairs or replacement of the BOPE is required, the BOPE shall test as per Onshore Oil and Gas Order No. 2.
- If in the event break testing is not utilized, then a full BOPE test would be conducted.

Offline Cementing

Offline cementing OK for surface and intermediate intervals. Notify the BLM prior to the commencement of any offline cementing procedure.

GENERAL REQUIREMENTS

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)

Contact Eddy County Petroleum Engineering Inspection Staff:

Email or call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220; **BLM NM CFO DrillingNotifications@BLM.GOV**; (575) 361-2822

Contact Lea County Petroleum Engineering Inspection Staff:

Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575) 689-5981

1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.

a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).

b. When the operator proposes to set surface casing with Spudder Rig

- i.Notify the BLM when moving in and removing the Spudder Rig.
- ii.Notify the BLM when moving in the 2nd Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
- iii.BOP/BOPE test to be conducted per **43** CFR **3172** as soon as 2^{nd} Rig is rigged up on well.

2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this

does not include the dog house or stairway area.

3. For intervals in which cement to surface is required, cement to surface should be verified with a visual check and density or pH check to differentiate cement from spacer and drilling mud. The results should be documented in the driller's log and daily reports.

A. CASING

1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.

2. <u>Wait on cement (WOC) for Potash Areas:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until

Page 5 of 8

both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends of both lead and tail cement, 2) until cement has been in place at least <u>8 hours</u>. WOC time will be recorded in the driller's log. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.

3. <u>Wait on cement (WOC) for Water Basin:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least <u>8 hours</u>. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.

4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.

5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.

6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.

7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.

8. Whenever a casing string is cemented in the R-111-Q potash area, the NMOCD requirements shall be followed.

B. PRESSURE CONTROL

1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in **43 CFR 3172**.

2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.

3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.

4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:

- i.Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
- ii.If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- iii.Manufacturer representative shall install the test plug for the initial BOP test.

Page 6 of 8

- iv.Whenever any seal subject to test pressure is broken, all the tests in 43 CFR 3172.6(b)(9) must be followed.
- v.If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - i.In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead cement), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
 - ii. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the cement plug. The BOPE test can be initiated after bumping the cement plug with the casing valve open. (only applies to single stage cement jobs, prior to the cement setting up.)
 - iii. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer and can be initiated immediately with the casing valve open. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to 43 CFR 3172 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for 8 hours or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
 - iv. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
 - v.The results of the test shall be reported to the appropriate BLM office.
 - vi.All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
 - vii. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
 - viii.BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per 43 CFR 3172.

C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area. Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

KPI 10/23/2024




Permian Drilling Hydrogen Sulfide Drilling Operations Plan

Open drill site. No homes or buildings are near the proposed location.

1. Escape

Personnel shall escape upwind of wellbore in the event of an emergency gas release. Escape can take place through the lease road on the Southeast side of the location. Personnel need to move to a safe distance and block the entrance to location. If the primary route is not an option due to the wind direction, then a secondary egress route should be taken.

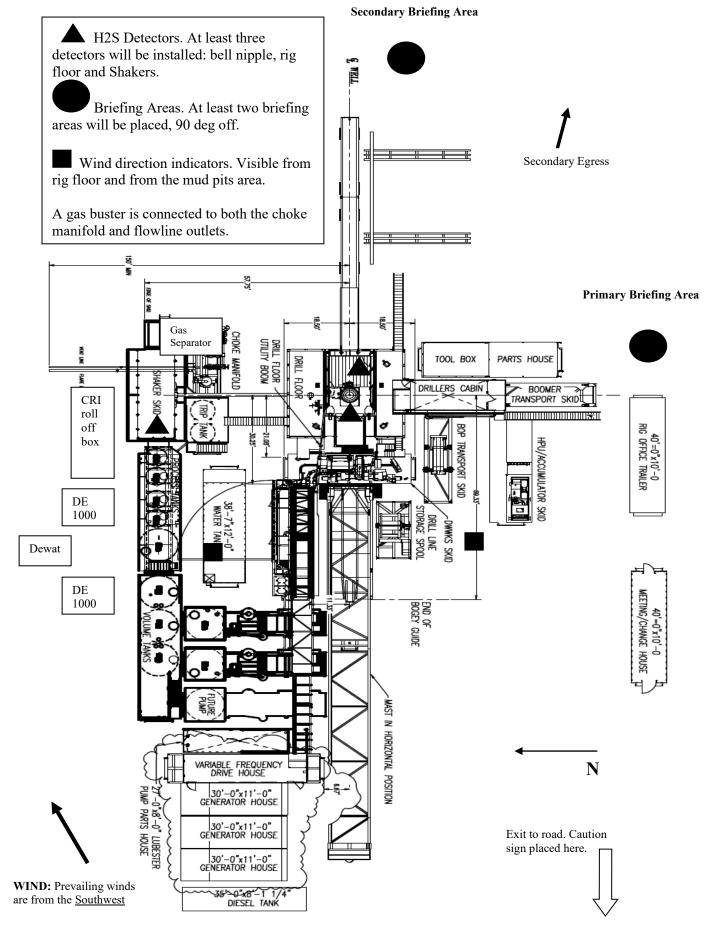



Permian Drilling Hydrogen Sulfide Drilling Operations Plan New Mexico

<u>Scope</u>

This contingency plan establishes guidelines for the public, all company employees, and contract employees who's work activities may involve exposure to hydrogen sulfide (H2S) gas.

While drilling this well, it is possible to encounter H2S bearing formations. At all times, the first barrier to control H2S emissions will be the drilling fluid, which will have a density high enough to control influx.

Objective

- 1. Provide an immediate and predetermined response plan to any condition when H2S is detected. All H2S detections in excess of 10 parts per million (ppm) concentration are considered an Emergency.
- 2. Prevent any and all accidents, and prevent the uncontrolled release of hydrogen sulfide into the atmosphere.
- 3. Provide proper evacuation procedures to cope with emergencies.
- 4. Provide immediate and adequate medical attention should an injury occur.

•

Discussion

Implementation:	This plan with all details is to be fully implemented before drilling to <u>commence</u> .
Emergency response Procedure:	This section outlines the conditions and denotes steps to be taken in the event of an emergency.
Emergency equipment Procedure:	This section outlines the safety and emergency equipment that will be required for the drilling of this well.
Training provisions:	This section outlines the training provisions that must be adhered to prior to drilling.
Drilling emergency call lists:	Included are the telephone numbers of all persons to be contacted should an emergency exist.
Briefing:	This section deals with the briefing of all people involved in the drilling operation.
Public safety:	Public safety personnel will be made aware of any potential evacuation and any additional support needed.
Check lists:	Status check lists and procedural check lists have been included to insure adherence to the plan.
General information:	A general information section has been included to supply support information.

Hydrogen Sulfide Training

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on the well:

- 1. The hazards and characteristics of H2S.
- 2. Proper use and maintenance of personal protective equipment and life support systems.
- 3. H2S detection.
- 4. Proper use of H2S detectors, alarms, warning systems, briefing areas, evacuation procedures and prevailing winds.
- 5. Proper techniques for first aid and rescue procedures.
- 6. Physical effects of hydrogen sulfide on the human body.
- 7. Toxicity of hydrogen sulfide and sulfur dioxide.
- 8. Use of SCBA and supplied air equipment.
- 9. First aid and artificial respiration.
- 10. Emergency rescue.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H2S on metal components. If high tensile strength tubular is to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling a well, blowout prevention and well control procedures.
- 3. The contents and requirements of the H2S Drilling Operations Plan.

H2S training refresher must have been taken within one year prior to drilling the well. Specifics on the well to be drilled will be discussed during the pre-spud meeting. H2S and well control (choke) drills will be performed while drilling the well, at least on a weekly basis. This plan shall be available in the well site. All personnel will be required to carry the documentation proving that the H2S training has been taken.

Service company and visiting personnel

- A. Each service company that will be on this well will be notified if the zone contains H2S.
- B. Each service company must provide for the training and equipment of their employees before they arrive at the well site.
- C. Each service company will be expected to attend a well site

Emergency Equipment Requirements

1. <u>Well control equipment</u>

The well shall have hydraulic BOP equipment for the anticipated pressures. Equipment is to be tested on installation and follow Oxy Well Control standard, as well as 43 CFR part 3170 Subpart 3172.

Special control equipment:

- A. Hydraulic BOP equipment with remote control on ground. Remotely operated choke.
- B. Rotating head
- C. Gas buster equipment shall be installed before drilling out of surface pipe.

2. <u>Protective equipment for personnel</u>

- A. Four (4) 30-minute positive pressure air packs (2 at each briefing area) on location.
- B. Adequate fire extinguishers shall be located at strategic locations.
- C. Radio / cell telephone communication will be available at the rig.
 - Rig floor and trailers.
 - Vehicle.

3. <u>Hydrogen sulfide sensors and alarms</u>

- A. H2S sensor with alarms will be located on the rig floor, at the bell nipple, and at the flow line. These monitors will be set to alarm at 10 ppm with strobe light, and audible alarm.
- B. Hand operated detectors with tubes.
- C. H2S monitor tester (to be provided by contract Safety Company.)
- D. There shall be one combustible gas detector on location at all times.

4. <u>Visual Warning Systems</u>

A. One sign located at each location entrance with the following language:

Caution – potential poison gas Hydrogen sulfide No admittance without authorization

Wind sock – *wind streamers*:

- A. One 36" (in length) wind sock located at protection center, at height visible from rig floor.
- B. One 36" (in length) wind sock located at height visible from pit areas.

Condition flags

A. One each condition flag to be displayed to denote conditions.

green – normal conditions yellow – potential danger red – danger, H2S present

B. Condition flag shall be posted at each location sign entrance.

5. <u>Mud Program</u>

The mud program is designed to minimize the risk of having H2S and other formation fluids at surface. Proper mud weight and safe drilling practices will be applied. H2S scavengers will be used to minimize the hazards while drilling. Below is a summary of the drilling program.

Mud inspection devices:

Garrett gas train or hatch tester for inspection of sulfide concentration in mud system.

6. <u>Metallurgy</u>

- A. Drill string, casing, tubing, wellhead, blowout preventers, drilling spools or adapters, kill lines, choke manifold, lines and valves shall be suitable for the H2S service.
- B. All the elastomers, packing, seals and ring gaskets shall be suitable for H2S service.

7. <u>Well Testing</u>

No drill stem test will be performed on this well.

8. <u>Evacuation plan</u>

Evacuation routes should be established prior to well spud for each well and discussed with all rig personnel.

- 9. <u>Designated area</u>
 - A. Parking and visitor area: all vehicles are to be parked at a predetermined safe distance from the wellhead.
 - B. There will be a designated smoking area.
 - C. Two briefing areas on either side of the location at the maximum allowable distance from the well bore so they offset prevailing winds perpendicularly, or at a 45-degree angle if wind direction tends to shift in the area.

Emergency procedures

- A. In the event of any evidence of H2S level above 10 ppm, take the following steps:
 - 1. The Driller will pick up off bottom, shut down the pumps, slow down the pipe rotation.
 - 2. Secure and don escape breathing equipment, report to the upwind designated safe briefing / muster area.
 - 3. All personnel on location will be accounted for and emergency search should begin for any missing, the Buddy System will be implemented.
 - 4. Order non-essential personnel to leave the well site, order all essential personnel out of the danger zone and upwind to the nearest designated safe briefing / muster area.
 - 5. Entrance to the location will be secured to a higher level than our usual "Meet and Greet" requirement, and the proper condition flag will be displayed at the entrance to the location.
 - 6. Take steps to determine if the H2S level can be corrected or suppressed and, if so, proceed as required.
- B. If uncontrollable conditions occur:
 - 1. Take steps to protect and/or remove any public in the down-wind area from the rig – partial evacuation and isolation. Notify necessary public safety personnel and appropriate regulatory entities (i.e. BLM) of the situation.

- 2. Remove all personnel to the nearest upwind designated safe briefing / muster area or off location.
- 3. Notify public safety personnel of safe briefing / muster area.
- 4. An assigned crew member will blockade the entrance to the location. No unauthorized personnel will be allowed entry to the location.
- 5. Proceed with best plan (at the time) to regain control of the well. Maintain tight security and safety procedures.
- C. Responsibility:
 - 1. Designated personnel.
 - a. Shall be responsible for the total implementation of this plan.
 - b. Shall be in complete command during any emergency.
 - c. Shall designate a back-up.

All personnel:	1. 2. 3.	On alarm, don escape unit and report to the nearest upwind designated safe briefing / muster area upw Check status of personnel (buddy system). Secure breathing equipment.
	4.	Await orders from supervisor.
Drill site manager:	1.	Don escape unit if necessary and report to nearest upwind designated safe briefing / muster area.
	2.	Coordinate preparations of individuals to return to point of release with tool pusher and driller (using the buddy system).
	3.	Determine H2S concentrations.
	4.	Assess situation and take control measures.
Tool pusher:	1.	Don escape unit Report to up nearest upwind designated safe briefing / muster area.
	2.	Coordinate preparation of individuals to return to point of release with tool pusher drill site manager (using the buddy system).
	3.	Determine H2S concentration.
	<i>4</i> .	Assess situation and take control measures.
Driller:	1.	Don escape unit, shut down pumps, continue

		rotating DP.
	2.	Check monitor for point of release.
	3.	Report to nearest upwind designated safe briefing / muster area.
	4.	Check status of personnel (in an attempt to rescue, use the buddy system).
	5.	Assigns least essential person to notify Drill Site Manager and tool pusher by quickest means in case of their absence.
	6.	Assumes the responsibilities of the Drill Site Manager and tool pusher until they arrive should they be absent.
Derrick man Floor man #1 Floor man #2	1.	Will remain in briefing / muster area until instructed by supervisor.
Mud engineer:	1.	Report to nearest upwind designated safe briefing / muster area.
	2.	When instructed, begin check of mud for ph and H2S level. (Garett gas train.)
Safety personnel:	1.	Mask up and check status of all personnel and secure operations as instructed by drill site manager.

<u>Taking a kick</u>

When taking a kick during an H2S emergency, all personnel will follow standard Well control procedures after reporting to briefing area and masking up.

Open-hole logging

All unnecessary personnel off floor. Drill Site Manager and safety personnel should monitor condition, advise status and determine need for use of air equipment.

Running casing or plugging

Following the same "tripping" procedure as above. Drill Site Manager and safety personnel should determine if all personnel have access to protective equipment.

Ignition procedures

The decision to ignite the well is the responsibility of the operator (Oxy Drilling Management). The decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope controlling the blowout under the prevailing conditions at the well.

Instructions for igniting the well

- 1. Two people are required for the actual igniting operation. They must wear self-contained breathing units and have a safety rope attached. One man (tool pusher or safety engineer) will check the atmosphere for explosive gases with the gas monitor. The other man is responsible for igniting the well.
- 2. Primary method to ignite: 25 mm flare gun with range of approximately 500 feet.
- 3. Ignite upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best for protection, and which offers an easy escape route.
- 5. Before firing, check for presence of combustible gas.
- 6. After lighting, continue emergency action and procedure as before.
- 7. All unassigned personnel will remain in briefing area until instructed by supervisor or directed by the Drill Site Manager.

<u>Remember</u>: After well is ignited, burning hydrogen sulfide will convert to sulfur dioxide, which is also highly toxic. **<u>Do not assume the area is safe after the well is ignited.</u>**

Status check list

Note: All items on this list must be completed before drilling to production casing point.

- 1. H2S sign at location entrance.
- 2. Two (2) wind socks located as required.
- 3. Four (4) 30-minute positive pressure air packs (2 at each Briefing area) on location for all rig personnel and mud loggers.
- 4. Air packs inspected and ready for use.
- 5. Cascade system and hose line hook-up as needed.
- 6. Cascade system for refilling air bottles as needed.
- 7. Condition flag on location and ready for use.
- 8. H2S detection system hooked up and tested.
- 9. H2S alarm system hooked up and tested.
- 10. Hand operated H2S detector with tubes on location.
- 11. 1-100' length of nylon rope on location.
- 12. All rig crew and supervisors trained as required.
- 13. All outside service contractors advised of potential H2S hazard on well.
- 14. No smoking sign posted and a designated smoking area identified.
- 15. Calibration of all H2S equipment shall be noted on the IADC report.

Checked by: _____ Date:

Procedural check list during H2S events

Perform each tour:

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to ensure that it in proper working order.
- 3. Make sure all the H2S detection system is operative.

Perform each week:

- 1. Check each piece of breathing equipment to make sure that demand or forced air regulator is working. This requires that the bottle be opened and the mask assembly be put on tight enough so that when you inhale, you receive air or feel air flow.
- 2. BOP skills (well control drills).
- 3. Check supply pressure on BOP accumulator stand by source.
- 4. Check breathing equipment mask assembly to see that straps are loosened and turned back, ready to put on.
- 5. Check pressure on breathing equipment air bottles to make sure they are charged to full volume. (Air quality checked for proper air grade "D" before bringing to location)
- 6. Confirm pressure on all supply air bottles.
- 7. Perform breathing equipment drills with on-site personnel.
- 8. Check the following supplies for availability.
 - A. Emergency telephone list.
 - B. Hand operated H2S detectors and tubes.

General evacuation plan

- 1. When the company approved supervisor (Drill Site Manager, consultant, rig pusher, or driller) determines the H2S gas cannot be limited to the well location and the public will be involved, he will activate the evacuation plan.
- 2. Drill Site Manager or designee will notify local government agency that a hazardous condition exists and evacuation needs to be implemented.
- 3. Company or contractor safety personnel that have been trained in the use of H2S detection equipment and self-contained breathing equipment will monitor H2S concentrations, wind directions, and area of exposure. They will delineate the outer perimeter of the hazardous gas area. Extension to the evacuation area will be determined from information gathered.
- 4. Law enforcement personnel (state police, police dept., fire dept., and sheriff's dept.) Will be called to aid in setting up and maintaining road blocks. Also, they will aid in evacuation of the public if necessary.
- 5. After the discharge of gas has been controlled, company safety personnel will determine when the area is safe for re-entry.

<u>Important:</u> Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.

Emergency actions

Well blowout – if emergency

- 1. Evacuate all personnel to "Safe Briefing / Muster Areas" or off location if needed.
- 2. If sour gas evacuate rig personnel.
- 3. If sour gas evacuate public within 3000 ft radius of exposure.
- 4. Don SCBA and shut well in if possible using the buddy system.
- 5. Notify Drilling Superintendent and call 911 for emergency help (fire dept and ambulance) if needed.
- 6. Implement the Blowout Contingency Plan, and Drilling Emergency Action Plan.
- 6. Give first aid as needed.

Person down location/facility

- 1. If immediately possible, contact 911. Give location and wait for confirmation.
- 2. Don SCBA and perform rescue operation using buddy system.

Toxic effects of hydrogen sulfide

Hydrogen sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 10 ppm, which is .001% by volume. Hydrogen sulfide is heavier than air (specific gravity -1.192) and colorless. It forms an explosive mixture with air between 4.3 and 46.0 percent by volume. Hydrogen sulfide is almost as toxic as hydrogen cyanide and is between five and six times more toxic than carbon monoxide. Toxicity data for hydrogen sulfide and various other gases are compared in table i. Physical effects at various hydrogen sulfide exposure levels are shown in table ii.

Common name	Chemical formula	Specific gravity	Threshold limit	Hazardous limit	Lethal concentration (3)
		(sc=1)	(1)	(2)	
Hydrogen Cyanide	Hcn	0.94	10 ppm	150 ppm/hr	300 ppm
Hydrogen Sulfide	H2S	1.18	10 ppm	250 ppm/hr	600 ppm
Sulfur Dioxide	So2	2.21	5 ppm	-	1000 ppm
Chlorine	C12	2.45	1 ppm	4 ppm/hr	1000 ppm
Carbon Monoxide	Co	0.97	50 ppm	400 ppm/hr	1000 ppm
Carbon Dioxide	Co2	1.52	5000 ppm	5%	10%
Methane	Ch4	0.55	90,000 ppm	Combustib	le above 5% in air

Table i Toxicity of various gases

1) threshold limit – concentration at which it is believed that all workers may be repeatedly exposed day after day without adverse effects.

- 2) hazardous limit concentration that will cause death with short-term exposure.
- 3) lethal concentration concentration that will cause death with short-term exposure.

Toxic effects of hydrogen sulfide

Table ii Physical effects of hydrogen sulfide

		Concentration	Physical effects
Percent (%)	Ppm	Grains	
	-	100 std. Ft3*	
0.001	<10	00.65	Obvious and unpleasant odor.

•

0.002	10	01.30	Safe for 8 hours of exposure.
0.010	100	06.48	Kill smell in $3 - 15$ minutes. May sting eyes and throat.
0.020	200	12.96	Kills smell shortly; stings eyes and throat.
0.050	500	32.96	Dizziness; breathing ceases in a few minutes; needs prompt artificial respiration.
0.070	700	45.36	Unconscious quickly; death will result if not rescued promptly.
0.100	1000	64.30	Unconscious at once; followed by death within minutes.

*at 15.00 psia and 60'f.

Use of self-contained breathing equipment (SCBA)

- 1. Written procedures shall be prepared covering safe use of SCBA's in dangerous atmosphere, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available SCBA.
- 2 SCBA's shall be inspected frequently at random to insure that they are properly used, cleaned, and maintained.
- 3. Anyone who may use the SCBA's shall be trained in how to insure proper facepiece to face seal. They shall wear SCBA's in normal air and then wear them in a test atmosphere. (note: such items as facial hair {beard or sideburns} and eyeglasses will not allow proper seal.) Anyone that may be reasonably expected to wear SCBA's should have these items removed before entering a toxic atmosphere. A special mask must be obtained for anyone who must wear eyeglasses or contact lenses.
- 4. Maintenance and care of SCBA's:
 - a. A program for maintenance and care of SCBA's shall include the following:
 - 1. Inspection for defects, including leak checks.
 - 2. Cleaning and disinfecting.
 - 3. Repair.
 - 4. Storage.
 - b. Inspection, self-contained breathing apparatus for emergency use shall be inspected monthly.
 - 1. Fully charged cylinders.
 - 2. Regulator and warning device operation.
 - 3. Condition of face piece and connections.
 - 4. Rubber parts shall be maintained to keep them pliable and prevent deterioration.
 - c. Routinely used SCBA's shall be collected, cleaned and disinfected as frequently as necessary to insure proper protection is provided.
- 5. Persons assigned tasks that requires use of self-contained breathing equipment shall be certified physically fit (medically cleared) for breathing equipment usage at least annually.
- 6. SCBA's should be worn when:
 - A. Any employee works near the top or on top of any tank unless test reveals less than 10 ppm of H2S.

- B. When breaking out any line where H2S can reasonably be expected.
- C. When sampling air in areas to determine if toxic concentrations of H2S exists.
- D. When working in areas where over 10 ppm H2S has been detected.
- E. At any time there is a doubt as to the H2S level in the area to be entered.

<u>Rescue</u> <u>First aid for H2S poisoning</u>


Do not panic!

Remain calm – think!

- 1. Don SCBA breathing equipment.
- 2. Remove victim(s) utilizing buddy system to fresh air as quickly as possible. (go up-wind from source or at right angle to the wind. Not down wind.)
- 3. Briefly apply chest pressure arm lift method of artificial respiration to clean the victim's lungs and to avoid inhaling any toxic gas directly from the victim's lungs.
- 4. Provide for prompt transportation to the hospital, and continue giving artificial respiration if needed.
- 5. Hospital(s) or medical facilities need to be informed, before-hand, of the possibility of H2S gas poisoning no matter how remote the possibility is.
- 6. Notify emergency room personnel that the victim(s) has been exposed to H2S gas.

Besides basic first aid, everyone on location should have a good working knowledge of artificial respiration.


Revised CM 6/27/2012

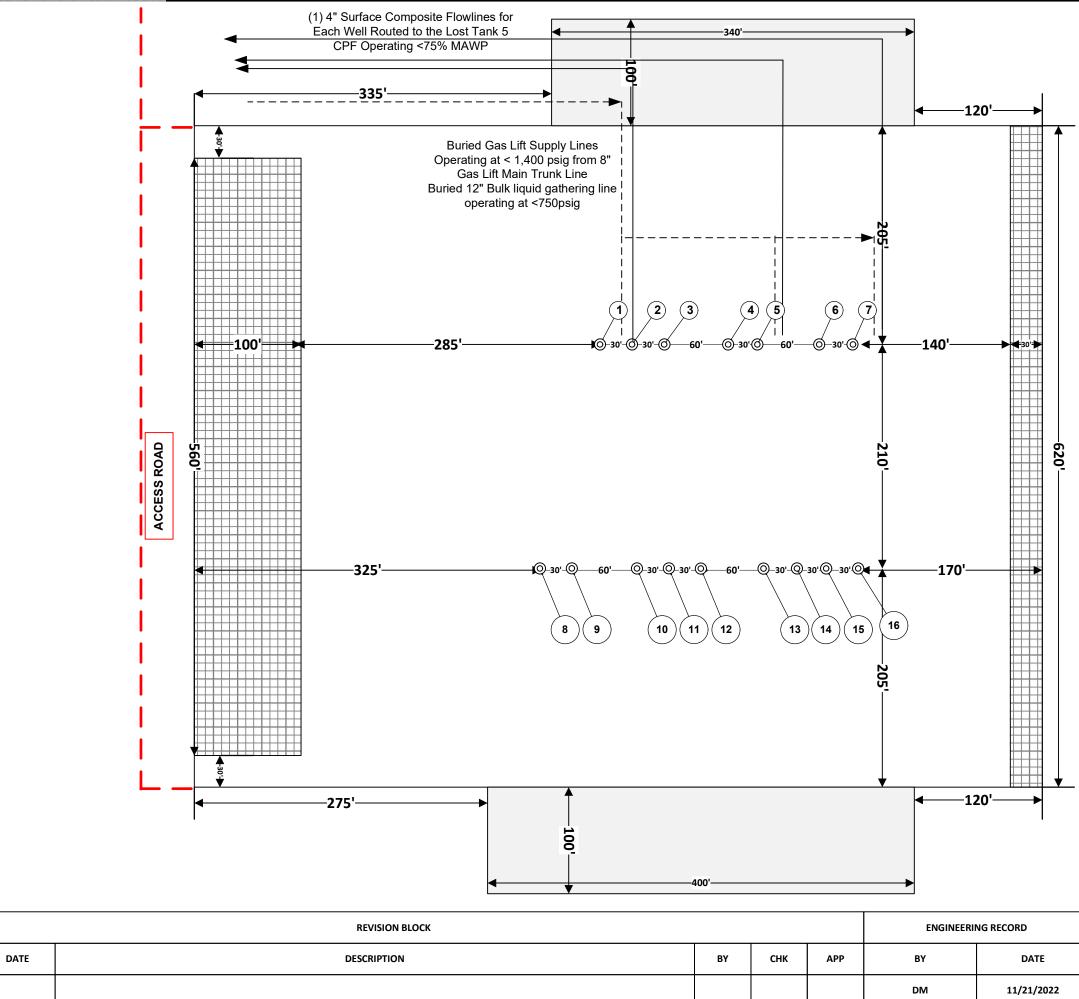



NO.



1. GOLD LOG 4_9 FED COM 14H 2. GOLD LOG 4_9 FED COM 15H 3. GOLD LOG 4_9 FED COM 16H 4. GOLD LOG 4_9 FED COM 3H 5. GOLD LOG 4_9 FED COM 4H 6. GOLD LOG 4_9 FED COM 73H 7. GOLD LOG 4_9 FED COM 74H 8. GOLD LOG 4_9 FED COM 43H 9. GOLD LOG 4_9 FED COM 44H 10. gold log 4_9 fed com 24h 11. GOLD LOG 4_9 FED COM 25H 12. GOLD LOG 4_9 FED COM 26H 13. GOLD LOG 4_9 FED COM 312H 14. GOLD LOG 4_9 FED COM 34H 15. GOLD LOG 4_9 FED COM 313H 16. GOLD LOG 4_9 FED COM 35H

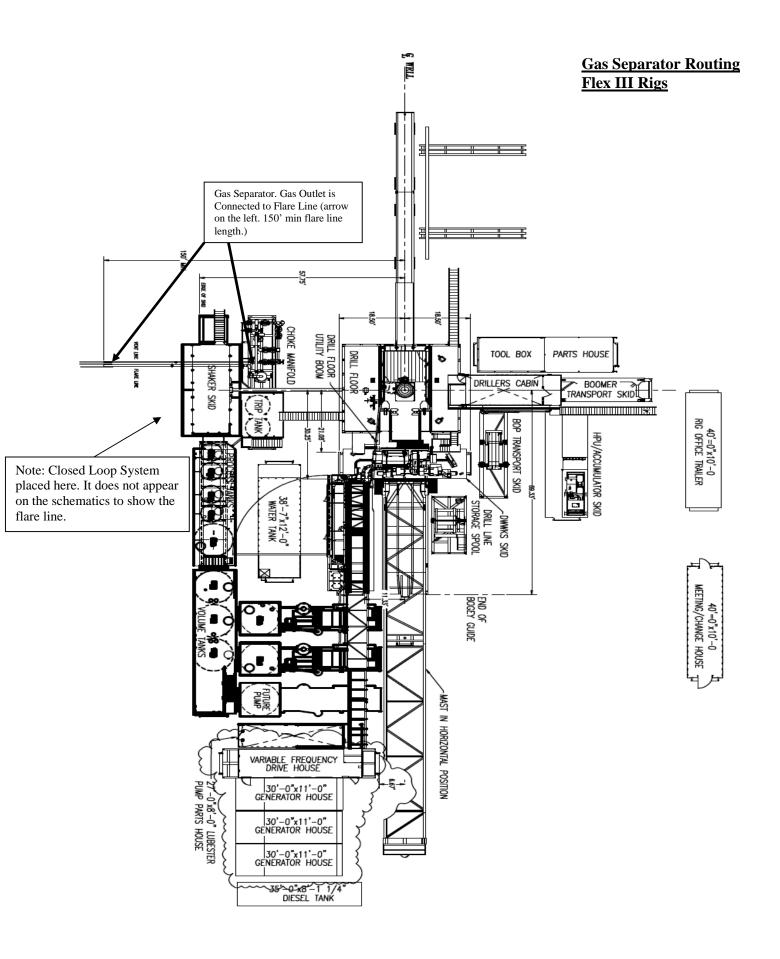

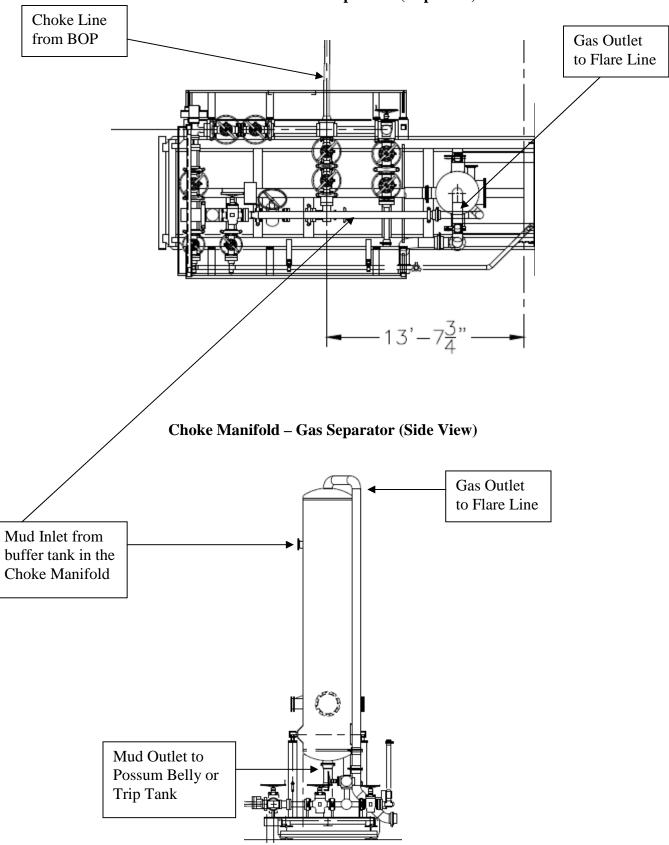


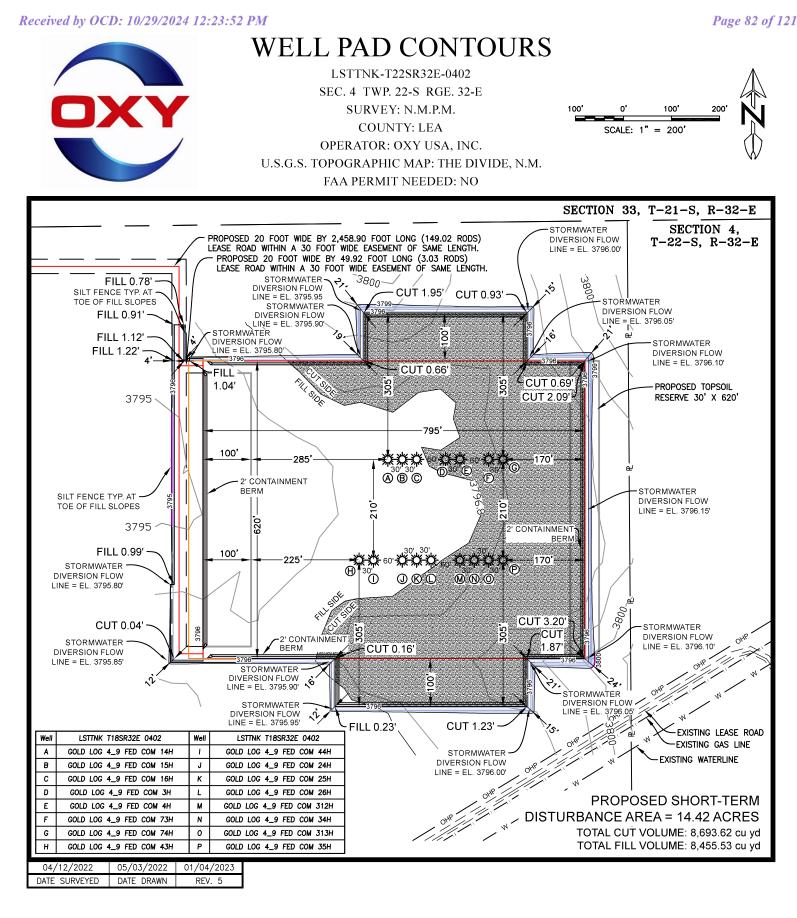


LEGEND			SWD	SALT WATER DISP.
<u></u> P	PROP. PAD SURFACE PROPERTY LINE PROP. LEASE ROAD EXIST. 1' CTR. LINES			PROP. 1' CTR. LINES PROP. 5' CTR. LINES EROSION CON. FENCE OVERHEAD POWER FENCE
Rologod to Im	EXIST. 5' CTR. LINES	24 2.2	22.00 PM	PIPELINE




Received by OCD: 10/29/2024 12:23:52 PM

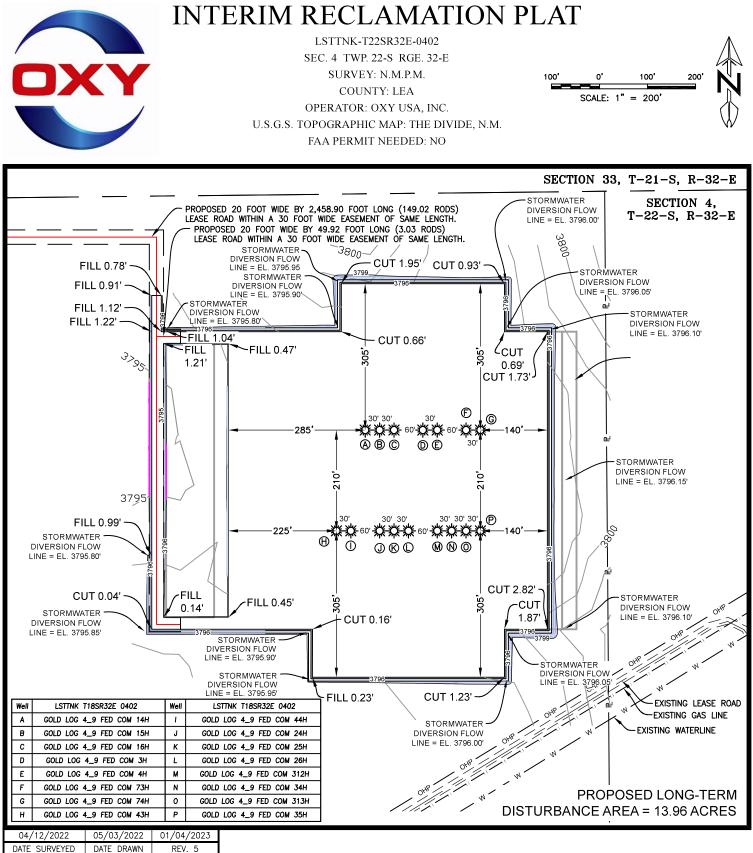







10M Choke Panel

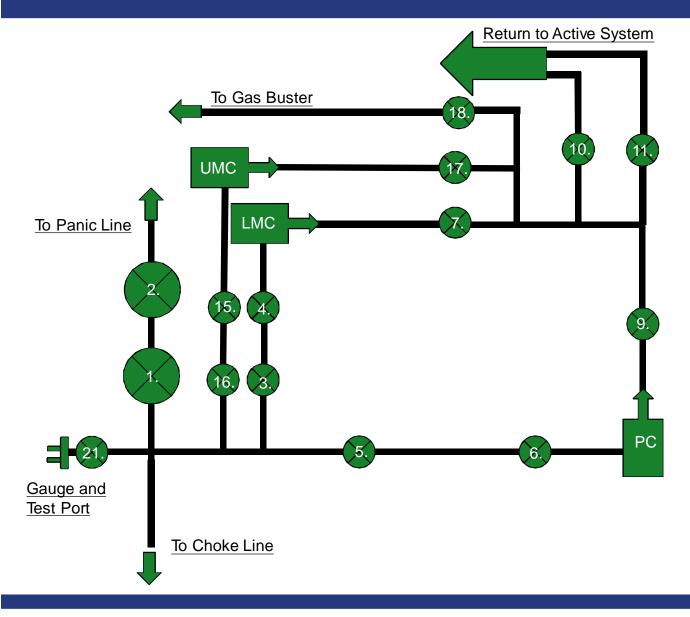



- 1. Choke Manifold Valve
- 2. Choke Manifold Valve
- 3. Choke Manifold Valve
- 4. Choke Manifold Valve
- 5. Choke Manifold Valve
- 6. Choke Manifold Valve
- 7. Choke Manifold Valve
- 8. PC Power Choke
- 9. Choke Manifold Valve
- 10. Choke Manifold Valve
- 11. Choke Manifold Valve
- 12. LMC Lower Manual Choke
- 13. UMC Upper manual choke
- 15. Choke Manifold Valve
- 16. Choke Manifold Valve
- 17. Choke Manifold Valve
- 18. Choke Manifold Valve
- 21. Vertical Choke Manifold Valve
- *All Valves 3" minimum




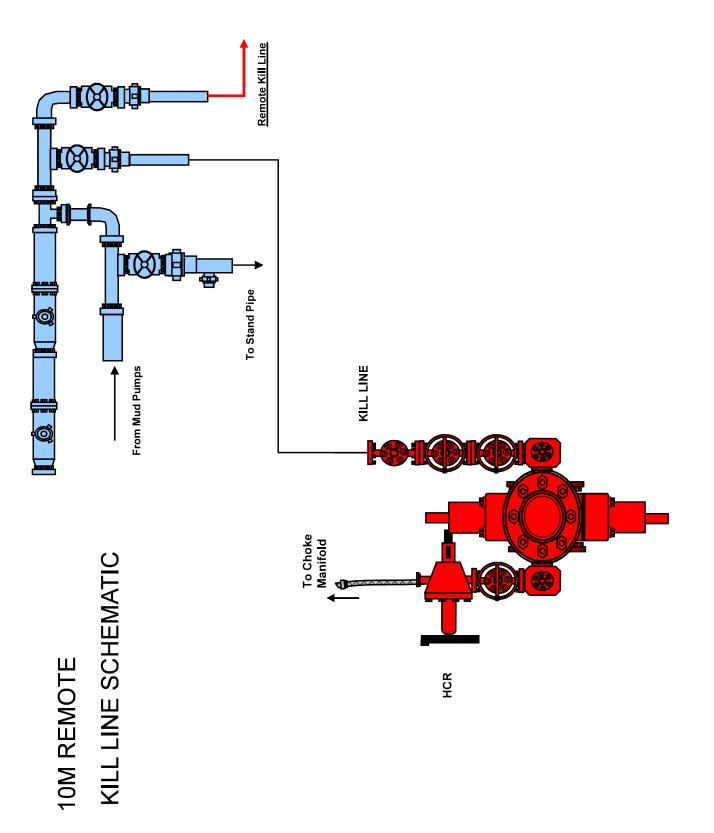

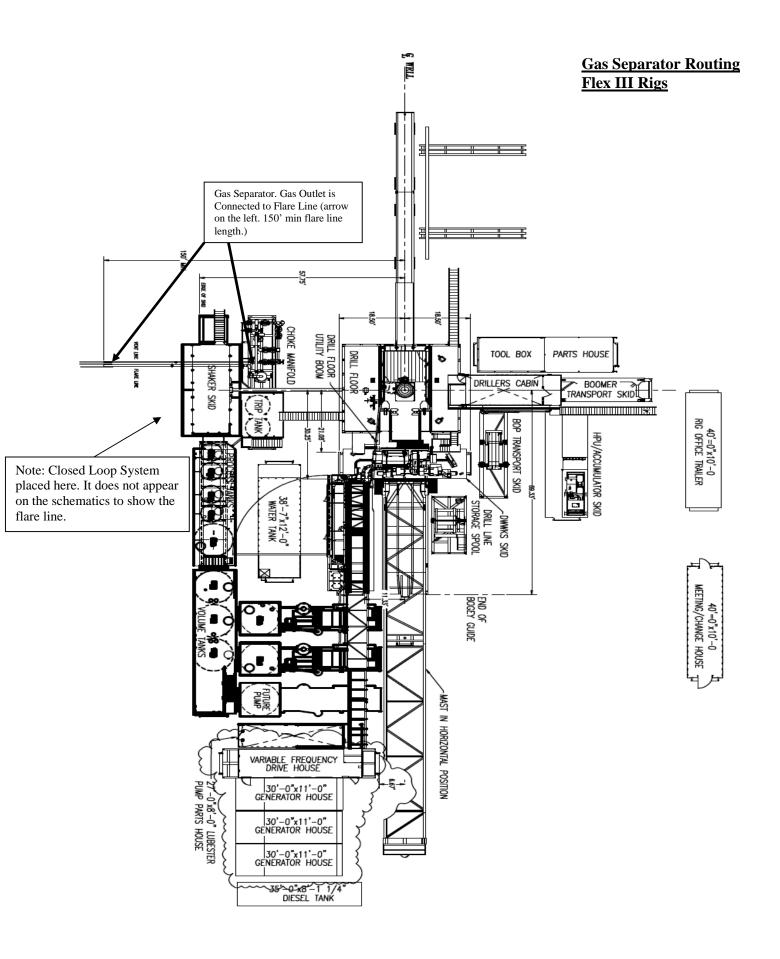

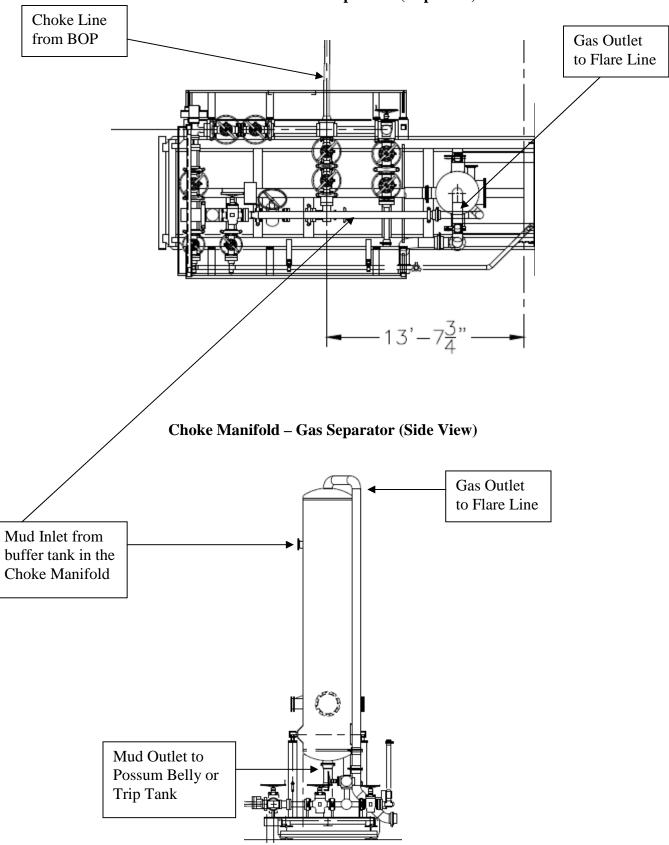

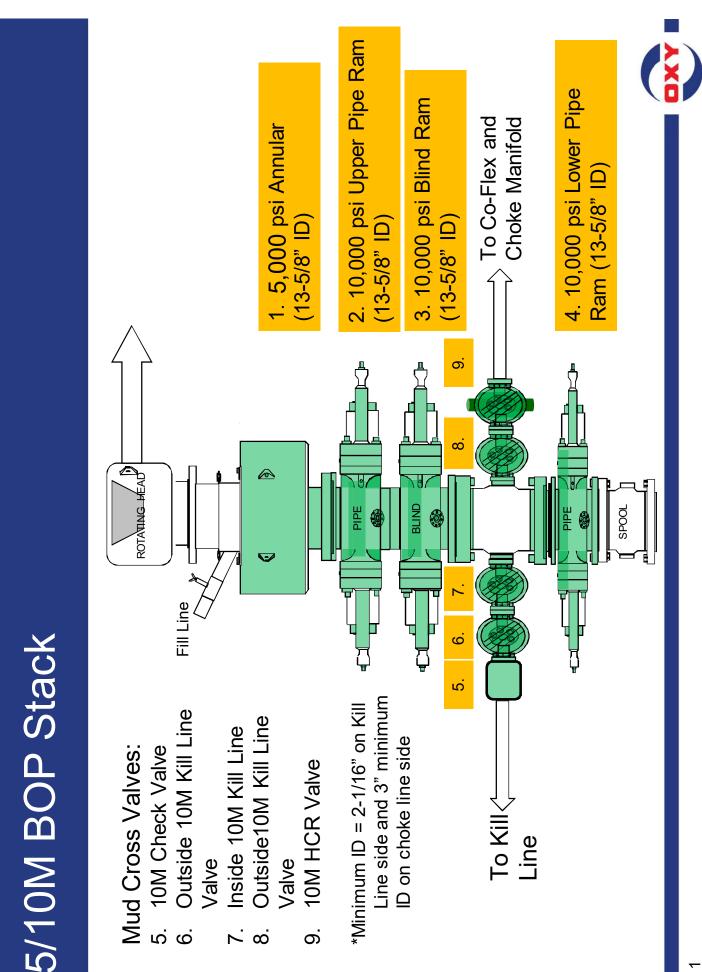

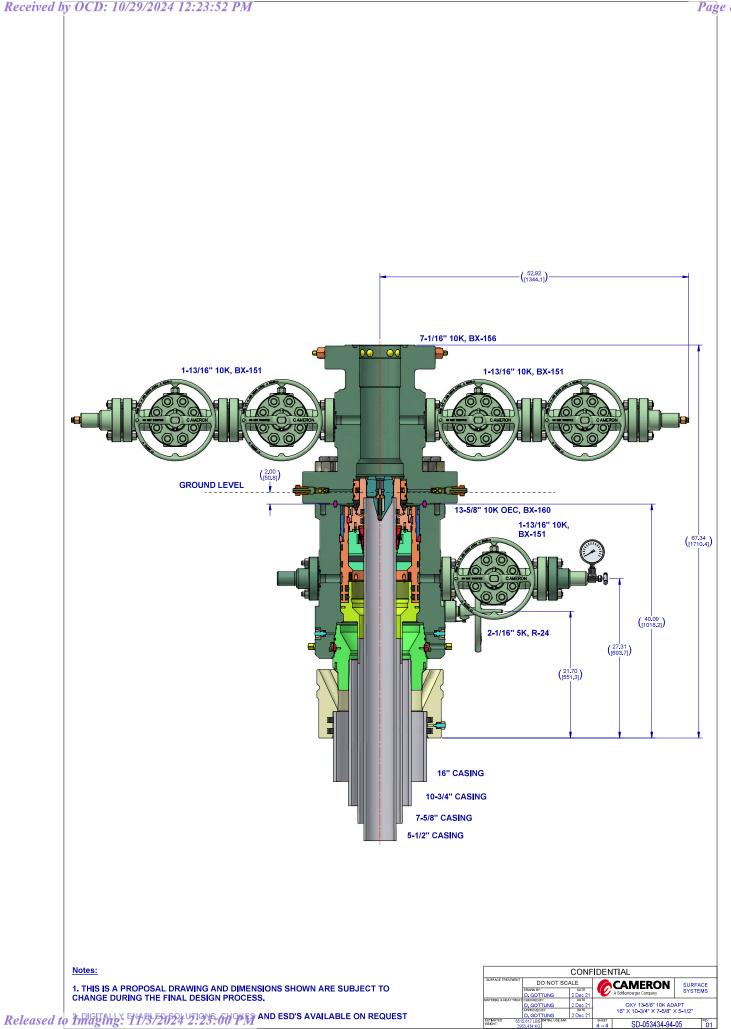

Ontinental 3

Certificate of Conformity

ContiTech

Certificate Number H100161	COM Order Reference 1429702	Customer Name & Address HELMERICH & PAYNE DRILLING CO
Customer Purchase Order No:	740382384	1434 SOUTH BOULDER AVE TULSA, OK 74119
Project:		USA
Test Center Address	Accepted by COM Inspection	Accepted by Client Inspection
ContiTech Oil & Marine Corp. 11535 Brittmoore Park Drive Houston, TX 77041 USA	Signed: Date: 06/27/22	

We certify that the items detailed below meet the requirements of the customer's Purchase Order referenced above, and are in conformance with the specifications given below.

ltem	Part No.	Description	Qnty	Serial Number	Specifications
30	RECERTIFICATION	3" ID 10K Choke and Kill Hose x 35ft OAL	1	70024	ContiTech Standard

.

Hydrostatic Test Certificate

60

Ontinental 3


ContiTech **Certificate Number** COM Order Reference **Customer Name & Address** H100161 1429702 HELMERICH & PAYNE DRILLING CO Customer Purchase Order No: 740382384 1434 SOUTH BOULDER AVE TULSA, OK 74119 Project: USA **Test Center Address** Accepted by COM Inspection Accepted by Client Inspection ContiTech Oil & Marine Corp. Gerson Mejia-Lazo 11535 Brittmoore Park Drive Signed: Houston, TX 77041 USA Date: 06/27/22

We certify that the goods detailed hereon have been inspected as described below by our Quality Management System, and to the best of our knowledge are found to conform the requirements of the above referenced purchase order as issued to ContiTech Oil & Marine Corporation.

Item	Part No.	Description	Qnty	Serial Number	Work, Press, (psi)	Test Press. (psi)	Test Time (minutes)
30	RECERTIFICATION	3" ID 10K Choke and Kill Hose x 35ft CAL	1	70024	10.000	15 000	60

Record In	nformation
Start Time	6/8/2022 12:49:19
End Time	6/8/2022 14:07:25
Interval	00:01:00
Number	79
MaxValue	15762
MinValue	-7
AvgValue	14395
RecordName	70024-sh
RecordNumber	235

Gauge I	nformation
Model	ADT680
SN	21817380014
Range	(0-40000)psi
Unit	psi

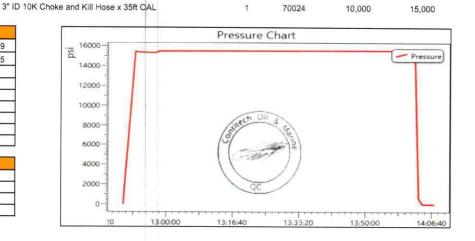

Released to Imaging: 11/3/2024 2:23:00 PM

12000

EN ARE DEC 23/52

Gates Engineering & Services North America 7603 Prairie Oak Dr. Houston, TX. 77086 PHONE : (281) 602-4119 FAX: EMIL: <u>Troy.Schmidt@gates.com</u>

CERTIFICATE OF CONFORMANCE

This is to certify that all parts and materials included in this shipment have manufactured and/or processed in accordance with various Gates and API assembly and test specifications. Records of required tests are on-file and subject to examination. Test reports and subsequent test graphs have been made available with this shipment. Additional supporting documentation related to materials, welding, weld inspections, and heat-treatment activities are available upon request.

	:# JAIABS	H2-112019-4
	:YTITNAUQ	τ
	:# ABORO SBJAS	286915
		CLAMPS
	PART DESCRIPTION:	RING GROOVE SUPPLIED WITH SAFETY CLAMPS & SLINGS & LIFT EYE
		ZRIMOR C/W 4 1/16 10K FIX X FLOAT H2S SUITED FLANGES WITH BX 155
	:N/4 AAMOT2UC	3" X 12 FT GATES CHOKE & KILL HOSE ASSEMBLY WITH STAINLESS STEEL 10KFR3.012.0CK411610KFIXXFLT SSA SC LE
j	:#.O.9 293MOT2U2	4128128 (RIG 1 PO 002773)
l.	:USTOMER:	320H NITZUA ABO DNI NITZUA 5-A

	6T0Z/0Z/TT	:3TAQ
annes i ten se internet i tel for a datas	32NARU22A YTIJAUD	
	Mouna and	SIGNATURE:

GATES ENGINEERING & SERVICES NORTH AMERICA 7603 Prairie Oak Dr. Houston, TX 77086

FAX: EMAIL: Troy.Schmidt@gates.com WEB: www gates.com

6TT1 - 209 (182) : 3NOHd

PRESSURE TEST CERTIFICATE

	PC1/9780-01050083	:9bo2 vidm9seA	810611 242141
1 Fitting 1:	4 1/10 10K FLANGES FIXED	End Fitting 2:	4 1/16 10K FLANGES FLOAT
roduct Description:	3" X 12 FT GATES CHOKE & KILL HOSE DROOM FLANGES WITH BX 155 RING GROOM	aly with strinless steel are We suppled with sefety clai	IOR C/W 4 1/16 10K FIX X FLOAT H2S SUITED
VOICE NO.:			
:.oN solovi	286915	Created By:	Norma Cabrera
ustomer: ustomer Ref.: ivoice No.:	216982 4128128 (KIC 1 bO 002333)	Hose Serial No.: Created By:	H2-112019-4 Norma Cabrera

Working Pressure:

Test Pressure:

Gates Engineering & Services North America certifies that:

10KFR3.012.0CK411610KFIXXFLT SSA SC LE

The following hose assembly has successfully passed all pressure testing requirements set forth in Gates specifications: GTS-04-052 (for 5K assemblies) or GTS-04-053 (10K assemblies), which include reference to Specification API 16C (2nd Edition); sections 7.5.4, 7.5.9, and 10.8.7. A test graph will accompany this test certificate to illustrate conformity to test requirements. This hose assembly was pressure tested using equipment and instrumentation that has been calibrated in accordance with the requirements set-forth in the GESNA management system.

: ameu6is	-1000 -2000 1	: andengis
: ejeQ	610Z/0Z/TT	: əteO
Production:	ΥΠΙΑΟΟ	:Vaileu Q
6605 (7.1 Salle)		

E-PRD-005

CUSTOMER P/N:

CLACE STAL NO.



PROBUCTION

'ISd 000'01

'ISd 000'SI

72-1987



RT	0	d	7	Н	I	S	7	I
	U	J	-	9			-	califiers.

Բart number:	
:Ol szoH	
Description:	
:Jadmun tol	
Serial number:	
TEST OBJECT	

3'0 × 4-7/79 70K
3.0 x 4-1/16 10K
3.0 10k MS C&K
F41242113018

H2-112019-4

M9 70:51:51 9102/02/11

	it gnind 1:	4
:3	ədmun tıs ^ı	d
	:Ol esol	н
	escription	
:	ot number	n
: 120	amun isina	c

rength:

Description:

Part number:

Fitting 2:

Description: Part number:

15 **J991**

inch

%

Sec

isd

292

isd

SSA

0.24

00.00

00.002

00'05/6

3600.00

00'000ST

286915

Soh nitzuA

E20-40-219

Test operator:

Visual check:

Length difference:

Length difference:

Mork pressure:

:eaussead aset

:vneqmoð

CUSTOMER

:enubeconq feat

Work pressure hold:


Test pressure hold:

VOITAMAORNI TEST

Customer reference: Sales order #:

Production description:

Length measurement result: Pressure test result:

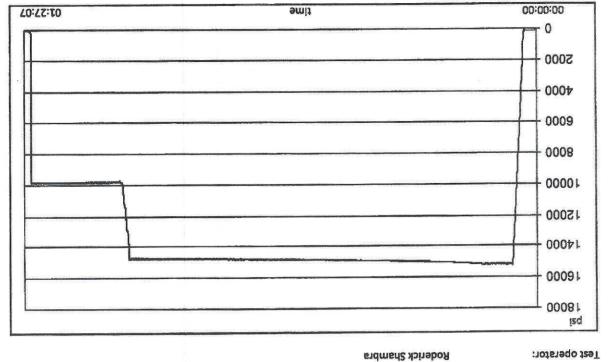

Page 1/2

Filename: D:/Certificates/Report_112019-4.pdf

72-1987

M9 70:51:51 8102/02/11

TEST REPORT



GAUGE TRACEABILITY

Calibration due date	Calibration date	Serial number	Description
5050-03-72	2079-03-17	TIOAMCLO	W-A-22-2
5050-04-14	5076-04-76	110APO2K	M-A-252-2

JuammoJ

Page 2/2

Filename: D:/Certificates/Report_112019-4.pdf

÷

Received by OCD: 10/29/2024 12:23:52 PM Wer Date: 12/17/2019

- 日日日子をあたり 日日 - 日間 日日 - 川南日、

\$2 - - \$1 - - 1E-

-

ちちゃ ちょう やちちゃ

《前十一张子,】子,故汉之,武子,谓曰:武子,武子,武子,武子,武子,武子,武子,武子,武子,王子,武子,武子,武子,武子,武子,之子,之武,,武子,武子,武子,武子,武子,武子,武子,武章,武章,

DW Industries Inc. Carrett Crawford, Director of Quality


Certificate Issue Date: 2/27/2020

WITH ISO-9001:2015, API Q1 AND API SPEC 7K. IDENTIFICATION REQUIREMENTS AND HAS BEEN PROCESSED IN ACCORDANCE PRESERVATION, PACKACING, PACKING, MARKING, AND PHYSICAL QUALITY CONTROL CLAUSES, DESIGN SPECIFICATIONS, DRAWINGS, AND CONFORM TO ALL REQUIREMENTS OF THE PURCHASE ORDER, INCLUDING: INDUSTRIES, THAT THE PRODUCT LISTED ABOVE ARE OF THE QUALITY SPECIFIED I DO HEREBY CERTIFY, AS THE AUTHORIZED REPRESENTATIVE OF DW

SNOING BEIM	C/M CI 3% T0'000 bzi M	Part Description	1005-4 O V-2040-4812-	Customer Part Number:	Purchase
07/56/2020	Assembly Date:		t	QTY Ordered:	ise Order
052620DW-2	Serial Number:	1-2001-st	84-0492-40	Part Number: DW Industries	
50050763	DW Industries Work Order Number:		CONTACT PAULI INF	Customer: Purchase Order Number:	Information
PAUL HOFFMAN 432-241-5360		Contact: Contact:	סאורדואפ	CITADELI	Customer Vame:

7424-443-EIT x57 Tel. 713 644-8372 Houston, TX 77087 6287 Long Drive DM INDRALISTICS

Certificate of Conformance don to in don don in

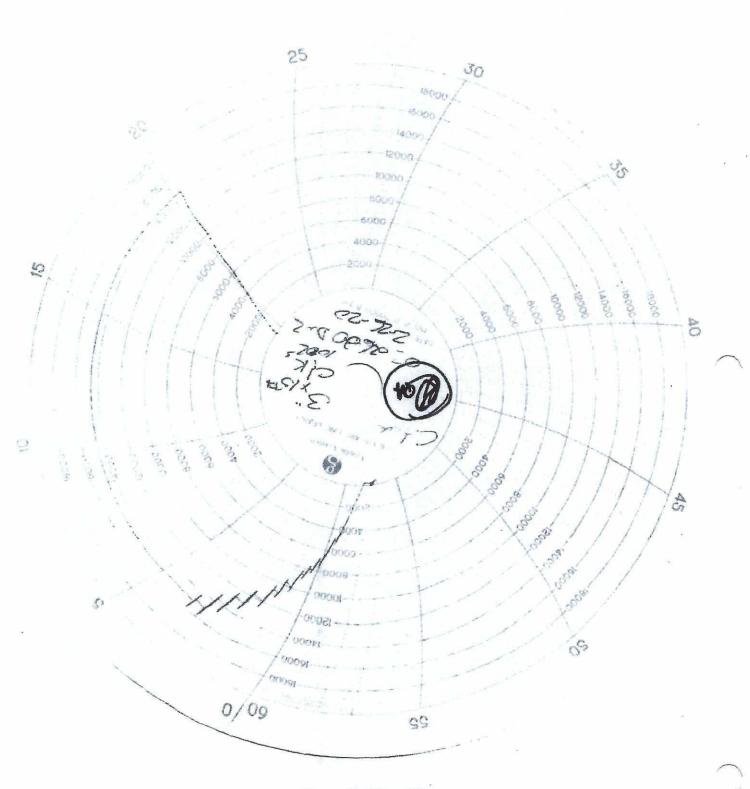



By burgeries barries bernarderen with the barries of the parties

Certificate of Conformance

2464-448-E17 X67 Tel. 713 644-8372 Houston, TX 77087 ANIA DUOJ 7820 DM INDORLISTER INC'

3" 10,000 psi WP CHOKE HOSE 4-1/16" FIXED BY FLOAT FLANGES C/W SS ARMOR & LIFTING EYES		Part Description:	J/J6FXFL-ALE 0A-5640-4822-4-	Customer Part Number:	Purcha
07/76/5050	Assembly Date:	τ		QTY Ordered:	se Orc
052620DW-1	serial Number:	OA-5640-4822-4-1/16FXFL-ALE		DW Industries Part Number:	Purchase Order Information
50020164	W Industries Work Order Number:	807 ИАМ740L НОFFMAN F08 ОТИГО		Customer Purchase Order Number:	rmation
NAM7701 JUA9 0352-142-264		Customer Contact:	סאורדואפ	J30ATID	Customer Name:

WITH ISO-9001:2015, API Q1 AND API SPEC 7K. IDENTIFICATION REQUIREMENTS AND HAS BEEN PROCESSED IN ACCORDANCE PRESERVATION, PACKAGING, PACKING, MARKING, AND PHYSICAL QUALITY CONTROL CLAUSES, DESIGN SPECIFICATIONS, DRAWINGS, AND CONFORM TO ALL REQUIREMENTS OF THE PURCHASE ORDER, INCLUDING: INDUSTRIES, THAT THE PRODUCT LISTED ABOVE ARE OF THE QUALITY SPECIFIED I DO HEREBY CERTIFY, AS THE AUTHORIZED REPRESENTATIVE OF DW

Certificate Issue Date: 2/27/2020


DW Industries Inc.

Carrett Crawford, Director of Quality

New Date: 12/17/2019 OF-018-OF. Rev Na

その、手し、、「それ、「ない」

1-24--26

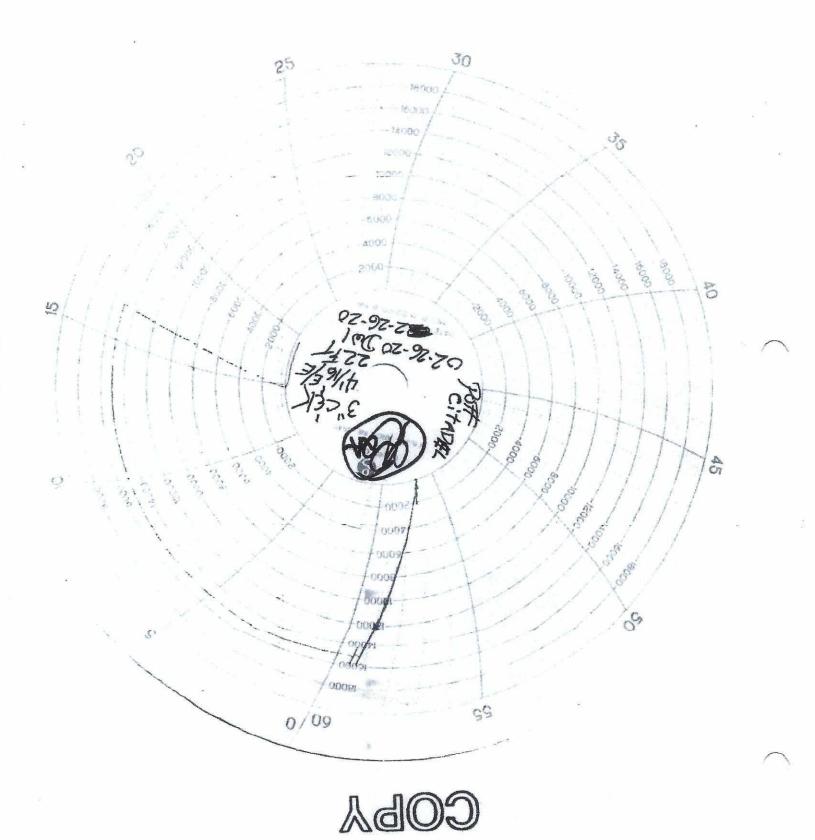

Certificate of Conformance


Tel. 713 644-8372 Fax 713-644-4947 Houston, TX 77087 DW INDUSTRIES INC.

t"" FIG 602 MXF	۲/M אנ "אבע" אני איי איי איי איי איי איי איי איי איי	Part Description		Customer Part Number:	Purcha
T\52\72053	:9160 Vidm922A		Ţ	QTY Ordered:	se Ord
59007062	Serial Number:	709-"4214	9-8E0229-AO	Part Number:	ler Info
59007082	DW Industries Work Order Number:	LL	670200	Customer Purchase Order Mumber:	Purchase Order Information
Α9301 ΥΟυί		rəmotsu) toataot:	HOSE	NITU2A	Customer Customer

I DO HEREBY CERTIFY, AS THE AUTHORIZED REPRESENTATIVE OF DW INDUSTRIES, THAT THE PRODUCT LISTED ABOVE ARE OF THE QUALITY SPECIFIED AND CONFORM TO ALL REQUIREMENTS OF THE PURCHASE ORDER, INCLUDING: PRESERVATION, PACKAGING, PACKING, MARKING, AND PHYSICAL PRESERVATION, PACKAGING, PACKING, MARKING, AND PHYSICAL WITH ISO-9001:2015, API Q1 AND API SPEC 7K.

Certificate Issue Date: 1/27/2023

Quality Assurance, Inc.

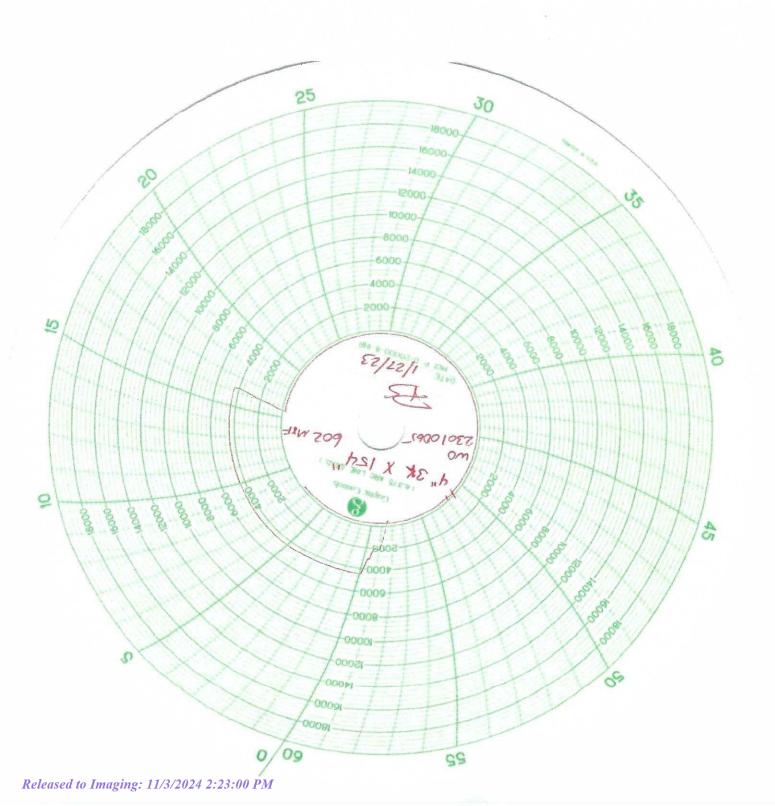

IN SERVICE 12-20-21



GATES ENGINEERING & SERVICES NORTH AMERICA 7603 Prairie Oak Dr. Suite 190 Houston, TX. 77086 PHONE: +1 (281) 602-4100 FAX: +1 (281) 602-4147 EMAIL: gesna.quality@gates.com WEB: www.gates.com/ollandgas

	DDFCGUDF FF		
	PRESSURE TES	ST CERTIFI	CATE
Customer:	A-7 AUSTIN INC DBA AUSTIN HOSE	Test Date:	10/15/2021
Customer Ref.:	00595477	Hose Serial No.:	H3-101521-2
Invoice No.:	521925	Created By:	Micky Mhina
Product Description:	3" X 35' GATES FIRE RATED CHOKE & KILL HOSE TREATED FLANGES SUPPLIED W	ASSEMBLY SUITED FOR H2 TH STAINLESS STEEL ARMO	S SERVICE C/W 4 1/16 10K FIXED X FLOAT HEAT DR SAFETY CLAMPS & LIFT EYES
End Fitting 1:	4 1/16 10K FIXED FLANGE	End Fitting 2:	4 1/16 10K FLOAT HEAT TREATED FLANGES
Oracle Star No.:	68703010-10074881	Assembly Code:	L41975 091719
CUSTOMER P/N:	10K3.035.0CK411610KFIXXFLTW/SSA/SC/LE	Test Pressure:	15,000 PSI.
		Working Pressure:	10,000 PSI.
The following hose specifications: GTS assemblies), which test graph will acc was pressure teste	ng & Services North America cert e assembly has successfully passed all 5-04-052 (for 5K assemblies) or GTS-0 n include reference to Specification AP ompany this test certificate to illustrated using equipment and instrumentation forth in the GESNA management system	I pressure testing req 04-053 (10K assembli PI 16C (2nd Edition); te conformity to test r on that has been cali	es) or GTS-04-048 (15K sections 7.5.4, 7.5.9, and 10.8.7. A requirements This hose assembly
Quality:	QUALITY	Production:	PBODUCTION
Date :	10/15/2021	Date :	10/15/2021
Signature :	Muly neur	Signature :	Ih If
F-PRD-005B		2	Revision 6, 05032021



GATES ENGINEERING & SERVICES NORTH AMERICA 7603 Prairle Oak Dr. Houston, TX. 77086 PHONE: +1 (281) 602-4100 FAX: +1 (281) 602-4147 EMAIL: gesna.quality@gates.com WEB: www.gates.com/oilandgas

CERTIFICATE OF CONFORMANCE

This is to certify that all parts and materials included in this shipment have manufactured and/or processed in accordance with various Gates and API assembly and test specifications. Records of required tests are on-file and subject to examination. Test reports and subsequent test graphs have been made available with this shipment. Additional supporting documentation related to materials, welding, weld inspections, and heat-treatment activities are available upon request.

CUSTOMER:	A-7 AUSTIN INC DBA AUSTIN HOSE
CUSTOMER P.O.#:	00595477
CUSTOMER P./N.#:	10K3.035.0CK411610KFIXXFLTW/SSA/SC/LE
PART DESCRIPTION:	3" X 35' GATES FIRE RATED CHOKE & KILL HOSE ASSEMBLY SUITED FOR H2S SERVICE C/W 4 1/16 10K FIXED X FLOAT HEAT TREATED FLANGES SUPPLIED WITH STAINLESS STEEL ARMOR SAFETY CLAMPS & LIFT EYES
SALES ORDER #:	521925
QUANTITY:	1
SERIAL #:	H3-101521-2

SIGNATURE:	Alalye when	
TITLE:	/ QUALITY ASSURANCE	R
DATE:	10/15/2021	

Received by OCD: 10/29/2024 12:23:52 PM




TEST REPORT

H3-6963

CUSTOMER			TEST OBJECT		
Company:	Austin Distril	outing	Serial number:	H3-101521-2	
and the second s			Lot number:	L4197509171	.9
Production description:			Description:		
Sales order #:	521925				
Customer reference:			Hose ID:	3" 10k ck	
			Part number:		
TEST INFORMATION					
Test procedure:	GTS-04-053		Fitting 1:	3.0 x 4-1/16	10K
Test pressure:	15000.00	psi	Part number:		
Test pressure hold:	3600.00	sec	Description:		
Work pressure:	10000.00	psi			
Work pressure hold:	900.00	sec	Fitting 2:	3.0 x 4-1/16	10K
Length difference:	0.00	%	Part number:		
Length difference:	0.00	inch	Description:		
Visual check:			Length:	35	feet
Pressure test result:	PASS				
	T MJJ				
Length measurement result:					

Test operator:

francisco

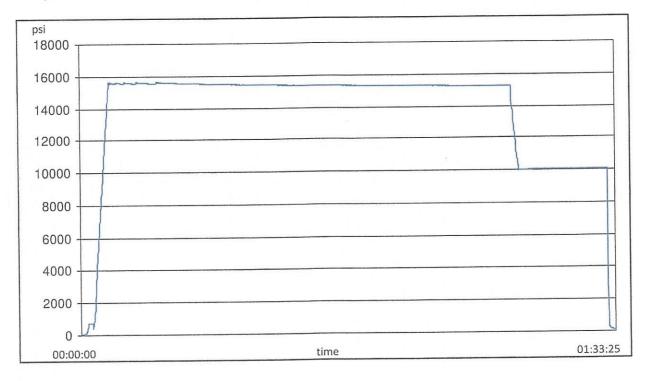

Filename: D:\Certificates\Report_101521-H3-101521-2.pdf



H3-6963

TEST REPORT

GAUGE TRACEABILITY

Description	Serial number	Calibration date	Calibration due date
S-25-A-W	110AQA1S	2021-02-24	2022-02-24
S-25-A-W	110D3PHQ	2021-03-11	2022-03-11
Comment			

Filename: D:\Certificates\Report_101521-H3-101521-2.pdf

Ontine Page 106 of 121

ContiTech

Hydrostatic Test Certificate

and the second	and the second	Customer Name & Address
1429702		HELMERICH & PAYNE DRILLING CO 1434 SOUTH BOULDER AVE
74038238	54	TULSA, OK 74119 USA
		Accepted by Client Inspection
A	ccepted by COM Inspection	
Signed: Date:	07/14/22	alow by our Quality Management System, and to the best of our
	1429702 74038238 A Signed:	Data: 07/14/22

We certify that the goods detailed hereon have been inspected as described below by our Quality Management System, and to the best of our knowledge are found to conform the requirements of the above referenced purchase order as issued to ContiTech Oil & Marine Corporation.

Item	Part No.	Description	Qnty	Serial Number	Work. Press. (psi)	Test Press. (psi)	Test Time (minutes)	
		255 01	1	70025	10,000	15,000	60	

RECERTIFICATION 50


3" ID 10K Choke and Kill Hose x 35ft OAL

1

15,00

We wanted and the second se	formation
Start Time	6/14/2022 11:42:08
End Time	6/14/2022 12:56:14
Interval	00:01:00
Number	75
MaxValue	15888
MinValue	-8
AvgValue	14184
RecordName	70025-sh
RecordNumber	237

Gauge li	nformation
Model	ADT680
SN	21817380014
Range	(0-40000)psi
Unit	psi

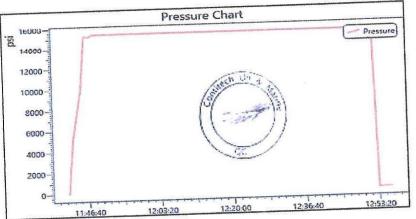

Page 107 of 121 ontinental

ContiTech

Certificate of Conformity

Customer Name & Address COM Order Reference Certificate Number HELMERICH & PAYNE DRILLING CO 1429702 H100163 1434 SOUTH BOULDER AVE 740382384 **Customer Purchase Order No:** TULSA, OK 74119 USA **Project:** Accepted by Client Inspection Accepted by COM Inspection **Test Center Address** Gerson Mejia-Lazo ContiTech Oil & Marine Corp. Signed: 11535 Brittmoore Park Drive Houston, TX 77041 Date: 07/14/22 USA

We certify that the items detailed below meet the requirements of the customer's Purchase Order referenced above, and are in conformance with the specifications given below.

Item	Part No.	Description	Qnty	Serial Number	Specifications
50	RECERTIFICATION	3" ID 10K Choke and Kill Hose x 35ft OAL	1	70025	ContiTech Standard

ARMORED CHOKE HOSE Frostalbal 4-29-22

Received by OCD: 10/29/2024 12:23:52 PM



	No: QC-DB- 120 / 2019				
Industrial Kft.	Page: 16 / 91				

ContiTech

	ITY CON		TROL CERTIFICATE			lo:	75819	
PURCHASER:	Dil & Marine Corp.		P.O. Nº:		4501225327			
CONTITECH RUBBER order N°	1127442	HOSE TYPE:	3"	ID		Choke an	d Kill Hose	
HOSE SERIAL Nº:	75819	NOMINAL / AC	NOMINAL / ACTUAL LENGTH:			10,67 m / 10,68 m		
W.P. 69,0 MPa 10	000 psi	T.P. 103,5	MPa	1500)0 psi	Duration:	60	min.
Pressure test with water at ambient temperature	;	See attachm	ient (1	page	:)			
COUPLINGS Typ	9	Serial	N°		Qu	ality	Heat N°	
3" coupling with		602	6		AISI 4130		A0607J	
4 1/16" 10K API Swivel F	ange end			AISI		4130	040841	
Hub			A		AISI 4130		54194	
3" coupling with	601	6	3 AIS		A060			
4 1/16" 10K API b.w. Fla	inge end			AISI		4130	040431	
Not Designed For Well Testing API Spec 16 C 2 nd Edition– FSL2 Temperature rate: "B" All metal parts are flawless WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDER INSPECTED AND PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. STATEMENT OF CONFORMITY: We hereby certify that the above items/equipment supplied by us are in conformity with the terms, conditions and specifications of the above Purchaser Order and that these items/equipment were fabricated inspected and tested in accordance with the referenced standards, codes and specifications and meet the relevant acceptance criteria and design requirements. COUNTRY OF ORIGIN HUNGARY/EU COUNTRY OF ORIGIN HUNGARY/EU								
Date: 08. April 2019. Unspector Inspector Quality Control Quality Control Quality Control ContiTech Rubber Industrial Kft. Quality Control Dept. (1) Som M. Yaupunge								

ContiTech Rubber Industrial Kft. | Budapesti út 10. H-6728 Szeged | H-6701 P.O.Box 152 Szeged, Hungary Phone: +36 62 566 737 | e-mail: info@fluid.contitech.hu | Internet: www.contitech-rubber.hu; www.contitech-oil-gas.com The Court of Csongråd County as Registry Court | Registry Court No: Cg.06-09-002502 | EU VAT No: HU11087209 Bank data Commerzbank Zrt., Budapest | 14220108-26830003

Released to Imaging: 11/3/2024 2:23:00 PM

Prepared by	(Cristian Rivera		Date:	8/27/2022		QIN:	N/A	
Customer:	HEL	MERICH & PAYNE, INC		Location:	H&P INT'	L DI) 210 MAGNOLIA DR GALEN X,77547-2738	A
User contact:	М	ITCH MCKINNIS		Phone:			e-mail:	mitch.mckinnis@hp	pinc.com
	Parameters			Но	ose Detai	ils	Test Status		
		РО			740398454 (88000240 SN	:700	35)		
		Gates SO			525035				
		Serial #:			88000240 SN:70035				
		As Tested Seria	1:		H2-082722-1 RE-TEST				
		Hose ID:			3 IN				
		INSPECT AND RETEST CUSTC C/W 4-1/16 FLANGES BX155			35FT CHOKE & KILL ASSEMBLY ACH END				
Applicatior	า								
Information Working pressure: 1		10000 PSI.				PASS			

1. Visual Examination

An API 16C, IN X 35FT CHOKE & KILL ASSEMBLY C/W 4-1/16 FLANGES BX155 RING GROOVE EACH END received from HELMERICH & PAYNE, INC for inspection, testing and external cosmetic repairs. The hydrostatic pressure testing was requested to 15000 PSI., by the customer HELMERICH & PAYNE, INC

Visual inspection and examination of external hose assembly showed some cosmetic dents and repairabledamages to the external armor at distance 32ft 9in. from EF2. (Need to fix a part of the hose.)

Both external & internal hose body and couplings of the hose were examined. Visual Inspection photos are in Table 2, while post inspection/testing pictures are in Table 4.

The hose was hydrostatically tested at 15000 PSI. test pressure with an hour-long hold. On completion of hydrostatic testing, an internal baroscopic examination was carried out, to check the condition of internal hose areas, mainly hose tube and coupling hose interface.


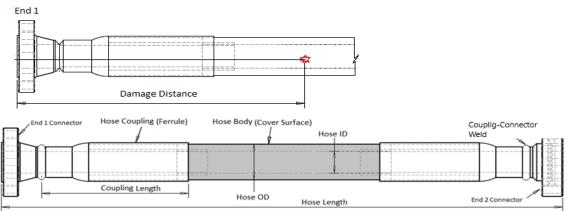


Figure 1: Generic Hose Assembly

1.0 Observations and comments






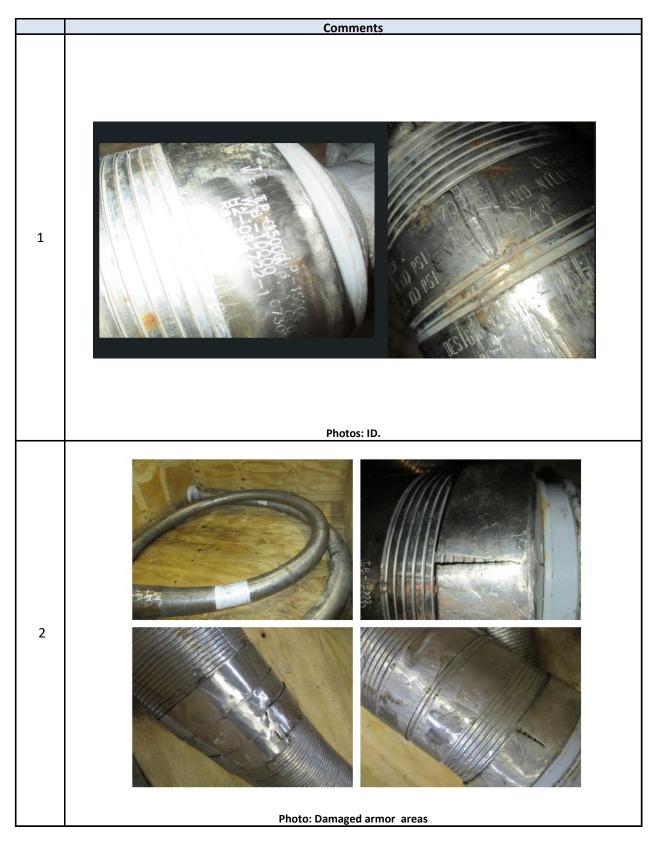





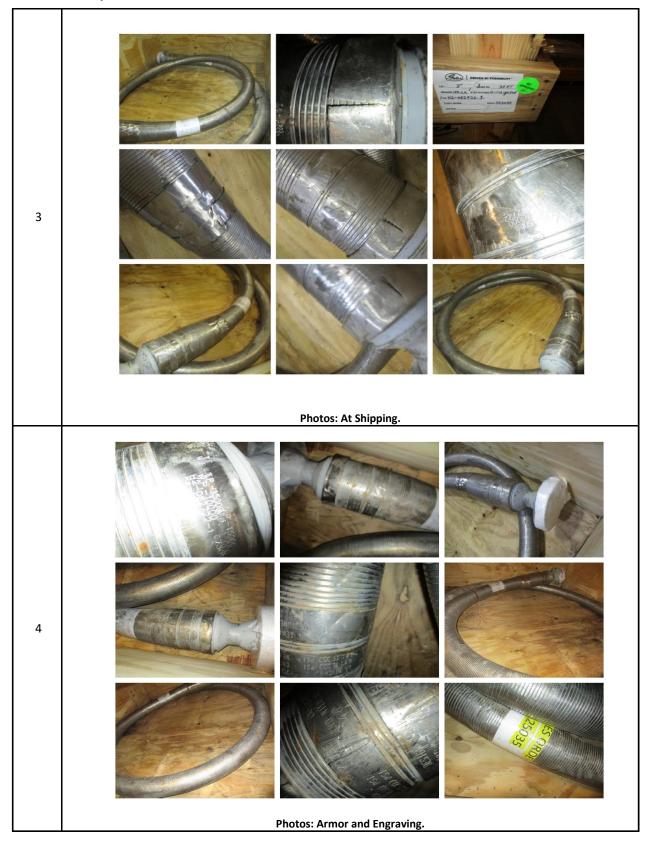








2. Hydro Static Pressure test

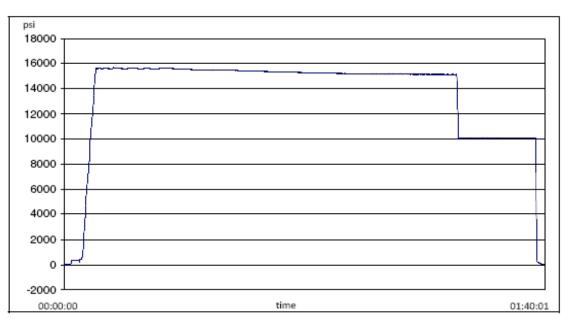

2.1 Hydrostatic Pressure test Procedures

	Hose Type	Test Specification	Test Date	Technician			
1	IN X 35FT CHOKE & KILL	3 10K C&K	2022-08-27	Martin Orozco			
	ASSEMBLY C/W 4-1/16	S IOK C&K	2022-06-27				
2.2	2.2 Gates Hydrostatic Pressure tester						

	Test Equipment	Serial No	Last Cal Date	Cal Due Date
1	S-25-A-W	110AMCLO	2022-01-10	2023-01-10
2	S-25-A-W	110BSEUZ	2022-03-09	2023-03-09

Gates).

Hose Assembly Evaluation Sheet

2.3 Hydro Static Test Pressure results

	Details	Re	sults
1	Hydrostatic Test Results ⁽¹⁾	Pass	Fail
2	Failure Mode	None	
3	Hose Dispatched to the customer?	Yes	No

Note:

1. Hydrostatic Pressure report is given in Appendix 1

3. Hose borescope inspection


3.2 Internal Failure Details

	Type of Failure	Location of Defect	Ref. Photo	Defect Details
1	Liner breach/ collapse	None		None
2	Bulges/ Blisters	None		None
3	Other breach/failures	None		None



Photos: Liner/Coupling Interface END 1



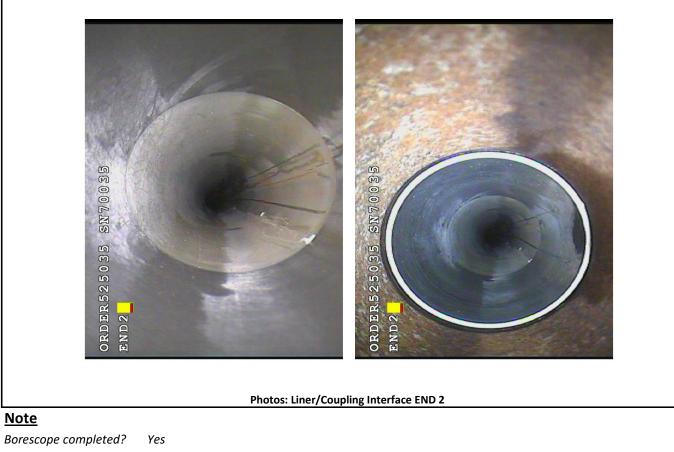

4. Summary

Hose assembly successfully tested to requested test pressure of 15000 PSI. with an hour hold. It was then serialized and stamped, as H2-082722-1 RE-TEST. The bore scope showed no blisters or delamination in the internal lining/tube area. External damages were repaired as agreed with the customer.



APPENDIX 1: Pressure Chart


H2-8316

8/27/2022 8:51:22 AM

CUSTOMER Company:			TEST OBJECT Serial number: Lot number:	H2-082722-1	
Production description:			Description:		
Sales order #:	525035				
Customer reference:	740398454	(88000240	Hose ID:	3 10k C&K	
	SN:70035)		Part number:		
TEST INFORMATION					
Test procedure:	3 10K C&K		Fitting 1:	3.0 x 4-1/16	10K
Test pressure:	15000.00	psi	Part number:		
Test pressure hold:	3600.00	sec	Description:		
Work pressure:	10000.00	psi			
Work pressure hold:	900.00	sec	Fitting 2:	3.0 x 4-1/16	10K
Length difference:	0.00	%	Part number:		
Length difference:	0.00	inch	Description:		
Visual check:			Length:	35	feet
Pressure test result:	PASS				
Length measurement result:					

TEST REPORT

Test operator:

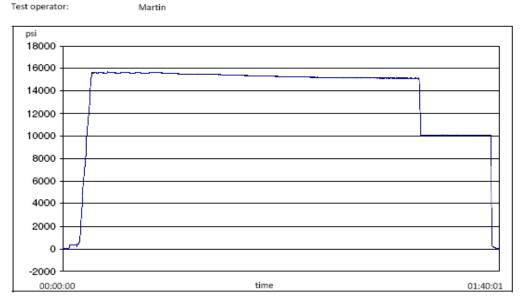

Filename: D:\Certificates\Report_082722-H2-082722-1.pdf

Page 1/2

Received by OCD: 10/29/2024 12:23:52 PM

Hose Assembly Evaluation Sheet





H2-8316

8/27/2022 8:51:22 AM

TEST REPORT

GAUGE TRACEABILITY

Description	Serial number	Calibration date	Calibration due date
S-25-A-W	110AMCLO	2022-01-10	2023-01-10
S-25-A-W	110BSEUZ	2022-03-09	2023-03-09
Comment			

Filename: D:\Certificates\Report_082722-H2-082722-1.pdf

Page 2/2

.

Received by OCD: 10/29/2024 12:23:52 PM



Hose Assembly Evaluation Sheet

Gates).

APPENDIX 2: Certificate of Conformance



GATES ENGINEERING & SERVICES NORTH AMERICA 7603 Prairie Oak Dr. Houston, TX. 77086 PHONE: +1 (281) 602-4100 FAX: +1 (281) 602-4147 EMAIL: gesna.quality@gates.com WEB: www.gates.com/ollandgas

CERTIFICATE OF CONFORMANCE

This is to verify that the items detailed below meet the requirements of the Customer's Purchase Order referenced herein, and are in Conformance with applicable specifications, and that Records of Required Tests are on file and subject to examination. The following items were inspected and hydrostatically tested at **Gates Engineering & Services North America** facilities in Houston, TX, USA.

CUSTOMER:HELMERICH & PAYNE, INCCUSTOMER P.O.#:740398454 (88000240 | SN:70035)CUSTOMER P/N:88000240 | SN:70035PART DESCRIPTION:INSPECT AND RETEST CUSTOMER HOSE 3IN X 35FT CHOKE & KILL ASSEMBLY C/W 4-1/16FLANGES BX155 RING GROOVE EACH END525035QUANTITY:1SERIAL #:H2-082722-1 RE-TEST

SIGNATURE:	CAUCIC	
TITLE:	QUALITY ASSURANCE	
DATE:	8/27/2022	

OXY's Minimum Design Criteria

Burst, Collapse, and Tensile SF are calculated using Landmark's Stress Check (Casing Design) software. A sundry will be requested if any lesser grade or different size casing is substituted.

1) Casing Design Assumptions

a) Burst Loads

CSG Test (Surface)

- Internal: Displacement fluid + pressure required to comply with regulatory casing test pressures. This will comply with both 43 CFR part 3170 Subpart 3172 and 19.15.16 of the OCD Rules.
- External: Pore pressure in open hole.

CSG Test (Intermediate)

- Internal: Displacement fluid + pressure required to comply with regulatory casing test pressures. This will comply with both 43 CFR part 3170 Subpart 3172 and 19.15.16 of the OCD Rules.
- External: Mud Weight to TOC, cement mix water gradient (8.4 ppg) below TOC, and pore pressure in open hole.

CSG Test (Production)

- o Internal:
 - For Drilling: Displacement fluid + pressure required to comply with regulatory casing test pressures. This will comply with both 43 CFR part 3170 Subpart 3172 and 19.15.16 of the OCD Rules.
 - For Production: The design pressure test should be the greater of (1) the planned test pressure prior to stimulation down the casing. (2) the regulatory test pressure, and (3) the expected gas lift system pressure. The design test fluid should be the fluid associated with pressure test having the greatest pressure.
- o External:
 - For Drilling: Mud Weight to TOC, cement mix water gradient (8.4 ppg) below TOC, and pore pressure in open hole.
 - For Production: Mud base-fluid density to TOC, cement mix water gradient (8.4 ppg) below TOC, and pore pressure in open hole.

Gas Column (Surface)

- Internal: Assumes a full column of gas in the casing with a Gas/Oil Gradient of 0.1 psi/ft in the absence of better information. It is limited to the controlling pressure based on the fracture pressure at the shoe or the maximum expected pore pressure within the next drilling interval, whichever results in a lower surface pressure.
- External: Fluid gradient below TOC, pore pressure from the TOC to the Intermediate CSG shoe (if applicable), and MW of the drilling mud that was in the hole when the CSG was run from Intermediate CSG shoe to surface.

Bullheading (Surface / Intermediate)

- Internal: The string must be designed to withstand a pressure profile based on the fracture pressure at the casing shoe with a column of water above the shoe plus an additional surface pressure (in psi) of 0.02 X MD of the shoe to account for pumping friction pressure.
- External: Mud weight to TOC, cement mix water gradient (8.4 ppg) below TOC, and pore pressure in open hole.

Gas Kick (Intermediate)

- The string must be designed to at least a gas kick load case unless the rig is unable to detect a kick. For the gas kick load case, the internal pressure profile must be based on a minimum volume of 50 bbl or the minimum kick detection capability of the rig, whichever is greater, and a kick intensity of 2.0 ppg for Class 1, 1.0 ppg of Class 2, and 0.5 ppg for Class 3 and 4 wells.
- Internal: Influx depth of the maximum pore pressure of 0.55 "gas kick gravity" of gas to surface while drilling the next hole section.
- External: Mud weight to the TOC, cement mix water gradient below TOC, and pore pressure in open hole.

Tubing Leak Near Surface While Producing (Production)

- o Internal: SITP plus a packer fluid gradient to the shoe or top of packer.
- External: Mud base-fluid density to TOC, cement mix water gradient (8.4 ppg) below TOC, and pore pressure in open hole.

Tubing Leak Near Surface While Stimulating (Production)

- Internal: Surface pressure or pressure-relief system pressure, whichever is lower plus packer fluid gradient.
- External: Mud base-fluid density to TOC, cement mix water gradient (8.4 ppg) below TOC, and pore pressure in open hole.

Injection / Stimulation Down Casing (Production)

- o Internal: Surface pressure plus injection fluid gradient.
- External: Mud base-fluid density to TOC, cement mix water gradient (8.4 ppg) below TOC, and pore pressure in open hole.
- **b)** Collapse Loads

Lost Circulation (Surface / Intermediate)

- Internal: Lost circulation at the TD of the next hole section, and the fluid level falls to a depth where the hydrostatic of the mud equals pore pressure at the depth of the lost circulation zone.
- \circ External: MW of the drilling mud that was in the hole when the casing was

run. Cementing (Surface / Intermediate / Production)

- o Internal: Displacement fluid density.
- External: Mud weight from TOC to surface and cement slurry weight from TOC to casing shoe.

Full Evacuation (Production)

- Internal: Full void pipe.
- External: MW of drilling mud in the hole when the casing was run.

c) Tension Loads

Running Casing (Surface / Intermediate / Production)

 Axial: Buoyant weight of the string plus the lesser of 100,000 lb or the string weight in air.

Green Cement (Surface / Intermediate / Production)

• Axial: Buoyant weight of the string plus cement plug bump pressure load.

Generated on April 25, 2024



CONNECTION DATA SHEET

OD: 5.500 in. Weight: 20.00 lb/ft Drift: 4.653 in. (API) Wall Th.: 0.361 in.

Grade: P110 RY



Semi-Flush

Make-up Torque (ft-lb) 20,000 MIN 22,500 **OPTI** 25,000 MAX

Torque with Sealability (ft-lb) 36,000 MTS

Locked Flank Torque (ft-lb) 4,500 **MIN** 15,750 **MAX**

(2) MTS: Maximum Torque with Sealability.

PIPE BODY PROPERTIES

Nominal OD	5.500	in.
Nominal ID	4.778	in.
Nominal Wall Thickness	0.361	in.
Minimum Wall Thickness	87.5	%
Nominal Weight (API)	20.00	lb/ft
Plain End Weight	19.83	lb/ft
Drift	4.653	in.
Grade Type	Controlle	ed Yield
Grade Type Minimum Yield Strength	Controlle	ed Yield <i>ksi</i>
Minimum Yield Strength	110	ksi
Minimum Yield Strength Maximum Yield Strength	110 125	ksi ksi
Minimum Yield Strength Maximum Yield Strength Minimum Ultimate Tensile Strength	110 125 140	ksi ksi ksi
Minimum Yield Strength Maximum Yield Strength Minimum Ultimate Tensile Strength Pipe Body Yield Strength	110 125 140 641	ksi ksi ksi klb

CONNECTION PROPERTIES

Connection Type	Semi-Pr	emium Integral Sen
Nominal Connection OD	5.783	in.
Nominal Connection ID	4.718	in.
Make-up Loss	5.965	in.
Tension Efficiency	90	% Pipe Body
Compression Efficiency	90	% Pipe Body
Internal Pressure Efficiency	100	% Pipe Body
External Pressure Efficiency	100	% Pipe Body

JOINT PERFORMANCES

Tension Strength	577	klb
Compression Strength	577	klb
Internal Pressure Resistance	12,640	psi
External Pressure Resistance	11,110	psi
Maximum Bending, Structural	78	°/100 ft
Maximum Bending, with Sealability(1)	30	°/100 ft

(1) Sealability rating demonstrated as per API RP 5C5 / ISO 13679



BOOST YOUR EFFICIENCY, REDUCE COSTS AND ENSURE 100% WELL INTEGRITY WITH VAM® FIELD SERVICE

Scan the QR code to contact us



The information available on this Site (Information) is offered for general information. It is supposed to be correct at the time of publishing on the Site but is not intended to constitute professional advice and is provided 'as is'. Vallourec does not guarantee the completeness and accuracy of this Information. Under no circumstances will Vallourec be liable for damage, liability of any kind, or any loss or injury that may result from the credibility given to this Information or use the low and the services are subject to Vallourec's The Information may be amended, corrected, and/or supplemented at any time that the services are subject to Vallourec's The Information or supplemented at any time that the services are subject to Vallourec's The Information or supplemented at any time that the services are subject to Vallourec's The Information and the services are subject to Vallourec's The Information are supplemented at any time that the services are subject to Vallourec's The Information or supplemented at any time that the services are subject to Vallourec's The Information are subject to Vallourec's The Information are supplemented at any time that the services are subject to Vallourec's the Information are supplemented at any time that the services are subject to Vallourec's the Information are supplemented at any time that the services are subject to Vallourec's the Information are supplemented at any time that the services are subject to Vallourec's the Information are supplemented at any time that the services are subject to Vallourec's the Information are supplemented at any time that the services are subject to Vallourec's the Information are supplemented at any time that the services are subject to Vallourec's the Information are supplemented at any time that the services are subject to Vallourec's the Information are supplemented at any time that the services are subject to Vallourec's the Information are supplemented at any time that the services are subject to Vallourec's the Information are supp

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	396749
	Action Type:
	[C-101] BLM - Federal/Indian Land Lease (Form 3160-3)

CONDITIONS

Created By	Condition	Condition Date
pkautz	File As Drilled C-102 and a directional Survey with C-104 completion packet.	11/3/2024
pkautz	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string.	11/3/2024
pkautz	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system.	11/3/2024
pkautz	Cement is required to circulate on both surface and intermediate1 strings of casing.	11/3/2024
pkautz	If cement does not circulate on any string, a Cement Bond Log (CBL) is required for that string of casing.	11/3/2024

Action 396749