Phone: (505) 476-3441 General Information	AM State of New Mexico Energy, Minerals and Natural Resources	Form C-103 Revised July 18, 2013	
Phone: (505) 629-6116 Online Phone Directory Visit: https://www.emnrd.nm.gov/ocd/contact-us/	OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505	WELL API NO. 30-015-10630 5. Indicate Type of Lease STATE FEE 6. State Oil & Gas Lease No.	
(DO NOT USE THIS FORM FOR PROPOSAL	ES AND REPORTS ON WELLS LS TO DRILL OR TO DEEPEN OR PLUG BACK TO A TION FOR PERMIT" (FORM C-101) FOR SUCH	7. Lease Name or Unit Agreement Name Resler Yates State	
PROPOSALS.) 1. Type of Well: Oil Well G	as Well Other	8. Well Number #341	
2. Name of Operator	ergy (Jackie Brewer DBA)	9. OGRID Number 154329	
3. Address of Operator P.O. Box 71 Lovington, 1		10. Pool name or Wildcat (3230) Artesia; Queen-Grayburg-San Andre s	
4. Well Location	100200	in the state of th	
Unit Letter N ::_	990feet from theSouth line and	feet from the _Westline	
Section 29	Township 18S Range 28E	NMPM Eddy County	
	11. Elevation (Show whether DR, RKB, RT, GR, e	etc.)	
12. Check Ap	propriate Box to Indicate Nature of Notice	e, Report or Other Data	
TEMPORARILY ABANDON	PLUG AND ABANDON 📉 REMEDIAL WO	PRILLING OPNS. P AND A	
	ed operations. (Clearly state all pertinent details, a.). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.		
Please see attached p	rocedure & wellbore schematics		
Spud Date:	Rig Release Date:		
hereby certify that the information about	ove is true and complete to the best of my knowled	dge and belief.	
SIGNATURE	TITLE	DATE	
Гуре or print name	E-mail address:	PHONE:	
.	TITLE	DATE	

Mewbourne Oil Company

Plug and Abandon

Wellname:	Resler Yates State 341	#		
Location:	990' FSL & 1650' FWL;Sec N-NM	-29-18S-28E; Eddy Co,		
Date:	August 7, 2025			
API #:	30-015-10630	Surf Csg Set:	7" 23# J-55	
Csg Size:	4 1/2" 9.5# J-55	Set @:	519'	
Set @:	2000'	Inter #1:		
Perfs:	1964'-1978' (28 shots)	Set @:		


Well is to be plugged & abandoned.

Procedure:

- 1. MIRU plugging crew.
- 2. ND WH & NU BOP.
- 3. RIH w/tbg & set CIBP @ 1950'
- 4. Circulate capacity of MLF (35 bbls).
- 5. Test csg to 500# for 30 mins.
- 6. POOH w/tbg & MIRU WL.
- 7. Run cmt bond log & verify tops of cmt.
- 8. POOH & RDMO WL
- 9. RIH w/tbg & spot 35 sks Class C neat cmton CIBP (±466').
- 10. WOC 6 hrs & tag plug @ 1484' or higher (Top Queen @ 1534').
- 11. POOH w/tbg to 570' & circulate 40 sks Class C neat cmt (±570').
- 12. WOC 6 hrs & confirm that wellbore remains full.
- 13. Cut off WH & install dry hole marker. Cut off anchors & clean location.


RESLER YATES STATE #341- P&A Procedure

990 FSL & 1650 FWL Sec N-29-18S-28E, Eddy Co, NM API 30-015-10630

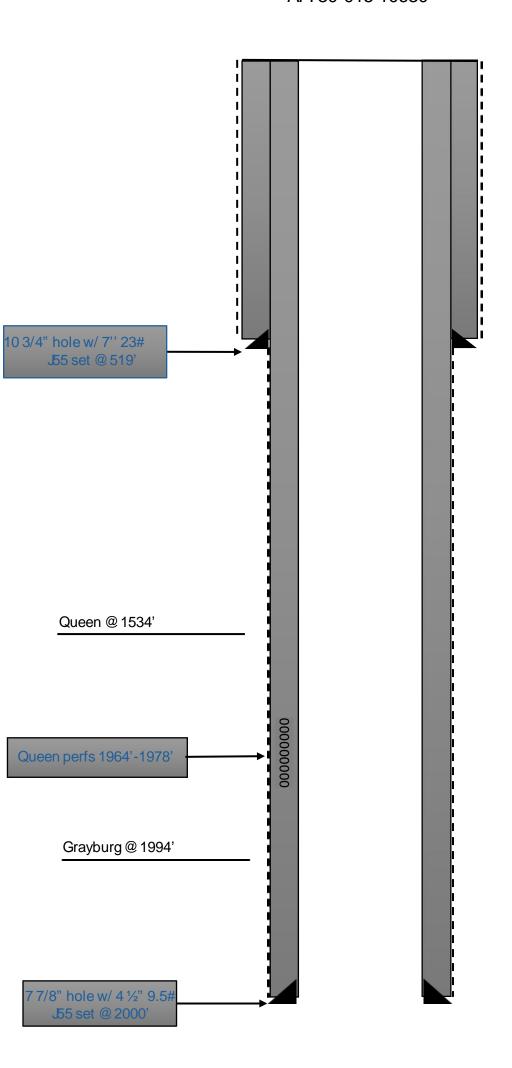

RESLER YATES STATE #341- P&A Procedure

990 FSL & 1650 FWL Sec N-29-18S-28E, Eddy Co, NM API 30-015-10630

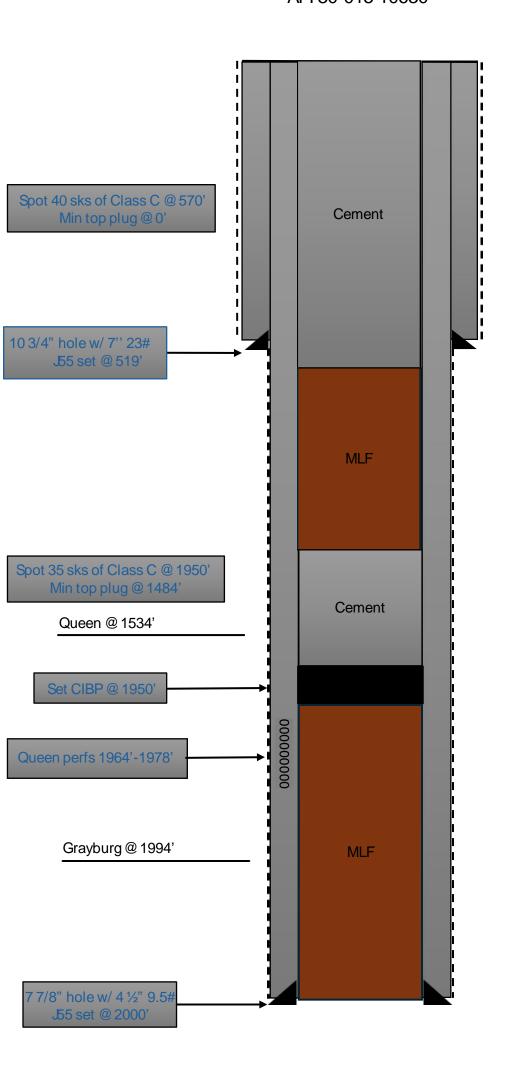

Santa Fe Main Office Phone: (505) 476-3441	State of New Mexico Energy, Minerals and Natural Resources	Form C-103 Revised July 18, 2013
General Information Phone: (505) 629-6116	Lifergy, wither als and ivaluation resources	WELL API NO.
Online Phone Directory Visite	OIL CONSERVATION DIVISION	30-015-10630
Online Phone Directory Visit: https://www.emnrd.nm.gov/ood/contact-us	1220 South St. Francis Dr.	5. Indicate Type of Lease
	Santa Fe, NM 87505	STATE FEE 6. State Oil & Gas Lease No.
		o. Saite on te das nease no.
(DO NOT USE THIS FORM FOR PROPOSALS DIFFERENT RESERVOIR. USE "APPLICATION"	S AND REPORTS ON WELLS S TO DRILL OR TO DEEPEN OR PLUG BACK TO A ON FOR PERMIT" (FORM C-101) FOR SUCH	7. Lease Name or Unit Agreement Name Resler Yates State
	Well Other	8. Well Number #341
Name of Operator Sandlott Ene	rgy (Jackie Brewer DBA)	9. OGRID Number 154329
3. Address of Operator P.O. Box 71		10. Pool name or Wildcat (3230)
Lovington, N		Artesia; Queen-Grayburg-San Andre
4. Well Location		
Unit LetterN:_	990feet from theSouthline and _	
Section 29	Township 188 Range 28E	NMPM Eddy County
1	1. Elevation (Show whether DR, RKB, RT, GR, e	dc.)
12. Check App	ropriate Box to Indicate Nature of Notice	. Report or Other Data
NOTICE OF INTE	•	BSEQUENT REPORT OF:
	LUG AND ABANDON 🖾 REMEDIAL WO	
		RILLING OPNS. P AND A
	ULTIPLE COMPL CASING/CEME	NT JOB
DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM		
OTHER:	□ OTHER:	
	d operations. (Clearly state all pertinent details, a	
	SEE RULE 19.15.7.14 NMAC. For Multiple C	ompletions: Attach wellbore diagram of
proposed completion or recomp	eletion.	
Please see attached pro	ocedure & wellbore schematics	
Spud Date:	Rig Release Date:	
		·····
I heraby cartify that the information 1		as and half of
increase certary that the information above	ve is true and complete to the best of my knowled	ge and benet.
SIGNATURE CONTINUE	TITLE	DATE 10-9-2025
Transcentists and Control of the Con		
Type or print name For State Use Only	E-mail address:	PHONE:

TITLE

DATE_

APPROVED BY:
Conditions of Approval (if any):

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 519779

CONDITIONS

Operator:	OGRID:
MEWBOURNE OIL CO	14744
P.O. Box 5270	Action Number:
Hobbs, NM 88241	519779
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
loren.diede	Notify the OCD inspection supervisor via email 24 hours prior to beginning Plug & Abandon (P&A) operations.	10/27/2025
loren.diede	NMOCD does not consider this well to be within the LPCH restricted area and an above ground P&A marker is required. NMOCD requires that plug(s) be added to cover the 7 Rivers = (930') and Yates = (600') formation tops. Submit photo and GPS coordinates of the P&A marker with the final P&A reports. The API# on the marker is to be clearly legible. Run CBL from CIBP to surface. Submit the CBL tif file to NMOCD for uploading into the Well Log File.	