

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

Online Phone Directory Visit:
<https://www.emnrd.nm.gov/oed-contact-us>

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-015-20088
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Resler Yates State
8. Well Number #367
9. OGRID Number 154329
10. Pool name or Wildcat (3230) Artesia; Queen-Grayburg-San Andre s

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
Sandlott Energy (Jackie Brewer DBA)

3. Address of Operator P.O. Box 711
Lovington, NM 88260

4. Well Location
Unit Letter F : 1650 feet from the North line and 2310 feet from the West line
Section 32 Township 18S Range 28E NMPM Eddy County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attached procedure & wellbore schematics

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Brewer TITLE _____ DATE 11/2/2025

Type or print name _____ E-mail address: _____ PHONE: _____

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____

Conditions of Approval (if any):

Mewbourne Oil Company

Plug and Abandon

Submitted By:
Steven Cooley

Wellname: **RESLER YATES STATE #367**

Location: 1650 FNL & 2310 FWL, F-32-18S-28E, Eddy Co,
NM

Date: August 7th, 2025

API #: 30-015-20088

Surf Csg Set: 7" 17# J-55

Csg Size: 4 1/2" 9.5# J-55

Set @: 454'

Set @: 2058'

Perfs: 2003-2017' (28 shots)

Well is to be plugged & abandoned.


Procedure:

1. MIRU plugging crew.
2. ND WH & NU BOP.
3. POOH w/tbg (set at 2000')
4. MIRU WL. RIH w/WL & set CIBP @ 1970'
5. POOH w/WL
6. Fill csg & test to 500 psi
7. RIH w/WL & run CBL from btm to surface
8. RIH w/tbg & Circulate WB capacity MLF (35 bbl)
9. Tag CIBP & Spot 35 sks Class C neat cmt. (\pm 506')
10. POOH w/tbg to 1000'
11. WOC 6 hrs & tag plug @ 1464' or higher (Top Queen @ 1564')
12. POOH w/ tbg to 504' & spot 35 sks Class C neat cmt. (\pm 504' 7" shoe @ 454')
13. POOH w/tbg
14. WOC 6 hrs & confirm that WB remains full.
15. Cut off WH & install dry hole marker. Cut off anchors & clean location.


RESLER YATES STATE #367 P&A Schematic

1650 FNL & 2310 FWL, F-32-18S-28E, Eddy Co, NM

API 30-015-20088

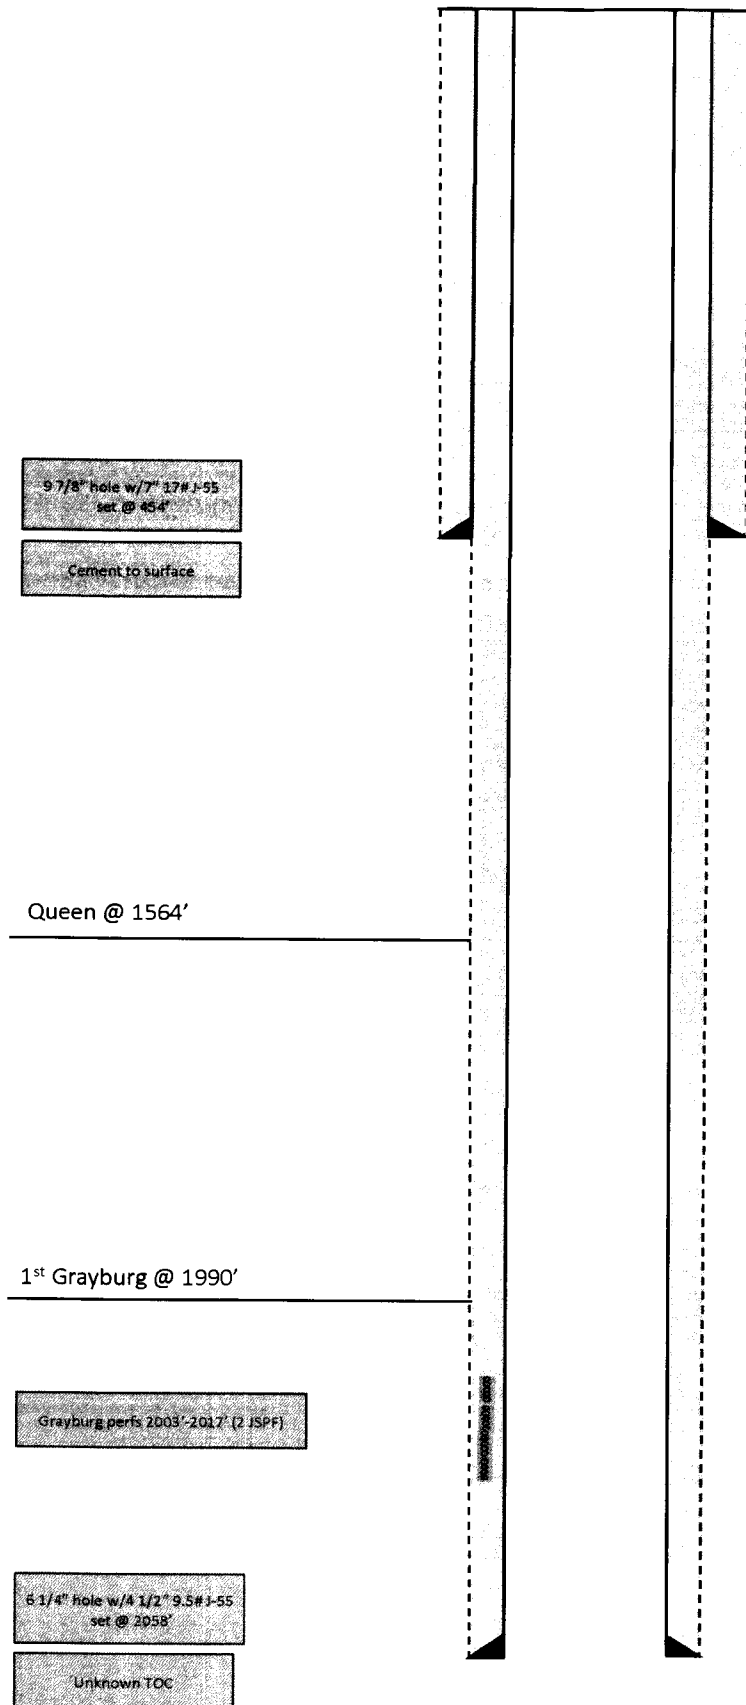

RESLER YATES STATE #367 P&A Schematic

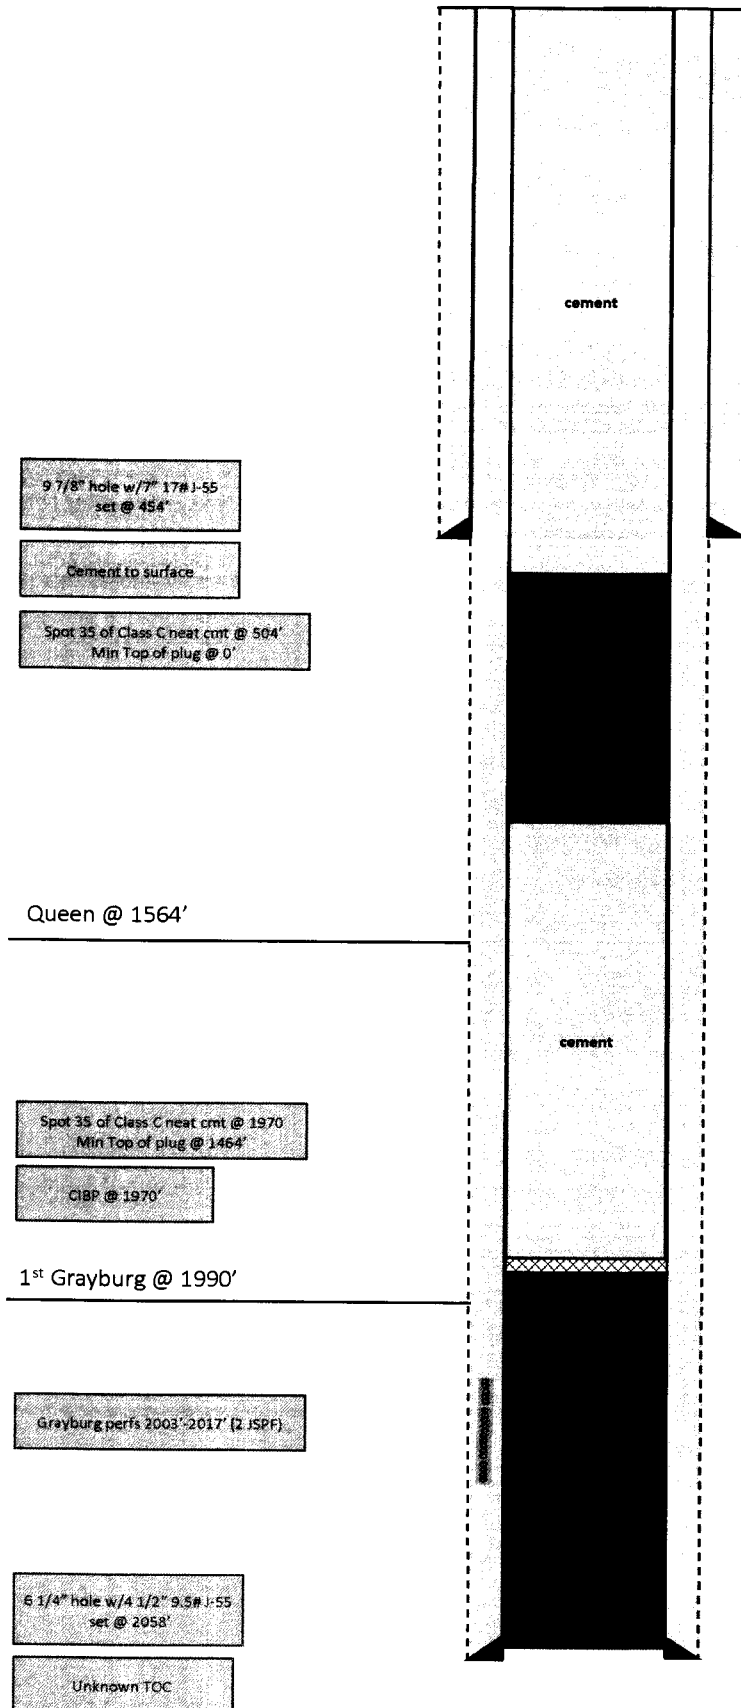1650 FNL & 2310 FWL, F-32-18S-28E, Eddy Co, NM
API 30-015-20088

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 524500

CONDITIONS

Operator: MEWBOURNE OIL CO P.O. Box 5270 Hobbs, NM 88241	OGRID: 14744
	Action Number: 524500
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
loren.diede	Notify the OCD inspection supervisor via email 24 hours prior to beginning Plug & Abandon (P&A) operations.	11/14/2025
loren.diede	NMOCD does not consider this well to be within the LPCH restricted area and an above ground P&A marker is required. NMOCD requires that plug(s) be added to cover the 7 Rivers = (965') and Yates = (605') formation tops. Submit photo and GPS coordinates of the P&A marker with the final P&A reports. The API# on the marker is to be clearly legible. Run CBL from CIBP to surface. Submit the CBL tif file to NMOCD for uploading into the Well Log File.	11/14/2025