U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Report

Well Name: RDX FEDERAL 21 Well Location: T26S / R30E / SEC 21 /

NESW / 32.025833 / -103.8895153

County or Parish/State: EDDY /

Well Number: 32

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM102917

Unit or CA Name:

Unit or CA Number:

US Well Number: 3001540642

Operator: WPX ENERGY PERMIAN

Notice of Intent

Sundry ID: 2876082

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 09/29/2025

Time Sundry Submitted: 10:56

Date proposed operation will begin: 12/15/2025

Procedure Description:

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

rki_rdx_21_32cbl_20250929105645.pdf

RDX_FEDERAL_21_32_BLM_NOI_P_A_SIGNED_WBD_20250929105627.pdf

Well Name: RDX FEDERAL 21 Well Location: T26S / R30E / SEC 21 / County or Parish/State: EDDY /

NESW / 32.025833 / -103.8895153

Well Number: 32 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMNM102917 Unit or CA Name: Unit or CA Number:

US Well Number: 3001540642 Operator: WPX ENERGY PERMIAN

LĹC

Conditions of Approval

Specialist Review

RDX_Fed_21_32_P_A_Sundry_2876082_20251106072622.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: JEFF YOUNG Signed on: SEP 29, 2025 10:56 AM

Name: WPX ENERGY PERMIAN LLC

Title: Production Data Analyst

Street Address: 333 W SHERIDAN AVE

City: OKLAHOMA CITY State: OK

Phone: (405) 228-2480

Email address: JEFF.YOUNG@DVN.COM

Field

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: ZOTA M STEVENS BLM POC Title: Petroleum Engineer

BLM POC Phone: 5752345998 **BLM POC Email Address:** ZSTEVENS@BLM.GOV

Disposition: Approved **Disposition Date:** 11/06/2025

Signature: Zota Stevens

Revised P&A Procedure

- 1. MIRU P&A unit. POOH tubing.
- 2. Spot 25 sx CL C cmt @ 7333'-7130'. WOC and Tag (T/Bone Spring)
- 3. Set CIBP @ 5481'. Pressure Test.
- 4. Spot 25 sx CL C cmt from 5481' 5270'. WOC and Tag (DV Tool, T/Brushy Canyon)
- 5. Spot 25 sx Cl C cmt from 4606-4400'. (T/ Cherry Canyon)
- 6. Spot 25 sx Cl C cmt from 3499'-3170'. WOC and Tag. (T/Delaware, B/Salt)
- 7. Perf and Sqz 80sx Cl C from 1500'- 1280'. WOC and Tag
- 8. Perf and Sqz 115 sx Cl C from 1005'-700'. WOC and Tag (Csg Shoe, T/ Salt)
- 9. Perf and Sqz 100 sx Cl C from 100'- surface.
- 10. Cut off Wellhead and set dry hole marker.

Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB No. 1004-0137 Expires, January 31, 2018

BUREAU OF LAND MANAGEMEN	5 Lease Serial No NMNM102917		
SUNDRY NOTICES AND REPORTS ON Do not use this form for proposals to drill or a bandoned well. Use Form 3160-3 (APD) for su	to re-enter an	6 If Indian, Allottee or Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on pa		7 If Unit of CA/Agreement, Name and/or No	
1 Type of Well			
✓ Oil Well Gas Well Other		8 Well Name and No RDX FEDERAL 21 32	
2 Name of Operator WPX ENERGY PERMIAN, LLC		9 API Well No. 30-015-40642	
the second secon	(include area code) 480	10. Field and Pool or Exploratory Area BRUSHY DRAW; DELAWARE EAST	
4 Location of Well (Footage, Sec., T.R.M., or Survey Description) K-21-26S-30E 1880 FSL 1650 FWL		11 Country or Parish, State EDDY COUNTY, NM	
12. CHECK THE APPROPRIATE BOX(ES) TO IN	DICATE NATURE OF NOTI	CE, REPORT OR OTHER DATA	
TYPE OF SUBMISSION	TYPE OF AC	FION	
✓ Notice of Intent Acidize Dee ✓ Alter Casing Hyd		uction (Start/Resume) Water Shut-Off unation Well Integrity	
Subsequent Report		mplete Other	
	= .	oerarily Abandon r Disposal	
is ready for final inspection.) 1. MIRU P&A unit. POOH 2 7/8" tubing and rods from 7281'. 2. Spot 25 sx CI C from 7333'-7130'. (Bone Spring @ 7283') 3. Set CIBP @ 5481'. Tag. Circ 10# salt gel. Pressure Test 500 psi 30 4. Spot 25 sx CI C from 5481'-5270'. WOC & Tag (Perfs @ 5530', DV '5 Spot 25 sx CI C from 4606'-4400'. (Cherry Canyon @ 4556') 6. Spot 40 sx CI C from 3499'-3170'. WOC & tag. (Shoe @ 3378', Del 7 Perf @ 1500'. Sqz 80 sx CI C from 1500'-1280'. WOC & Tag. (Salad 8 Perf @ 1005', Sqz 115 sx CI C from 1005'-700'. WOC & Tag. (Shoe 9. Perf @ 100'. Sqz 35 sx CI C from 100' to surface. Verify at surface. 10. Cut wellhead off 3' BGL, set dry hole marker.	Fool @ 5531', Brushy Cany aware @ 3449', B Salt @ 3 o @ 1342')	on @ 5623')	
4. Thereby certify that the foregoing is true and correct. Name (Printed Typed) JEFF YOUNG	PRODUCTION Title		
Signature Jeff Cfoung	Date	09/29/2025	
THE SPACE FOR FED	ERAL OR STATE OF	CE USE	
Approved by			
	Title	Date	
conditions of approval, if any, are attached. Approval of this notice does not warran ertify that the applicant holds legal or equitable title to those rights in the subject leads would entitle the applicant to conduct operations thereon.	or	<u>.</u>	
itle 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any false, fictitious or fraudulent statements or representations as to any matter within		ally to make to any department or agency of the United States	

(Instructions on page 2)

GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13. Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve hydraulic fracturing operations, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.


The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

(Form 3160-5, page 2)



WELLBORE DIAGRAM - CURRENT

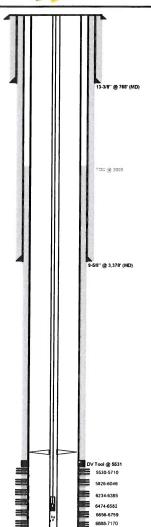

5-1/2" @ 8,148" (MD)

TD @ 8,157' (MD) PBTD @ 8,100' (MD) (8,157' TVD)

WELL:	RDX FEDERAL 21 32	OPERATOR:	WPX Energy Permian LLC	SPUD DATE:	1/8/2013	
COUNTY:	EDDY			TD:	8,157 MD (KB)	
STATE:	NM			TVD:	8,157' TVD (KB)	
API:	30-015-40642			PBTD:	8,100' MD (KB)	
LOCATION:	K-21-26S-30E 1880 FSL 1650 FWL			KB ELEVATION:	3,028.0' (19' KB)	
FIELD:	STATELINE			GL ELEVATION:	3,009.0	
FORMATION:	BRUSHY DRAW: DELAWARE EAST			SURFACE LAT/LONG:	32 0258217 / -103 889556	9

					CASING REC	ORD				
ACE CASING										
O.D.	WT./FT.	GRADE	THD	TOP	BTM	NO. JTS.	BIT SZ.	SX CMT.	TOP CMT.	COMMENT
13-3/8*	54.50#	J-55	STC	O	768'	18	17-1/2"	625	o	Circ 61 sx to surf
RMEDIATE CA	SING									
O.D.	SING WT./FT.	GRADE	THD	TOP	ВТМ	NO. JTS.	BIT SZ.	SX CMT.	TOP CMT	COMMENT
		GRADE K-55	THD LTC	TOP 0'	BTM 3,378	NO. JTS. 82	BIT SZ. 12-1/4"	SX CMT. 1,162	TOP CMT	COMMENT Circ 263 sx to surf
	WT./FT.									
O.D. 9-5/8*	WT./FT. 40.00#									
O.D.	WT./FT. 40.00#									

Date	Perf Description		
	5530-5710		
	5826-6046		
	6234-638		
	6474-6582		
	6656-6759		
	6888-7170		


RUSTLER	995
Salado	1342
Salt_Base	3268
Delaware	3449
CHERRY_CANYON	4556
BRUSHY_CANYON	5623
MADERA Sandstone	6863
L_BRUSHY	7002
1BSLM	7283

Tubing and Packer detail		Length (ft)	Top Depth (ft)	Bottom Depth (ft)	
KB Adjustment		17.00	σ	17	
2-7/8" 6.5# L-80 8rd EUE tubing	(170)	5,519.00	17.0	5,536.0	
2-7/8" Pup Jt	(1)	2.10	5,536 0'	5,538.1'	
2-7/8" 6.5# L-80 8rd EUE tubing	(2)	66.0'	5,538.1'	5,604.1"	
5-1/2" x 2-7/8" TAC	(1)	3.00	5,604.1'	5,607.1	
2-7/8" 6.5# L-80 8rd EUE tubing	(47)	1,578.0	5,607.1"	7,185.1	
2 7/8*SN	(1)	1.5	7,185.1	7,186.2	
2-7/8" Pup Jt	(1)	4.10"	7,186.2'	7,190.3	
Gas Separator	(1)	25 00	7,190.3"	7,215.3	
2-7/8" 6.5# L-80 8rd EUE tubing	(2)	65.00	7,215.3	7,280.3	
2-7/8* bull plug	(1)	0.40	7,280.3	7,280 7	
			EOT @	7,281'	

Туре	Rods	00	Length	Top Depth
l" Polished Rod - Spray Metal	1	1.000"	36"	17
1-1/4° Pony Rod	1	1.250"	3	53*
1-1/4" Pony Rod	1	1.250"	9	56
1-1/4" Pony Rod	1	1.250"	18"	65
1 1/4" Fiberglass sucker rod	97	1.240"	3,638	83"
1° Sucker rod	60	1.000*	1,500'	3,721
7/8" Sucker rods	65	0.875*	1,625	5,221'
Sinker bars	- 11	1.625"	275'	6,846
Shear tool	1	0.875"	1"	7,121
Sinker bars	1	1.625"	25'	7,122
I-1/2" Rod Centralizer	1	1.500"	4	7,147
25 x 175 RHBM Pump	1	1.750"	30'	7,151



WELLBORE DIAGRAM - PROPOSED

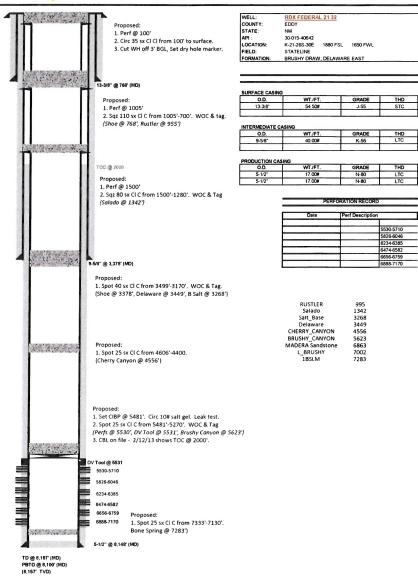

	RDX FEDERAL 21	2		OPERATOR:	WPX Energy Per	rmian LLC		SPUD DATE:	1/8/2013	
TY:	EDDY							TD:	8,157	MD (KB)
	NM							TVD:	8,157	TVD (KB)
	30-015-40642							PBTD:	8,100	MD (KB)
ION:	K-21-26S-30E 1880	FSL 1650 FWL						KB ELEVATION:	3,028.0	(19' KB)
	STATELINE							GL ELEVATION:	3,009.0	
ATION:	BRUSHY DRAW; DEL	AWARE EAST					SURI	ACE LAT/LONG:	32.0258217	/ -103.8895569
					CASING REC	ORD				
CE CASI										Too manage
O.D.	WT./FT. 54.50#	GRADE	THD	TOP	BTM	NO. JTS.	BIT SZ.	SX CMT.	TOP CMT.	COMMENT
3-3/8"	54.50#	J-55	STC	0	768'	18	17-1/2*	625	σ	Circ 61 sx to surf
										1
MEDIATE	CASING									
O.D.	WT/FT.	GRADE	THD	TOP	ВТМ	NO. JTS.	BIT SZ.	SX CMT.	TOP CMT	COMMENT
9-5/8"	40.00#	K-55	LTC	ď	3,378	82	12-1/4"	1,162	ď	Circ 263 sx to surf
CTION C										
O.D.	WTJFT.	GRADE	THD	TOP	BTM	NO. JTS.	BIT SZ.	SX CMT.	TOP CMT	COMMENT
5-1/2*	17.00#	N-80	LTC	Ø	5,531'	205	7-7/8"	525	2,000	CBL 2/12/13
5-1/2"	17.00#	N-80	LTC	5,531	8,148			525	5,531	DV Tool @ 5531
										2 2
	PER	FORATION RECORD						TUBING DETAIL		
	Date	10.15								
	Date	Perf Description			Tubing and Pac	ker detail		Length (ft)	Top Depth (ft)	Bottom Depth (ft

Tubing and Packer detail		Length (ft)	Top Depth (ft)	Bottom Depth (ft
KB Adjustment		17.00	0	17
2-7/8" 6.5# L-80 8rd EUE tubing	(170)	5,519.00	17.0	5,536 0'
2-7/8" Pup Jt	(1)	2.10	5,536.0	5,538.1'
2-7/8" 6.5# L-80 8rd EUE tubing	(2)	66.0	5,538.1	5,604.1
5-1/2° x 2-7/8° TAC	(1)	3.00	5,604.1'	5,607.1
2-7/8" 6.5# L-80 8rd EUE tubing	(47)	1,578.0'	5,607.1'	7,185.1
2 7/8*SN	(1)	1.1"	7,185.1'	7,186.2
2-7/8* Pup Jt	(1)	4.10	7,186.2	7,190.3
Gas Separator	(1)	25.00	7,190.3	7,215.3
2-7/8* 6.5# L-80 8rd EUE tubing	(2)	65.00	7,215.3	7,280.3
2-7/8° bull plug	(1)	0.40'	7,280.3	7,280.7
			EOT @	7,281'

Type	Rods	OD	Length	Top Depth
1" Polished Rod - Spray Metal	1	1.000"	36	17
1-1/4" Pony Rod	1	1.250"	3'	53'
1-1/4" Pony Rod	1	1 250"	g	56
1-1/4" Pony Rod	1	1.250"	18'	65"
1 1/4" Fiberglass sucker rod	97	1.240"	3,638"	83'
1" Sucker rod	60	1.000"	1,500	3,721
7/8" Sucker rods	65	0.875"	1,625	5,221
Sinker bars	11	1.625"	275	6,846
Shear tool	1	0.875"	1'	7,121
Sinker bars	1	1.625"	25'	7,122
1-1/2* Rod Centralizer	1	1.500"	4	7,147
25 x 175 RHBM Pump	1	1.750"	30"	7,151
			EOD	7 181'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

<u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Lea County, call 575-689-5981. Eddy County, please email notifications to: <u>BLM_NM_CFO_PluggingNotifications@BLM.GOV</u>. The Eddy County inspector on call phone, 575-361-2822, will remain active as a secondary contact.

<u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

<u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

<u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours for Class C or accelerated cement (calcium chloride) and 6 hours for Class H. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

Fluid used to mix the cement in R111Q shall be saturated with the salts common to the section penetrated, and in suitable proportions but not less than 1% and not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Above Ground Level Marker: If outside of Lesser Prairie-Chicken Habitat an above ground level marker shall be utilized. All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified BY PHONE (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 14th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

Below Ground Level Marker: If within Lesser Prairie-Chicken Habitat a below ground level marker shall be utilized. All casing shall be cutoff at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified BY PHONE (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 14th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing. The following information shall be permanently inscribed on the plate: well name and number, name of operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

Operator to verify the ground marker type with the BLM before setting dry hole Marker.

<u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was**

plugged.

Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.

For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well abandonment.

The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.

Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon

conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.

It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.

At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Angela Mohle Environmental Protection Specialist 575-234-9226

Robert Duenas Environmental Protection Specialist 575-234-2229

Terry Gregston Environmental Protection/HAZMAT Specialist 575-234-5958 Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 523676

CONDITIONS

Operator:	OGRID:
WPX Energy Permian, LLC	246289
Devon Energy - Regulatory	Action Number:
Oklahoma City, OK 73102	523676
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	Adhere to current Plug & Abandon (P&A) Conditions Of Approvals (COA).	11/19/2025