

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 1301 W. Grand Ave., Artesia, NM 88210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised March 25, 1999

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-025-03424
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-1399
7. Lease Name or Unit Agreement Name: SHELL STATE
7. Well No. 1
8. Pool name or Wildcat WILSON YATES 7 RVRS ASSOC.
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3668 KB

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
 Oil Well Gas Well Other

2. Name of Operator
 HAL J. RASMUSSEN OPERATING, INC.

3. Address of Operator
 550 W. TEXAS, SUITE 200, MIDLAND, TEXAS 79701

4. Well Location
 Unit Letter K : 1980 feet from the SOUTH line and 1980 feet from the WEST line
 Section 7 Township 21S Range 35E NMPM LEA County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
 3668 KB

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PROPOSED OPERATIONS FOR THE C-103 TO BE APPROVED.

Subject well has 5" liner set @ 3837-3645

Propose to P&A as follows:

1. Set 7" CIBP @ 3620' (just above est. 5" Liner top) + dump bail 35' cement plug (Bottom) -TAG
2. 25 sx cement plug 1650' - 1700' Perf @ 1700 & Sqz & Tag (Top Salt @ 1815')
3. 100 sx cement 40' - 140' Perf @ 140' and Sqz & Tag (Surface Shoe)
4. 10 sx surface plug w/ regulation marker

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Michael P. Jobe TITLE Agent DATE 10/01/01

Type or print name <u>Michael P. Jobe</u> (This space for State use)	BEFORE EXAMINER	Telephone No. <u>915-687-1664</u>
APPROVED BY <u>oCD</u> Conditions of approval, if any:	OIL CONSERVATION DIVISION EXHIBIT NO. <u>58</u>	DATE <u>OCT 10 2001</u>
	CASE NO: <u>12758-A</u>	

Handwritten initials or mark.

Hal J. Rasmussen Operating, Inc.


Lease SHELL STATE

Well # 1

Location: K-7-21S-35E

Formation @ TD: 7 RVRS

Formation @ PBTD: 7 RVRS

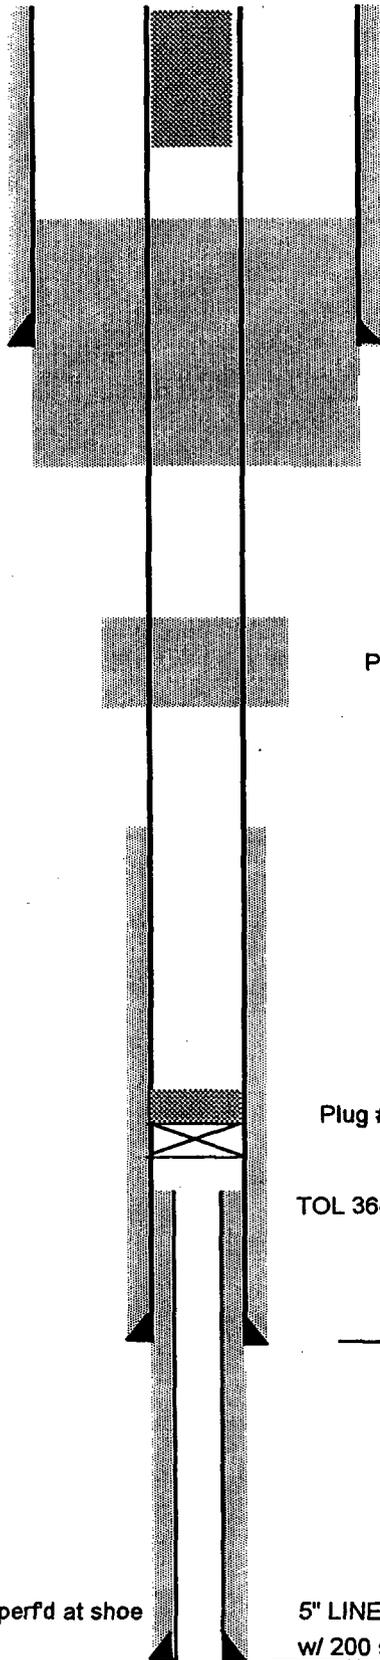

Surface plug
10 sx

15 1/2" @ 90' w/ 50 sx cmt (Circ)

Plug #3 40' - 140' Perf and Sqz. w/ 100 sx

Plug #2 1650' - 1700' Perf and Sqz. w/ 25 sx

T. Salt: 1815

TOC: 2735' Det. By: CALC

Plug #1 CIBP @ 3620' w/35' (Proposed)

TOL 3645

7" @ 3678' w/ 100 sx cmt

T.S

perfd at shoe

5" LINER 3645-3837
w/ 200 sx cmt

TD: 3842
PBD: 3837

Plug	Type	Sacks Cmnt	Depth	
			from	to
Plug #1	CIBP w/35'		3620	
Plug #2	Perf & Sqz	25 sx	1650	1700
Plug #3	Shoe Perf & Sqz	100 sx	40	140
Plug #4	Surface	10 sx		
Plug #5				
Plug #6				