
			OCD – REC'D 9	/17/2020				
B	UNITED STATES PARTMENT OF THE INTERIOR JREAU OF LAND MANAGEMENT			FORM APP OMB NO. 1 Expires: Janua 5. Lease Serial No.	004-0137			
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an				0. If Indian, Allottee or Tribe Name				
abandoned we	II. Use form 3160-3 (APL	D) for such	h proposals.					
SUBMIT IN TRIPLICATE - Other instructions on page 2					<ol> <li>If Unit or CA/Agreement, Name and/or No. NM061P3585C535</li> </ol>			
1. Type of Well ☐ Oil Well ⊠ Gas Well ☐ Other					8. Well Name and No. FEDERAL RR COM 2			
2. Name of Operator WPX ENERGY PERMIAN LLC		CAITLIN C			9. API Well No. 30-015-32657-00-S1			
3a. Address       3b. Phone No. (include a Ph: 539-573-3527         TULSA, OK 74172       2b. Phone No. (include a Ph: 539-573-3527				code)	10. Field and Pool or Exp CARLSBAD	loratory Area		
4. Location of Well (Footage, Sec., 7	., R., M., or Survey Description)	)			11. County or Parish, Stat	e		
Sec 24 T23S R26E NESE 19	30FSL 990FEL				EDDY COUNTY, N	M		
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDIO	CATE NATUR	E OF NOTIC	E, REPORT, OR OTHE	R DATA		
TYPE OF SUBMISSION			TYI	PE OF ACTION				
Notice of Intent	□ Acidize					Water Shut-Off		
Subsequent Report	□ Alter Casing	D H	Iydraulic Fractu	ring AL Reon	THAT THE MENTS AN	Well Integrity		
	Casing Repair		New Construction	AL SRee	porarity Abandon	Other		
Final Abandonment Notice	<ul> <li>Change Plans</li> <li>Convert to Injection</li> </ul>		lug Back	CHED Wate	r Disposal			
<ul> <li>testing has been completed. Final A determined that the site is ready for f WPX ENERGY PERMIAN, LI</li> <li>1. MIRU plugging equipment.</li> <li>2. POH w/ tbg &amp; Packer. RIH</li> <li>3. Spot 20 sx class H @ 1175</li> <li>4. Perf &amp; Sqz 20 sx class H @ 8775</li> <li>6. Perf &amp; Sqz 35 sx class C @</li> <li>7. Perf &amp; Sqz 35 sx class C @</li> <li>9. Perf &amp; Sqz 55 sx class C @</li> <li>9. Perf &amp; Sqz 55 sx class C @</li> <li>9. Perf &amp; Sqz 55 sx class C @</li> </ul>	Image: State Stat	D P&A the : 1 554 ' 750. Circul 14 3 0 ' 3. (9 000 5/53 ') C 1.(1918 '	above mention late hole w/ ML $p^{1} = 8833^{1}$ $5n /out)= 1733^{1}$	ed well. F. Leak 35 sx (In lout)	)			
14. I hereby certify that the foregoing i		_) .,-		1001) 00	nity e th			
	Electronic Submission # For WPX ENE nmitted to AFMSS for proc	RGY PERM	IIAN LLC, sent	to the Carlsbac	i 20 (20PP4106SE)			
Signature (Electronic	Submission)			10/2020	USE Accepted for record -	- NMOCD gc 9/23/202		
Approved By Long Vo Conditions of approval, it any, are attach ertify that the applicant holds legal or ec which would entitle the applicant to cond	ed. Approval of this notice does uitable title to those rights in the	s not warrant e subject leas	or	troleum CFC	Engineer	Date 9/15/202		
Fitle 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a statements or representations as	crime for an to any matte	y person knowing er within its jurisd	ly and willfully to iction.	make to any department or ag	ency of the United		
(Instructions on page 2)	/ISED ** BLM REVISE	D ** BI M	REVISED **		ED ** BI M REVISED	**		
	JOED DEWIKEVIJEI			SENI ILEVIO				

# Additional data for EC transaction #529568 that would not fit on the form


32. Additional remarks, continued

Spot 20 sx class C 100 - surface.
 Cut off wellhead and weld on Dry Hole Marker.

Please see the attached for the current and proposed WBDs.

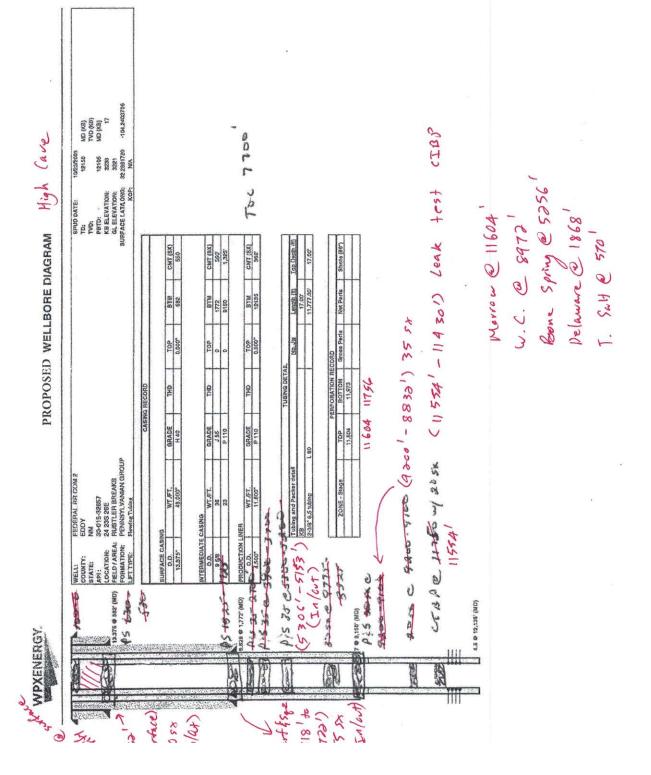

CURRENT WELLBORE DIAGRAM

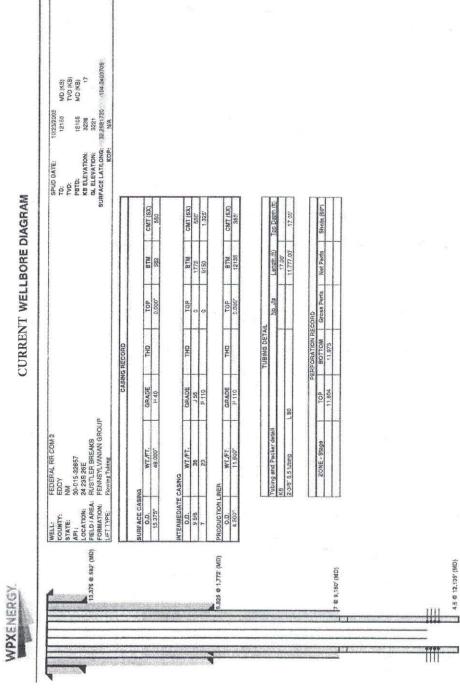

### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

#### Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



# United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

### **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Melissa Horn Environmental Protection Specialist 575-234-5951

Kelsey Wade Environmental Protection Specialist 575-234-2220

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

Form 3160-5 (June 2015)       UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT         SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.         SUBMIT IN TRIPLICATE - Other instructions on page 2         1. Type of Well         Oil Well S Gas Well Other         2. Name of Operator         WPX ENERGY PERMIAN LLC         E-Mail: caitlin.ohair@wpxenergy.com         3a. Address 3500 ONE WILLIAMS CENTER MD 35 TULSA, OK 74172         3b. Phone No. (include area code) Ph: 539-573-3527         4. Location of Well (Footage, Sec., T., R., M., or Survey Description)         Sec 24 T23S R26E NESE 1980FSL 990FEL					FORM APPROVED         OMB NO. 1004-0137         Expires: January 31, 2018         5. Lease Serial No.         NMNM027994D         6. If Indian, Allottee or Tribe Name         7. If Unit or CA/Agreement, Name and/or No.         NM061P3585C535         8. Well Name and No.         FEDERAL RR COM 2         9. API Well No.         30-015-32657-00-S1         10. Field and Pool or Exploratory Area         CARLSBAD         11. County or Parish, State         EDDY COUNTY, NM		
12. CHECK THE AF	PROPRIATE BOX(ES)	TO INDICA	TE NATURE OI	F NOTICE,	REPORT, OR OTI	HER D	АТА
TYPE OF SUBMISSION			TYPE OF	FACTION			
Image: Subsequent Report <ul> <li>Acidize</li> <li>Alter Casing</li> <li>Hydraulic Fracturing</li> <li>Reclamation</li> <li>Well Integrity</li> </ul> <li>Subsequent Report</li> <li>Change Plans</li> <li>Plug and Abandon</li> <li>Temporarily Abandon</li> <li>Convert to Injection</li> <li>Plug Back</li> <li>Water Disposal</li> <li>Convert to Injection</li> <li>Convert to Injection</li> <li>Convert to Injection</li> <li>Plug Back</li> <li>Integrity or complete operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BL//BLA. Required subsequent reports must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.</li> <li>WPX ENERGY PERMIAN, LLC respectfully requests to P&amp;A the above mentioned well.</li> <li>MIRU plugging equipment. ND WH. NU BOP.</li> <li>POH w/ tbg &amp; Packer. RIH and set 4 1/2 CIBP @ 11750. Circulate hole w/ MLF.</li> <li>Spot 20 sx class H @ 11750-11500.</li> <li>Perf &amp; Sqz 35 sx class C @ 5300-5200.</li> <li>Perf &amp; Sqz 35 sx class C @ 3800-3700.</li> <li>Perf &amp; Sqz 35 sx class C @ 1825-1725. WOC &amp; Tag.</li> <li>Perf &amp; Sqz 55 sx class C @ 1825-1725. WOC &amp; Tag.</li> <li>Perf &amp; Sqz 55 sx class C @ 630-5300. WOC &amp; Tag.</li>						Vell Integrity ther uration thereof. kers and zones. thin 30 days t be filed once	
14. I hereby certify that the foregoing is Corr Name(Printed/Typed) CAITLIN C	Electronic Submission # For WPX ENE nmitted to AFMSS for proc	RGY PERMIA	NLLC, sent to the SCILLA PEREZ or	e Carlsbad	(20PP4106SE)		
Signature (Electronic S	,		Date 09/10/20				
	THIS SPACE FO			OFFICE US	SE		
Approved By LONG VO Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to conduit Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s	uitable title to those rights in the act operations thereon. U.S.C. Section 1212, make it a	e subject lease	TitlePETROLE	ł			Date 09/15/2020

# \*\* BLM REVISED \*\*

## Additional data for EC transaction #529568 that would not fit on the form

#### 32. Additional remarks, continued

- Spot 20 sx class C 100 surface.
   Cut off wellhead and weld on Dry Hole Marker.

Please see the attached for the current and proposed WBDs.

## Revisions to Operator-Submitted EC Data for Sundry Notice #529568

	Operator Submitted	BLM Revised (AFMSS)
Sundry Type:	ABD NOI	ABD NOI
Lease:	NMNM027994D	NMNM027994D
Agreement:		NM061P3585C535 (NMNM72497)
Operator:	WPX ENERGY PERMIAN, LLC 3500 ONE WILLIAMS CENTER MD 35 TULSA, OK 74103 Ph: 539-573-3527	WPX ENERGY PERMIAN LLC 3500 ONE WILLIAMS CENTER MD 35 TULSA, OK 74172 Ph: 855 979 2012
Admin Contact:	CAITLIN O'HAIR REGULATORY SPECIALIST E-Mail: caitlin.ohair@wpxenergy.com Cell: 918-891-5617 Ph: 539-573-3527	CAITLIN O'HAIR REGULATORY TECH II E-Mail: caitlin.ohair@wpxenergy.com Ph: 539-573-3527
Tech Contact:	CAITLIN O'HAIR REGULATORY SPECIALIST E-Mail: caitlin.ohair@wpxenergy.com Cell: 918-891-5617 Ph: 539-573-3527	CAITLIN O'HAIR REGULATORY TECH II E-Mail: caitlin.ohair@wpxenergy.com Ph: 539-573-3527
Location: State: County:	NM EDDY	NM EDDY
Field/Pool:	CARLSBAD; MORROW, SOUTH	CARLSBAD
Well/Facility:	FEDERAL RR COM 002 Sec 24 T23S R26E 1980FSL 990FEL 32.288284 N Lat, 104.241096 W Lon	FEDERAL RR COM 2 Sec 24 T23S R26E NESE 1980FSL 990FEL