

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 811 South First, Artesia, NM 88210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised March 25, 1999

OIL CONSERVATION DIVISION
 2040 South Pacheco
 Santa Fe, NM 87505

WELL API NO. 30-105-20829
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. K-6290
7. Lease Name or Unit Agreement Name: AIRPORT GRACE
8. Well No. 1
9. Pool name or Wildcat CARLSBAD, CANYON, SOUTH

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG A WELL IN A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-103) FOR SUCH PROPOSALS.)


1. Type of Well:
 Oil Well Gas Well Other

2. Name of Operator
 Lynx Petroleum Consultants, Inc.

3. Address of Operator
 P.O. Box 1708, Hobbs, NM 88241

4. Well Location
 Unit Letter K : 1980 feet from the South line and 2164 feet from the West line
 Section 36 Township 22S Range 26E NMPM Eddy County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
 3221' GR

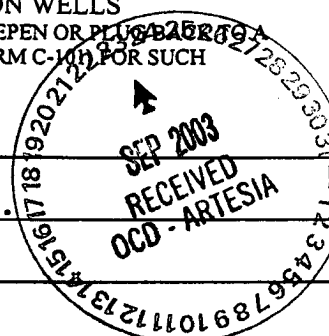

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
MULTIPLE COMPLETION <input type="checkbox"/>	OTHER: RECOMPLETION <input checked="" type="checkbox"/>
OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

9/8/03: PLUG BACK AS FOLLOWS:

1. NU BOPE. Pulled packer and tubing.
2. Set 7" C.I.B.P. at 10395' and dumped 35' cement on top.
3. Perforate Canyon 10200'-05' w/4jspf. Ran tubing and packer to 10133' and swabbed well dry with no show.
4. Set 7" C.I.B.P. at 10160' and dumped 35' cement on top.
5. Perforated Canyon 9862'-66' w/4jspf. Ran tubing and packer to 9790' and swabbed well dry with slight gas show.
6. Acidized with 1000 gals 15% HCL. Swabbed back load. Put well on test.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Marc Wise TITLE President DATE 9/22/03

Type or print name Marc Wise Telephone No. 505-392-6950

APPROVED BY Jim W. Gunn TITLE District Supervisor DATE SEP 27 2003

Conditions of approval, if any: