Form 3160-5 (June 2015)

# UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

<b>A</b>	IIREAILOE LAND MANAC	SEMENT	·	1 1 .	LAPIECS. J	anuary 31, 2016						
SUNDRY	NOTICES AND REPOR	RTS ON WI		Hobb	5. Lease Serial No. NMNM15321							
BUREAU OF LAND MANAGEMENT  SUNDRY NOTICES AND REPORTS ON WELCE Hobb  Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or Tribe Name							
SUBMIT IN TRIPLICATE - Other instructions on page 2  1. Type of Well Oil Well Gas Well Other  2. Name of Operator Contact: ERIC HANSEN					7. If Unit or CA/Agreement, Name and/or No.  8. Well Name and No. RED HILLS FEDERAL 501H  9. API Well No.							
							KAISER FRANCIS OIL COMPANY E-Mail: EricH@KFOC.net			30-025-46422-00-X1		00-X1
							3a. Address		3b. Phone No Ph: 918-49	o. (include area code) 91-4339		
TULSA, OK 74121-1468				· · · · · · · · · · · · · · · · · · ·								
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)						or Parish, State						
Sec 31 T25S R33E 2165FSL 32.085747 N Lat, 103.618744	L		LEA COUNTY,	LEA COUNTY, NM								
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTI	HER DATA						
TYPE OF SUBMISSION			TYPE OF	OF ACTION								
Notice of Intent	☐ Acidize	☐ Dee	pen	☐ Product	ion (Start/Resume)	☐ Water Shut-Off						
Notice of Intent	☐ Alter Casing	☐ Hyd	☐ Hydraulic Fracturing ☐ New Construction		ation	☐ Well Integrity  ☑ Other						
☐ Subsequent Report	□ Casing Repair	□ New			olete							
☐ Final Abandonment Notice	Change Plans	☐ Plug and Abandon ☐		☐ Temporarily Abandon		Change to Original A PD						
	☐ Convert to Injection	Plug	g Back	☐ Water D	Disposal							
following completion of the involved testing has been completed. Final At determined that the site is ready for fi Kaiser Francis Oil Company rethe well listed below.	pandonment Notices must be filed in all inspection.	d only after all	requirements, includi	ing reclamation	n, have been completed a	and the operator has						
Red Hills 501H					•	OCA						
APD# 10400041669					HOBBE	1 2019						
Kaiser Francis Oil Company well Red Hills 402H and Red Hills 402H and Red Hills be drilled identical to the 4	Hills 403H was drilled with 03H. Additional BOP and v	a 5,000 PSI	annular BOP, the nformation is atta	e Red Hills ( sched.	imilar 501H DEC	OCD 102019 ECEIVED						
Il other previous	s Conditions	of has	nutu st	ill aix	NIX. UN							
14. I hereby certify that the foregoing is	Electronic Submission #49	91346 verifie	by the BLM Well	Information	System							
Com	For KAISER FRA Imitted to AFMSS for proces	ANCIS OIL CO ssing by PRI	OMPANY, sent to SCILLA PEREZ on	the Hobbs 11/06/2019	(20PP0328SE)							
Name (Printed/Typed) ERIC HANSEN			Title DRILLING ENGINEER									
Signature (Electronic S	ubmission)		Date 11/06/20	019								
	THIS SPACE FO	R FEDERA	L OR STATE (	OFFICE US	SE							
_Approved_By_DYLAN_RQSSMANG	GQ		TitlePETROLE	JM ENGINE	ER	Date 11/15/2019						
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office Hobbs									

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2) \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*


Additional data for EC transaction #491346 that would not fit on the form

32. Additional remarks, continued

Kaiser Francis Oil Co. request a variance to use a 5K psi annular BOP with a 10K BOP stack. Attached are Kaiser Francis Oil Co. minimum processes required to assure a proper shut-in while drilling, tripping, open hole, and moving BHA through the BOPs. A minimum of one well control drill will be performed weekly per tour, to regulate compliance with well control procedures and plans. Drills will be determined by operations, and will variate on drills conducted. Drills will consist of but are not limited to pit, trip, open hole, and choke drills. This well control plan will be available for review to all rig personnel. A copy of well control plan will be located in the Kaiser Francis Oil Co. representative's office on location, and on the rig floor during drilling operations. All BOP equipment will be tested per Onshore O&G Order No. 2 with the exception of the 5K annular which will be tested to 70% of it rated working pressure.

## A. BOP Diagram

10M BOP with 5M Annular Kaiser Francis Oil Company Hole Sections Utilized \*12 1/4" Hole below Surface Casing \*8 3/4"-8 1/2" Hole below Intermediate casing

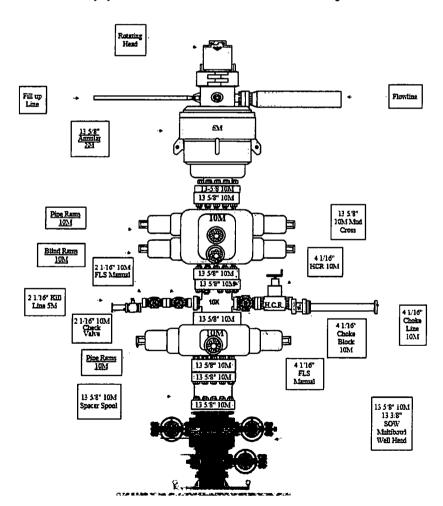

## **B.** Component and Preventer Compatibility Table

Component	OD	Preventer	RWP
Drill Pipe	4 1/2"	Upper VBR: 3.5 – 5.5 Lower VBR: 3.5 – 5.5	10M
Heavyweight Drill Pipe	4 1/2"	Upper VBR: 3.5 – 5.5 Lower VBR: 3.5 – 5.5	10M
Drill Collars & MWD Tools	6 1/4"-4 ¾"	Annular Upper VBR: 3.5 – 5.5 Lower VBR: 3.5 – 5.5	5M 10M 10M
Mud Motor	8"-4 3/4"	Annular Upper VBR: 3.5 – 5.5 Lower VBR: 3.5 – 5.5	5M 10M 10M
Production Casing	5 1/2"	Upper VBR: 3.5 – 5.5 Lower VBR: 3.5 – 5.5	10M
Surface Casing	10-3/4"	Annular	5M
Intermediate Casing	7-5/8	Annular	5M
All	0 – 13 5/8"	Annular	5M
Open Hole		Blind Rams	10M

#### C. Well Control Procedures

- I. General Procedures While Drilling:
  - a. Sound alarm alert crew
  - b. Space out drill string
  - c. Shut down pumps and stop rotary
  - d. Open HCR
  - e. Shut well in, utilizing upper VBRs
  - f. Close choke
  - g. Confirm shut in
  - h. Notify rig manager and KFOC, Inc. company representative
  - i. Call KFOC, Inc. engineer
  - j. Read and record:
    - i. Shut in drill pressure and shut in casing pressure
    - ii. Pit gain
    - iii. Time
  - k. Regroup, identify forward plan

## II. General Procedures While Tripping:

- a. Sound alarm alert crew
- b. Stab full opening safety valve and close
- c. Space out drill string
- d. Open HCR

- e. Shut well in, utilizing upper VBRs
- f. Close choke
- g. Confirm shut in
- h. Notify rig manager and KFOC. company representative
- i. Call KFOC. engineer
- i. Read and record:
  - i. Shut in drill pressure and shut in casing pressure
  - ii. Pit gain
  - iii. Time
- k. Regroup, identify forward plan

### III. General Procedures While Running Casing:

- a. Sound alarm alert crew
- b. Stab full opening safety valve and close
- c. Space out drill string
- d. Open HCR
- e. Shut well in, utilizing upper VBRs
- f. Close choke
- g. Confirm shut in
- h. Notify rig manager and KFOC company representative
- i. Call KFOC engineer
- j. Read and record:
  - i. Shut in drill pressure and shut in casing pressure
  - ii. Pit gain
  - iii. Time
- k. Regroup, identify forward plan

## IV. General Procedures With No Pipe in Hole (Open Hole):

- a. Sound alarm alert crew
- b. Open HCR
- c. Shut well in with blind rams
- d. Close choke
- e. Confirm shut in
- f. Notify rig manager and KFOC company representative
- g. Call KFOC engineer
- h. Read and record:
- i. Shut in drill pressure and shut in casing pressure
  - ii. Pit gain
  - iii. Time
- j. Regroup, identify forward plan

#### V. General Procedures While Pulling BHA Through BOP Stack:

- 1. Prior to pulling last joint of drill pipe through stack A.
  - Perform flow check and if flowing:
    - a. Sound alarm alert crew
    - b. Stab full opening safety valve and close
    - c. Space out drill string with tool joint just beneath upper pipe ram

- d. Open HCR
- e. Shut well in utilizing upper VBRs
- f. Close choke
- g. Confirm shut in
- h. Notify rig manager and KFOC company representative
- i. Call KFOC engineer
- i. Read and record:
  - i. Shut in drill pressure and shut in casing pressure
  - ii. Pit gain
  - iii. Time
- k. Regroup, identify forward plan
- 2. With BHA in the BOP stack and compatible ram preventer and pipe combo immediately available.
  - a. Sound alarm alert crew
  - b. Stab full opening safety valve and close
  - c. Space out drill string with tool joint just beneath upper pipe ram
  - d. Open HCR
  - e. Shut well in utilizing upper VBRs
  - f. Close choke
  - g. Confirm shut in
  - h. Notify rig manager and KFOC. company representative
  - i. Call KFOC engineer
  - j. Read and record:
    - i. Shut in drill pressure and shut in casing pressure
    - ii. Pit gain
    - iii. Time
  - k. Regroup, identify forward plan
- 3. With BHA in the BOP stack and no compatible ram preventer and pipe combo immediately available
  - a. Sound alarm alert crew
  - b. If possible to pick up high enough, pull string clear of the stack and follow Open Hole scenario (III)
  - c. If impossible to pick up high enough to pull the string clear of the stack:
    - i. Stab crossover, make up one joint/stand of drill pipe and full opening safety valve and close
    - ii. Space out drill string with tool joint just beneath the upper pipe ram
    - iii. Open HCR
    - iv. Shut in utilizing upper VBRs
    - v. Close choke
    - vi. Confirm shut in
    - vii. Notify rig manager and Mesquite SWD, Inc. company representative
    - viii. Read and record:
      - 1. Shut in drill pipe pressure and shut in casing pressure
      - 2. Pit gain
      - 3. Time

d. Regroup and identify forward plan

<sup>\*\*</sup> If annular is used to shut in well and pressure build to or is expected to get to 50% of RWP, confirm space-out and swap to upper VBRs for shut in.