

COPIES RECEIVED	
DISTRIBUTION	
STATE FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. OG-5798

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT --" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- Dry Hole	7. Unit Agreement Name
2. Name of Operator Hondo Oil & Gas Company	8. Farm or Lease Name State "BK"
3. Address of Operator P. O. Box 1978, Roswell, New Mexico 88201	9. Well No. 1
4. Location of Well UNIT LETTER L 1980 FEET FROM THE South LINE AND 660 FEET FROM West LINE, SECTION 3 TOWNSHIP 14-S RANGE 34-E N.M.P.M. Undesig.	10. Field and Pool, or Wildcat w/c/Upper Pennr.
15. Elevation (Show whether DF, RT, GR, etc.) 4140' DF	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

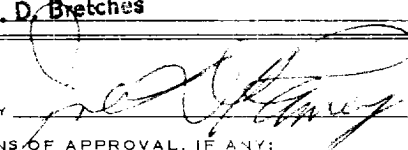
This well was drilled (8-3/4" hole) to a T.D. of 10530' without encountering commercial hydrocarbons. We propose to P & A by setting the following neat Incor cement plugs:

40 sx 10380-10280 (Top of Penn)	40 sx 2928-2858 (9-5/8" csg stub)
40 sx 9735- 9635 (Top of w/c)	25 sx 1885-1910 (top of salt)
40 sx 7980- 7880 (Top of Abo)	35 sx 380- 430 (13-3/8" csg shoe)
40 sx 5790- 5690 (Top of Glorieta)	10 sx 15- 30
40 sx 4542- 4442 (9-5/8" csg shoe)	

9.8#/gal gel mud will be used to spot all plugs. Location will be cleared and dry hole marker erected. 9-5/8" casing will be recovered; 13-3/8" casing will remain intact.

Verbal permission was received for above program from Mr. L. A. Clements 2/7/69.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Original Signed SIGNED O. D. Bretches	TITLE Dist. Drlg. Supervisor	DATE 2-10-69
APPROVED BY 	TITLE	DATE
CONDITIONS OF APPROVAL, IF ANY:		