

SUPPLEMENTAL WELL REPORT

P&A

E-K QUEEN UNIT #3-4

E. K. QUEEN UT #3-4, E. K. Queen Field, Lea Co. NM. OBJECTIVE:
P&A.

1-2-74 4432 TD

MIRU DA&S DDU, POH w/ CL tbg & pkr, set CIBP @ 4340, cap
w/5x cmt 4340-4305, ran tbg OE to 4250, SDFN & holiday.

1-3-74 w/tubing @ 4250 loaded hole w/10.0# mud spot 25sx Class H
cement @ 3202-2987, 25sx Class H cement 1711-1500

1-4-74 Shot 5½ csg @ 700, work loose, P & LD 1 jt of csg, SDFN.

1-5-74 P & LD 21 jts 5½ csg, ran 2-3/8 tbg OE to 750, spot 25x
reg cmt 750-638, 30x 342-242, & 10x 10' to surf, inst'l
State marker, RD, Rel unit 4 pm 1-4-74. Well P&A 1-4-74.
FINAL REPORT.



Job separation sheet

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPI
(Other instructions
verse side)

TE*
re-

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC 065 394

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☐ GAS WELL ☐ OTHER **WIW**

2. NAME OF OPERATOR

Mobil Oil Corporation

3. ADDRESS OF OPERATOR

Box 633, Midland, Texas 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

Unit M, 660' FSL, 660' FWL Sec 18, T-18-S, R-34-E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4019 GR

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

E.K. Queen Unit Tr. 3

9. WELL NO.

4

10. FIELD AND POOL OR WILDCAT
E. K. Yates Seven Rivers (Queen)

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 18, T-18-S, R-34-E

12. COUNTY OR PARISH 18. STATE

Lea

New Mexico

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☒

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Plug and abandon as per attached recommendation

18. I hereby certify that the foregoing is true and correct

SIGNED

Christina L. Tucker

TITLE

Proration Clerk

DATE

11-13-73

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

APPROVED

NOV 27 1973

ARTHUR R. BROWN
DISTRICT ENGINEER

*See Instructions on Reverse Side

Instructions


General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963-O-665229

667-851

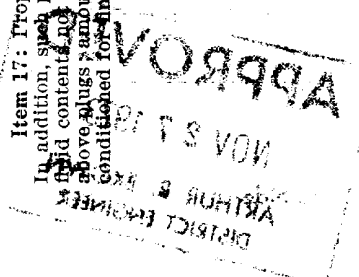

L. WORK RECOMMENDATIONS
Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: E-K Queen Unit Tract 2 Well No. 4
Field: E-K Queen Pool
County: Lea State: New Mexico

RECOMMENDED PROCEDURE:

1. Set CIBP @ 4340' and cap w/ 5sx cement
2. Circulate hole to mud using 25 cu gal per 100 bbls water
3. Spot 25 sx (USGS minimum) plug from 3200' up to 3075'± (Base of salt)
4. Spot 25 sx plug from 1700' up to 1575'± (Top of Anhydrite)
5. Attempt to cut and pull 5½" csg. to 900' or above

If successful - spot 35 sx plug across 5½" stub @ 850' seat (100 per cent)

If not successful - spot 25 sx plug in 5½" from 400' up to 275'±

6. Spot 10 sx plug at surface
7. Set monuments and clean location

Notes: 1. Procedure reviewed and approved by A.R. Brown, USGS@Hobbs

2. Notify USGS in Hobbs, #393-3612 24 hrs before starting

10/10-13-75