

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-24089
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Chevron USA, Inc.		6. State Oil & Gas Lease No. 858150
3. Address of Operator 15 Smith Rd. Midland, Tx 79705		7. Lease Name or Unit Agreement Name: West Vacum Unit
4. Well Location Unit Letter L : 1980 feet from the south line and 490 feet from the west line Section 34 Township 17-S Range 34-E NMPM County Lea		8. Well No. 126
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Vacum Grayburg San Andres


11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPLETION ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24hrs prior to MI & RU.
2. RIH Tag 5 1/2 CIBP @ 4388, spot 25sx plug 4388-4200(Grayburg-San andres)WOC Tag.
3. Displace hole w/MLF, 9.5 # Brine w/25# Gel P/BBL.
4. Spot 25sx plug 3900-3700(Queen)
5. Spot 25sx plug 2700-2500(Yates, B-salt)WOC Tag.
6. Spot 25sx plug 1690-1490(8 5/8 shoe,T-salt)WOC Tag.
7. Perf 4 holes @ 300, sqz 75sx plug 300-surf 5 1/2 X 8 5/8 csqs. WOC Tag.
8. Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

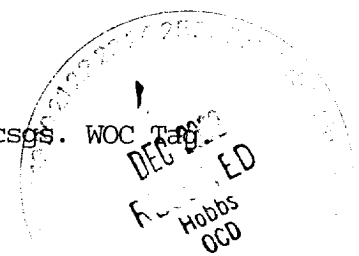

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE D.R. Mahme TITLE HES Specialist DATE 12/19/2002

Type or print name

Telephone No.

(This space for State use)

APPROVED BY

ORIGINAL SIGNED BY

GARY W. WINK

DEC 30 2002

Conditions of approval, if any:

OC FIELD REPRESENTATIVE II/STAFF MANAGER

PLUGGING & ABANDONMENT WORKSHEET (2 STRING CSNG)

OPERATOR CHEVRON USA Inc.

LEASE NAME WEST VACUM UNIT


WELL # 126

SECT 34 TWN 17-S RNG 34-E

FROM 1980 N5L 490 EWL

TD 8850 FORMATION @ TD ABO

PBTD FORMATION @ PBTD G.S.A.

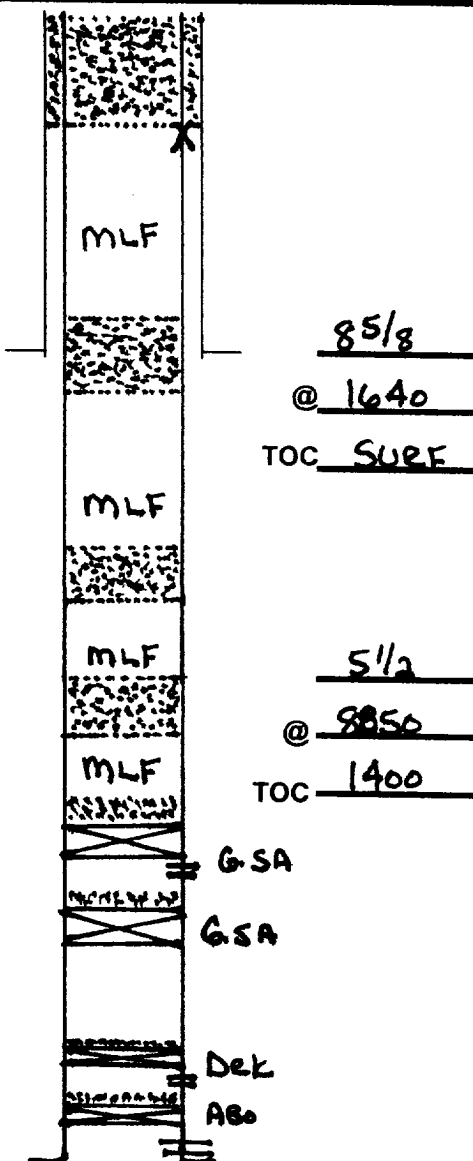

8 5/8

@ 1640

TOC SURF

5 1/2

@ 8850

TOC 1400

G.S.A.

G.S.A.

Dek

ABO

TD 8850

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	8 5/8	1640	SURF	Ciec
INTMED 1				
INTMED 2				
PROD	5 1/2	8850	1400	CALC

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL		TOP - BOTTOM
INTMED 1		PERFS	4508 - 4545
INTMED 2		OPENHOLE	
PROD			

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	*			
YATES	1	G.S.A.	25	4388
QUEEN	2	QUEEN	25	3900
GRAYBURG	3	B-SALT	25	2700
SAN ANDRES	4	8 5/8 S	25	1690
	5	SURF	75	300
CAPTAN REEF	*			
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA	*			
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				

