

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE
(Other instructions on
reverse side)

Form approved
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC 065447

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ Injection Well	7. UNIT AGREEMENT NAME Teas Yates Unit
2. NAME OF OPERATOR Anadarko Production Company	8. FARM OR LEASE NAME Tract 3
3. ADDRESS OF OPERATOR Box 806, Eunice, New Mexico 88231	9. WELL NO. 4
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 990' FNL & 1650' FEL	10. FIELD AND POOL, OR WILDCAT Teas
14. PERMIT NO.	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 13-20S-33E
15. ELEVATIONS (Show whether DE, RT, GR, etc.) 3608 GL	12. COUNTY OR PARISH Lea
	13. STATE N. Mex

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐
REPAIR WELL ☐	CHANGE PLANS ☐
(Other) ☐	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Move in and rig up drlg. rig.
2. Cleaned out to 3520'.
3. Dresser Atlas ran GR-CNL & Caliper.
4. Ran 3511' 4 1/2" 10.50# J-55 csg. Halliburton cmt. w/880 sks. cmt. D.V. tool @ 2813'.
5. Dresser Atlas perforated w/1 JSPF 3306-11, 3314-20, 3326-34, 3340-46, 3360-67, 3373-91, 3399-3406, 3469-74, 3478-84'.
6. Acidized perms w/3000 gals 15% Reg. acid.
7. Ran 105 jts. 2-3/8" 8R-4.7# Salta Lined tubing and 4 1/2" Guiberson packer set packer @ 3241' w/15,000# tension 2-26-75.
8. RDPV

18. I hereby certify that the foregoing is true and correct

SIGNED *R. A. Anderson*

TITLE Area Supervisor


DATE 5-30-75

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

*See Instructions on Reverse Side

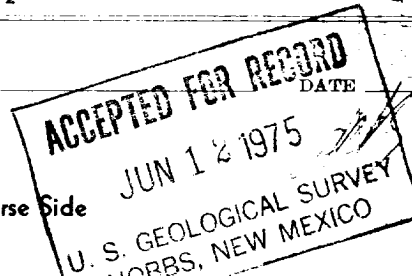

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.