Form 3160-5 (April 2004)	UNITED STATES 1625 DEPARTMENT OF THE INTERIOR HO BUREAU OF LAND MANAGEMENT		viexico Oll Co 1625 f Hob	USCRVATION WWW.Block, District I . French FORM& PPROVED DM BN. 1004-0137 S. NNI SELECTMArch 31, 2007 5. Lease Sorial No.	
	RY NOTICES AND RE			6. If Indian, Allottee or Tribe Name	
	well. Use Form 3160 - 3 (				
	RIPLICATE- Other inst	ructions on reve	rse side.	7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well Oil Well	Gas Well		· · · ·	8. Well Name and No.	
2. Name of Operator OXY USA	Inc.	- <u></u>	16696	Bluit Scu Andres 13 Federic 1# 9. API Well No.	
3a. Address P.O. Box 50250 Midland, TX 79710		3b. Phone No. (include area code) 432-685-5717		<u>30-041-20852</u> 10. Field and Pool, or Exploratory Area	
4. Location of Well (Footage, Se	c., T., R., M., or Survey Description)		/	Bluitt Sun Andres (HSSex)	
1980 FNL 1980	FWL SENW(F)	Sec 13 T85	R37E/	11. County or Parish, State Rocsevelt WM	
12. CHECK	APPROPRIATE BOX(ES) TO	INDICATE NATU	RE OF NOTICE, R	EPORT, OR OTHER DATA	
TYPE OF SUBMISSION		TYPE OF ACTION			
Notice of Intent	Acidize Alter Casing Casing Repair Change Plans	Deepen Fracture Treat New Construction Plug and Abandon	Production (Sta Reclamation Recomplete Temporarily Al	Well Integrity	
Final Abandonment Notice		Plug Back	Water Disposal		
HOBBS OCD MAR 1 4 2013	TD-4820' PBTD-459 8-5/8" 20# csg @ 514 5-1/2" 14# csg @ 482	1' w/ 310sx, 12-1/4	" hole, TOC-Surf-C	Circ	
RECEIVED	1. RIH & set CIBP @ 4 2. M&P 25sx cmt @ 3 3. M&P 25sx cmt @ 2 4. M&P 80sx cmt @ 5 10# MLF betweer	2208-2086' WOC-T 564' to surface		ECirculate MLF EDFOR <u>3</u> MONTH PERIOD JUN 1 1 2013	
14. I hereby certify that the fo	oregoing is true and correct				
Name (Printed/Typed) David Stewar		Title I	Regulatory Advisor		
Signature	f.	Date	3/4/13		
	THIS SPACE FOR	FEDERAL OR S	TATE OFFICE	USE	
	VID R. GLAS re attached. Approval of this notice		PETROLEUM E	Date MAN 11 Long	
which would entitle the applican Title 18 U.S.C. Section 1001 and 7	gal or equitable title to those rights i to conduct operations thereof the itle 43 U.S.C. Section 1212, make it a fulent statements or representations	$\frac{3}{15/20}$ $\frac{3}{15/20}$	nowingly and willfully	WELL FIELD OFFICE to make to any department or agency of the United	
(Instructions on page 2)		J-C	n Jaccodivelvili. <u>Tempid in mich tie junger i 1</u>	n19	
		~		MAR 10 shis	

, , , OXY USA Inc. - Proposed Bluitt San Andres 13 Federal #6 API No. 30-041-20852


80sx @ 564'-Surface

25sx @ 2208-2086' WOC-Tag

25sx @ 3850-3700' WOC-Tag

CIBP @ 4454' w/ 25sx to 4305'

CIBP @ 4610' w/ 2sx cmt

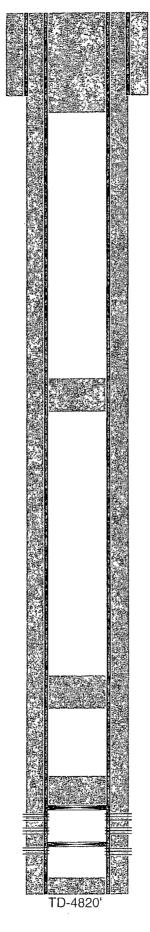


12-1/4" hole @ 514' 8-5/8" csg @ 514' w/ 310sx-TOC-Surf-Circ

7-7/8" hole @ 4820' 5-1/2" csg @ 4820' w/ 1320sx-TOC-Surf-Circ

Perfs @ 4504-4579'

Perfs @ 4625-4659'

OXY USA Inc. - Current Bluitt San Andres 13 Federal #6 API No. 30-041-20852

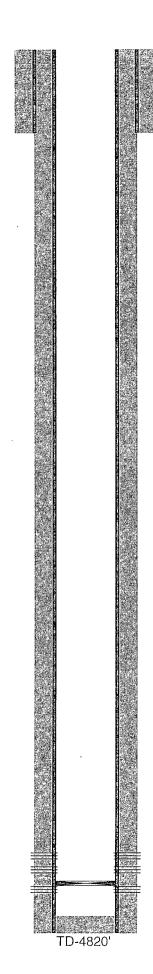

12-1/4" hole @ 514' 8-5/8" csg @ 514' w/ 310sx-TOC-Surf-Circ

7-7/8" hole @ 4820' 5-1/2" csg @ 4820' w/ 1320sx-TOC-Surf-Circ

Perfs @ 4504-4579'

Perfs @ 4625-4659'

CIBP @ 4610' w/ 2sx cmt

## BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90<sup>th</sup> day provide the BLM Roswell Field Office (RFO), prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.

2. <u>Notification</u>: Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. <u>Monument:</u> Upon abandonment of the well, all casing shall be cut-off at the base of the cellar or 3-feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. <u>Timing Limitation Lease Stipulation / Condition of Approval For Lesser Prairie-Chicken:</u> Oil and gas activities including 3-D geophysical exploration, and drilling will not be allowed in lesser prairie-chicken habitat during the period from March 1 through June 15 annually. During that period, other activities that produce noise or involve human activity, such as the maintenance of oil and gas facilities, geophysical exploration other than 3-D seismic operations, and pipeline, road, and well pad construction, will be allowed except between 3:00 am and 9:00 am. The 3:00 am to 9:00 am restriction will not apply to normal, around-the-clock operations, such as venting, flaring, or pumping, which do not require a human presence during this period. Additionally, no new drilling will be allowed within up to 200 meters of leks known at the time of permitting. Normal vehicle use on existing roads will not be restricted. Exhaust noise from pump jack engines must be muffled or otherwise controlled so as not to exceed 75 db measured at 30 feet from the source of the noise.

8. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.