Form 3160-5 (March 2012)

UNITED STATES

DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

0	OH	Co	tserv	<i>ration</i>	Div			4
	16	9E 10	Jr 1801		332	OMB No.	1004-0137	-

	_			* 425 mm (5* #	W 74 7 1 1	778775489	5 ⁴ (0044) 137
167	5	N	100	man and aren	Buch	()10113 140	ctober 31, 20
440	w	7.4	ι Д'	1 1 1 1 1 1 1 1	APBRE	Zionires (etober 31. ZU

				TWO ires:	Octobe
Bar and	En 1	MIN Sef	POND!	160	

	AND DEDOOT	O ON MELLO
SUNDRY NOTICES	AND KEPOK I	2 ON MELL2

Do not use this f	OTICES AND REP orm for proposals Use Form 3160-3 (A	ORTS ON WELLS to drill or to re-enter ar APD) for such proposa		NM 02218 6 If Indian, Allottee or 1 N/A	Tribe Name	
SUBMI	TIN TRIPLICATE - Othe	er instructions on page 2.		7. If Unit of CA/Agreem N/A	nent, Name and/or No.	
1. Type of Well		R	ECEIVED	IN/A		
Oil Well Gas W	ell Other	·	VEU	Well Name and No. EL ZORRO E FEDI	ERAL #004	
2. Name of Operator HALCON HOLD	DINGS, INC			9. API Well No. 30-041-00169		
Ba. Address	. 650	3b. Phone No. (include area code)		10. Field and Pool or Exploratory Area		
5100 E. SKELLY DRIVE, SUITE TULSA, OK 74135	. 000	(918) 663-2800	٠.	ALLISON; SAN AN	IDRES, EAST	
 Location of Well (Footage, Sec., 17.,1980' FNL & 1980' FEL SEC. 28, T08S, R37E 	R.,M., or Survey Descriptio	n) ,		11. County or Parish, Sta ROOSEVELT COL		
12. CHEC	K THE APPROPRIATE B	OX(ES) TO INDICATE NATUR	E OF NOTIC	E, REPORT OR OTHER	R DATA	
TYPE OF SUBMISSION		TY	PE OF ACT	ION		
Notice of Intent Acidize		. Deepen	Produ	iction (Start/Resume)	Water Shut-Off	
Notice of Intent	Alter Casing	Fracture Treat	Recla	mation	Well Integrity	
Subsequent Report	Casing Repair	New Construction	Reco	mplete	Other	
sassaquent report	Change Plans	Plug and Abandon	☐ Temp	orarily Abandon		
Final Abandonment Notice Convert to Injectio		Plug Back	☐ Water	ter Disposal		

New Mexic

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

WELL WAS COMPLETED IN THE BOUGH C SAND ON 10/26/1960. THE ZONE WAS ABANDONED IN 1972 AND WAS RECOMPLETED IN THE SAN ANDRES. THIS FORMATION HAS NOW BECOME UNECONOMIC TO PRODUCE. A GEOLOGIC REVIEW INDICATES THERE ARE NO OTHER POTENTIAL UPHOLE ZONES. PLEASE SEE ATTACHED THE PROPOSED SUMMARY TO PLUG AND ABANDON, PROPOSED WELLBORE DIAGRAM AND A CURRENT WELLBORE DIAGRAM. THE ESTIMATED STARTING DATE TO PERFORM THIS WORK IS APRIL 15, 2013. ALL WORK IS TO BE PERFORMED UNDER BLM BOND NO. WYB000905; RIDER NO. SUR0003902.

Halcon Holdings Inc. Is Not The Approved BLM Operator But Is Approved To Do The Downhole Plugging Of This Well For Ram Energy Inc. Approval To Change Operator

APPROVED FOR 3 MONTH PERICO JUN 12 2013

is Configent On Halcon Bond Increase.	
14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)	
STEPHEN MILINICHIK	Title SR: OPERATIONS ENGINEER
Signature AMuluwul	Date 02/21/2013
THIS SPACE FOR FEDE	RAL OR STATE OFFICE USE
/S/ DAVID R. GLASS	Title PETROLEUM ENGINEER Date MAR 1 2 2013
Conditions of approval, if any, are attached. Approval of this notice does not warrant or co	

Title 18 U.S.C. Section 1001 and Pitte 43 U. compfor any person knowingly and willfully to make to any department or agency of the United States any false,

CONDITIONS OF APPROVAL

entitle the applicant to conduct operations thereon



APR 1 2013

BAKER OIL TOOLS INC. Current SERVING THE WORLD


DATE 6-9-92	— мет ио. —	4	LEASE	Zonno	FIELD	Husson For Hu	ozes l
		ź (-1,x	sen o	zoz z		350 sx	
	978 (450	a v	CE	MENTCIR	EVENTED		
							The second secon
							A Company of the Comp
							Associations of the second
	29/8 TUBI	NG W/ NG PE	BAKER RF@ 47	ARKER Z	ET @ 5	1618 FROM MLAUNA REA	DETE)
							:
	PERFS:	1/Fra)	85 00		16000 GAL	:
	4825,3, 4899	3,: 38, ¥	0, 70, 13	, 09, 77		10sec	
	50 % LINER 50 SK (52" CASIA BRIDGE P. 52 (25)	LEMEN Cu;	PLUE & FE FULL 9450	150-51 W 50'	500 689 ' Cemen		
10,9599						BASKET # RFOR	ATION

El Zorro E Federal #4 P&A Summary

- Contact local BLM representative at least 24 hours before starting operations
- MIRU plugging company rig.
- Contact local BLM representative at least 24 hours before starting operations (?, (?)). If available, have CBL for depth and collar correlation.
- 4. No current record of equipment left in hole. Assume anchor and tubing string.
- MIRU Wireline Service. RIH w/ 5½" gauge ring and junk basket to top of perforations @ 4825'KB. POOH. PU & RIH w/ 51/2" CIBP to 4800'KB. Set CIBP. PU & TIH w/glass bottom dump bailer w/ 5 sx Class H cement to top of plug. Spot cement on plug (Plug #1: 4800'KB).
- 6. PU & TIH w/ 2 %" workstring to top of cement @ 4759'KB. Circulate hole with fresh water. Spot 11 bbls 9.0 ppg drilling mud from 4270'- 4759'KB in 5 1/2" casing.
- 7. RIH w/ string shot and perforate casing at 4270'KB w/ 2 shots.
- 8. PU & RIH w/ 5 1/2" cement retainer to 4200'KB. Set retainer.
- PU & RIH w/ cement retainer stinger on 2 %" tubing to top of retainer @ 4200'KB.
- 10. Mix and pump 50 sx Class "H" cement into holes (Plug #2: 4170'-4270'KB). Displace cement slurry w/15 bbls fresh water (45 sx below retainer).
- 11. Leave 5 sx cement on top of retainer. 5 po \$ 40 5 x. F/2600-2500-Tag

 12. Circulate hole volume via 2 3%" tubing with 9.0 ppg drilling mud.
- 13. MIRU Wireline. RIH w/ string shot and perforate 9 %" casing at 436'KB w/ 2 shots.
- 14. Mix and pump 50 sx Class "H" cement via 9 %" casing into holes (Plug #3:336'-436'KB). Stage squeeze cement to standing pressure of 500 psi. Displace cement slurry w/26 bbls drilling mud-
- RIH w/ tubing and tag cement top ~ 336'KB.
- 16. Spot final 25 sx Class "H" cement plug from 3'-50'KB (Plug #4).
- 17. Cutoff casing(s) 3' below ground level.
- 18. Weld on ID plate with API number and date plugged (vent ID plate).

Proposed

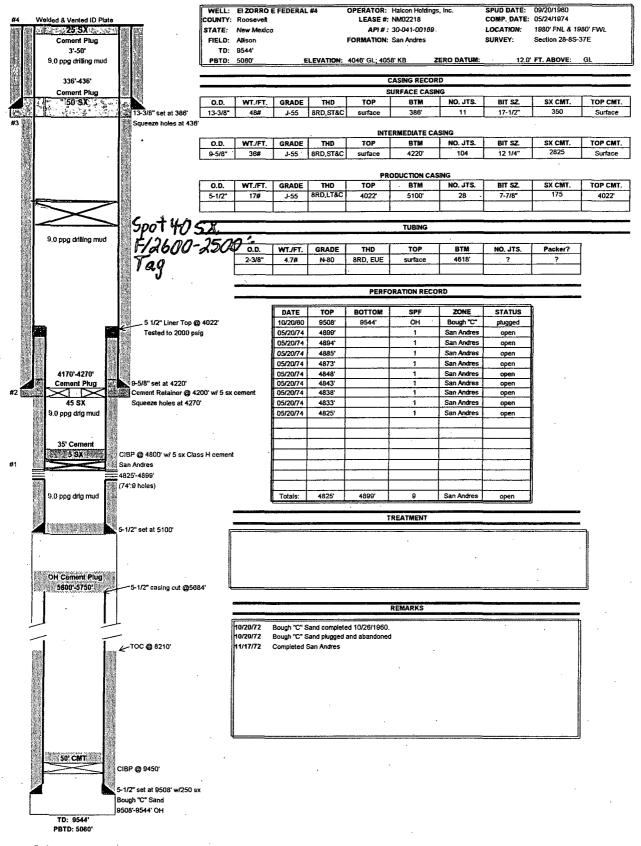

Engineer: Stephen Milinichik

Office#: (918) 632-0608

Cell#: (918) 714-1806

Prepared By: SJM

Date: 2/26/2013

Undated: 2-26-2013 SJM

BUREAU OF LAND MANAGEMENT

Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

- 1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office (RFO), prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.
- 2. <u>Notification:</u> Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.
- 3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement:</u> Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

- 6. Monument: Upon abandonment of the well, all casing shall be cut-off at the base of the cellar or 3-feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).
- 7. Timing Limitation Lease Stipulation / Condition of Approval For Lesser Prairie-Chicken: Oil and gas activities including 3-D geophysical exploration, and drilling will not be allowed in lesser prairie-chicken habitat during the period from March 1 through June 15 annually. During that period, other activities that produce noise or involve human activity, such as the maintenance of oil and gas facilities, geophysical exploration other than 3-D seismic operations, and pipeline, road, and well pad construction, will be allowed except between 3:00 am and 9:00 am. The 3:00 am to 9:00 am restriction will not apply to normal, around-the-clock operations, such as venting, flaring, or pumping, which do not require a human presence during this period. Additionally, no new drilling will be allowed within up to 200 meters of leks known at the time of permitting. Normal vehicle use on existing roads will not be restricted. Exhaust noise from pump jack engines must be muffled or otherwise controlled so as not to exceed 75 db measured at 30 feet from the source of the noise.
- 8. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.