
State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 5-27-2004

FILE IN TRIPLICATE	OIL CONSERVA	TION DIVISION		
DISTRICT I	1220 South \$	St. Francis Dr.	WELL API NO.	
1625 N. French Dr., Hobbs, NM 88240	Santa Fe,	NM 87505	30-025-34416	
DISTRICT II		HOBBS OCD	5. Indicate Type of Lease	
1301 W. Grand Aye, Artesia, NM 88210			STATE X FEE 6. State Oil & Gas Lease No.	
DISTRICT III 1000 Rio Brazos Rd, Aztec, NM 87410		.IUL 3 0 2014	6. State Off & Gas Lease No.	
r	TICES AND REPORTS ON WEL	IS	7. Lease Name or Unit Agreement Name	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BASE FIFTED				
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.)			North Hobbs (G/SA) Unit Section 33	
1. Type of Well:			8. Well No. 545	
Oil Well X Gas Well Other				
2. Name of Operator			9. OGRID No. 157984	
Occidental Permian Ltd. 3. Address of Operator			10. Pool name or Wildcat Hobbs (G/SA)	
HCR 1 Box 90 Denver City, TX 79323			10. Pool name or Wildcat Hobbs (G/SA)	
4. Well Location				
Unit Letter G : 1925	Feet From The North	Line and 2100 Feet	From The East Line	
· · · · · · · · · · · · · · · · · · ·				
Section 33 Township 18-S Range 38-E NMPM Lea County				
11. Elevation (Show whether DF, RKB, RT GR, etc.) 3638' GL				
3038 GL				
Pit or Below-grade Tank Application or Closure				
Pit Type Depth of Ground Water Distance from nearest fresh water well Distance from nearest surface water				
Pit Liner Thickness mil Below-Grade Tank: Volume bbls; Construction Material				
12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data				
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:				
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	X ALTERING CASING	
	CHANGE PLANS	COMMENCE DRILLING OP	NS. PLUG & ABANDONMENT	
PULL OR ALTER CASING Multiple Completion CASING TEST AND CEMENT JOB				
OTHER:				
	L			
 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 				
1. RUPU & RU.				
2. RU wire line & perforate tubing @4010'. RD wire line.				
3. ND wellhead/NU BOP.				
 POOH and lay down ESP equipment. Found hole in top seal which caused the motor to burn. RIH w/bit. Tag @4451'. POOH w/bit. 				
 RIH w/bit. Tag @4451'. POOH w/bit. RIH w/ESP equipment on 126 jts of 2-7/8" tubing. Intake set @4075' 				
7. ND BOP/NU wellhead.				
8. RDPU & RU. Clean location and return well to production.				
RUPU 06/27/2014				
RDPU 07/03/2014				
I hereby certify that the information above is t	rue and complete to the best of my knowl	edge and belief. I further certify t	hat any pit or below-grade tank has been/will be	
constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative OCD-approved				
closed according to NMOCD guidelines , a general permit or an (attached) alternative OCD-approved plan				
Mande (1) have 1				
SIGNATURE I I UNITY OF TOTAL TITLE Administrative Associate DATE 07/29/2014				
TYPE OR PRINT NAME Meney A. Jo	bhnson E-mail address:	mendy_johnson@oxy.com	TELEPHONE NO. 806-592-6280	
For State Use Only	K	N: + 1	Mala	
APPROVED BY	nown	TITLE DUCS	1/50/2014 1/50/2014	
CONDITIONS OF APPROVAL IF ANY:			JUL 3 0 2014	
V			JUL	
			n	

.

Work Plan Report for Well:NHSAU 545-33

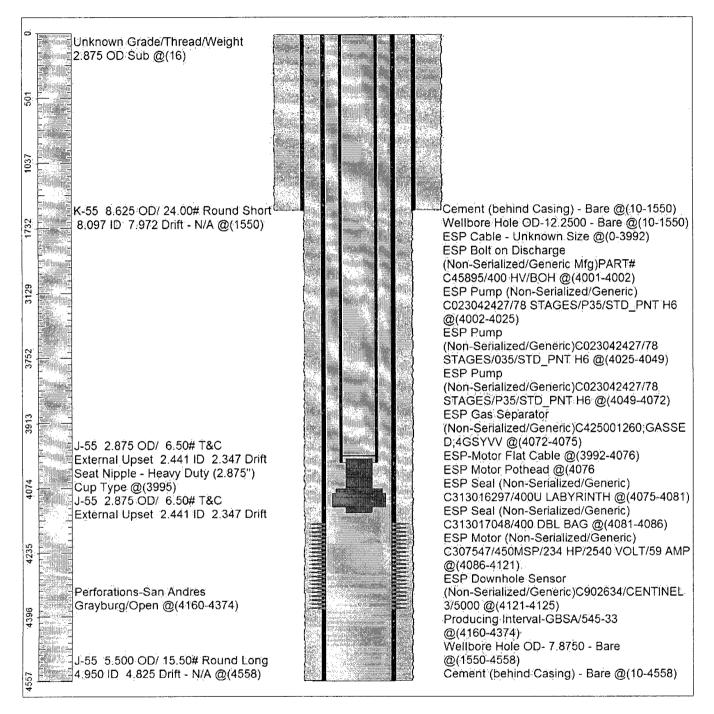

Survey Viewer