

HOBBS OCD

JUL 0 7 2015

RECEIVED

Devon Energy Center 333 West Sheridan Avenue Oklahoma City, Oklahoma 73102-5015

Hydrogen Sulfide (H₂S) Contingency Plan

For


Arena Roja Fed Unit 16H

Sec-27, T-26S R-35E 200' FNL & 60' FWL LAT. = 32.0209383'N (NAD83) LONG = 103.3636699'W

Lea County NM

Arena Roja Fed Unit 16H

This is an open drilling site. $H_2^{2}S$ monitoring equipment and emergency response equipment will be used within 500' of zones known to contain H_2S , including warning signs, wind indicators and H_2S monitor.

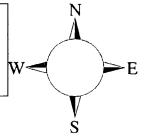

	8		44		
	17	16	~ =	4.4	,
			Arena Roja Fed Unit 16H		
	20	21	555	23	
	$D^{"}$	Loca	tion Road	26	
	32	33	34	35	

Assumed 100 ppm 3000' ()
100 ppm H2S concentration shall trigger activation of this plan.

Escape

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated from the location entrance road, West then Northwest on lease road. Crews should then block entrance to the location from the lease road so as not to allow anyone traversing into a hazardous area. The blockade should be at a safe distance outside of the ROE. There are no homes or buildings in or near the ROE.

Assumed 100 ppm ROE = 3000'

100 ppm H₂S concentration shall trigger activation of this plan.

Emergency Procedures

In the event of a release of gas containing H₂S, the first responder(s) must

- Isolate the area and prevent entry by other persons into the 100 ppm ROE.
- Evacuate any public places encompassed by the 100 ppm ROE.
- Be equipped with H₂S monitors and air packs in order to control the release.
- Use the "buddy system" to ensure no injuries occur during the response
- Take precautions to avoid personal injury during this operation.
- Contact operator and/or local officials to aid in operation. See list of phone numbers attached.
- · Have received training in the
 - o Detection of H₂S, and
 - o Measures for protection against the gas,
 - Equipment used for protection and emergency response.

Ignition of Gas Source

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO₂). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas

Characteristics of H₂S and SO₂

Common Name	Chemical Formula	Specific Gravity	Threshold Limit	Hazardous Limit	Lethal Concentration
Hydrogen Sulfide	H ₂ S	1.189 Air = 1	10 ppm	100 ppm/hr	600 ppm
Sulfur Dioxide	\$O ₂	2.21 Air = 1	2 ppm	N/A	1000 ppm

Contacting Authorities

Devon Energy Corp. personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. Devon Energy Corp. Company response must be in coordination with

the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER)

Hydrogen Sulfide Drilling Operation Plan

I. HYDROGEN SULFIDE (H2S) TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- 1. The hazards and characteristics of hydrogen sulfide (H₂S)
- 2. The proper use and maintenance of personal protective equipment and life support systems.
- 3. The proper use of H₂S detectors, alarms, warning systems, briefing areas, evacuation procedures, and prevailing winds.
- 4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H₂S metal components. If high tensile tubulars are to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- 3. The contents and requirements of the H₂S Drilling Operations Plan and Public Protection Plan.

There will be an initial training session just prior to encountering a known or probable H₂S zone (within 3 days or 500 feet) and weekly H₂S and well control drills for all personnel in each crew. The initial training session shall include a review of the site specific H₂S Drilling Operations Plan and the Public Protection Plan.

II. HYDROGEN SULFIDE TRAINING

Note: All H_2S safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonably expected to contain H_2S .

1. Well Control Equipment

- A. Flare line
- B. Choke manifold Remotely Operated
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit
- D. Auxiliary equipment may include if applicable: annular preventer and rotating head.
- E. Mud/Gas Separator

2. Protective equipment for essential personnel:

30-minute SCBA units located at briefing areas, as indicated on well site diagram, with escape units available in the top doghouse. As it may be difficult to communicate audibly while wearing these units, hand signals shall be utilized.

3. H₂S detection and monitoring equipment:

Portable H₂S monitors positioned on location for best coverage and response. These units have warning lights which activate when H₂S levels reach 10 ppm and audible sirens which activate at 15 ppm. Sensor locations:

- Bell nipple
- Shale shaker
- Trip tank

- Suction pit
- Rig floor
- Cellar

- Choke manifold
- Living Quarters (usually the company man's trailer stairs.)

Visual warning systems:

- A. Wind direction indicators as shown on well site diagram
- B. Caution/ Danger signs shall be posted on roads providing direct access to locations. Signs will be painted a high visibility yellow with black lettering of sufficient size to be reasonable distance from the immediate location. Bilingual signs will be used when appropriate.

4. Mud program:

The mud program has been designed to minimize the volume of H₂S circulated to surface. Proper mud weight, safe drilling practices and the use of H₂S scavengers will minimize hazards when penetrating H₂S bearing zones.

5. Metallurgy:

- A. All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold lines, and valves shall be H₂S trim.
- B. All elastomers used for packing and seals shall be H₂S trim.

6. Communication:

- A. Company personnel have/use cellular telephones in the field.
- B. Land line (telephone) communications at Office

7. Well testing:

- A. Drill stem testing will be performed with a minimum number of personnel in the immediate vicinity, which are necessary to safety and adequately conduct the test. The drill stem testing will be conducted during daylight hours and formation fluids will not be flowed to the surface. All drill-stem-testing operations conducted in an H₂S environment will use the closed chamber method of testing.
- B. There will be no drill stem testing.

Devon Energy Corp. Company Call List

Artesia (575)

Ass Dor Mor	eman – Robert Bell						
Agency Call List							
<u>Lea</u> <u>County</u> (575)	Hobbs 393-3981 State Police 392-5588 City Police 397-9265 Sheriff's Office 393-2515 Ambulance 911 Fire Department 397-9308 LEPC (Local Emergency Planning Committee) 393-2870 NMOCD 393-6161 US Bureau of Land Management 393-3612						
Eddy County (575)	Carlsbad State Police 885-3137 City Police 885-2111 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-2111 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 887-6544 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (Washington, DC) (800) 424-8802						
Give	Emergency Services 80015 & Coots IWC (800)-256-9688 or (281) 931-8884 Cudd Pressure Control (915) 699-0139 or (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Native Air – Emergency Helicopter – Hobbs (575) 392-6429						
GIVE GPS position:	Native Air – Emergency Helicopter – Hobbs (575) 392-6429 Flight For Life - Lubbock, TX (806) 743-9911 Aerocare - Lubbock, TX (806) 747-8923 Med Flight Air Amb - Albuquerque, NM (575) 842-4433 Lifeguard Air Med Svc. Albuquerque, NM (575) 272-3115						

Cellular

Office


Home

Prepared in conjunction with Dave Small

ORMUNICATIONS & CONSULTING, LLC



Devon Energy - Well Pad Rig Location Layout Safety Equipment Location

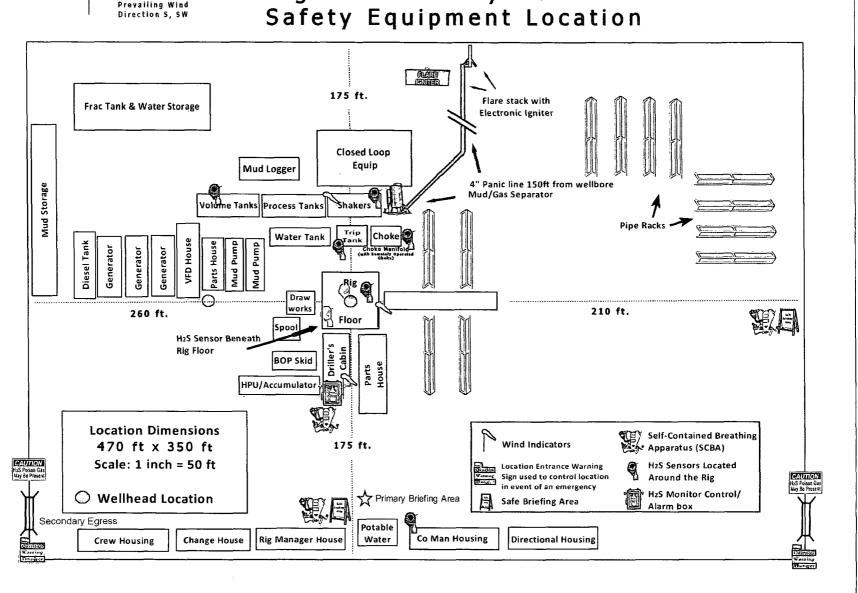

H&P Flex Rig Location Layout 2 Well Pad

